PHASE I ENVIRONMENTAL SITE ASSESSMENT

LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL

840-860 AND 887 FULTON MALL

FRESNO, CALIFORNIA

Prepared For:

Scott Johnson, Director
Economic Department of the City of Fresno
2600 Fresno Street
Fresno, California 93721

Prepared By:

Rebecca Fraser, Consultant Bulldog Properties, Inc 1540 Shaw Avenue, Suite 103 Fresno, CA 93710

TABLE OF CONTENTS

1.0	INTRODUCTION	25	4			
2.0	PURPOSE AND SC	<u>OPE</u>	4			
3.0	SITE INFORMATIO	<u>DN</u>	5			
4.0	4.3 Historical Cit4.4 Review of Ov4.5 Site Reconna	graph Review Insurance Review Ty Directory Review Winership and Use	5 5 5 6 6 6 6 6			
5.0	5.3 Historical Cit5.4 Review of Ov5.5 Site Reconna	Insurance Review by Directory Review wnership and Use issance and Permit Review	7 7 7 8 9 9 10 10			
6.0	EVALUATIONS 6.1 On-Site Cond 6.2 Off-Site Cond		11 11 11			
7.0	CONCLUSIONS		11			
8.0	LIMITATIONS		12			
9.0	CLOSING		12			
REFE	ERENCES		13			
APPE	ENDICES					
APPE	ENDIX 1	SITE LOCATION MAP AND TOPOGE	RAPHICS			
APPE	ENDIX 2	SANBORN MAPS AND AERIAL PHO	TOGRAPHS			
APPENDIX 3		CURRENT SITE PHOTOGRAPHS				
APPE	ENDIX 4	ENVIRONMENTAL QUESTIONNAIR	RE & DISCLOSURE STATEMENT			
APPF	ENDIX 5	ENVIRONMENTAL DATA RESEARC	CH (EDR) REPORT			

PHASE I ENVIRONMENTAL SITE ASSESSMENT

LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL

840-860 AND 887 FULTON MALL

FRESNO, CALIFORNIA

1.0 <u>INTRODUCTION</u>

This report summarizes the findings of a Phase I Environmental Site Assessment (Phase I) conducted on 840-860 Fulton Mall and 887 Fulton Mall in the City of Fresno, Fresno County, California (SITE). A SITE Location Map is presented as Drawing 1 in Appendix A.

The Phase I was performed consistent with the American Society for Testing and Materials (ASTM) Standard Practice for Environmental Site Assessments, Designation E-1527-00 (ASTM, 2000).

2.0 PURPOSE AND SCOPE

The purpose of the Phase I was to:

- Assess the environmental condition of the SITE based on the past and current existence (or absence) of
 impairments and the past existence of activities, practices, and materials which are subject to
 environmental regulation governing contamination of soil and / or groundwater; and
- Assess reported soil and groundwater contamination incidents in the surrounding area, up to a one-mile radius from the SITE, which could pose an environmental concern or impairment to the SITE.

The scope of work is summarized as follows:

- Conducted a reconnaissance of the SITE and accessible areas within one-quarter mile;
- Reviewed available historical resources to assess the history and past use of the SITE;
- Reviewed available regulatory agency files regarding the possible release of hazardous materials to the
 environment, up to one mile from the SITE. Facilities known to operate and / or maintain underground
 storage tanks (USTs) and / or aboveground storage tanks (ASTs) on-SITE or at adjoining properties
 were identified;
- Conducted interviews with readily available individuals who may have knowledge of the SITE;
- Reviewed an Environmental Questionnaire and Disclosure Statement completed by the current SITE owner;
- Reviewed data to assess potential environmental concerns or impairments as a result of the past and present activities at the SITE, existing SITE conditions, and conditions at nearby off-SITE properties; and
- Prepared this report summarizing the assessment procedures, findings, evaluations, and conclusions.

3.0 SITE INFORMATION

The SITE is developed with commercial and retail structures.

Current Address:

840-860 Fulton Mall and 887 Fulton Mall

Location:

The site exists within Section 10, Township 14 South, Range 20 East,

Mount Diablo Baseline and Meridian.

Assessor's Parcel Number:

468-255-07 and 468-284-21

Site Acreage:

30,000 square feet (840-860 Fulton Mall) and 11,250 square feet (887

Fulton Mall)

Existing Site Use:

Retail uses and restaurant

Proposed Site Use:

Mixed use commercial, residential and health club

SURROUNDING PROPERTY USE AND ZONING

	Zoning	Property Use
North	C-4	California Hotel (Senior Residents and restaurants)
South	C-4	Grizzly Stadium and retail
East	C-4	City of Fresno Parking structure and retail
West	C-4	Grizzly Stadium

4.0 ASSESSMENT PROCEDURES

This PHASE I consisted of gathering basic information concerning the SITE and its vicinity. Tasks performed to complete the PHASE I are summarized in the following subsections.

4.1 Aerial Photograph Review

Aerial photographs of the Site were reviewed at the City of Fresno Development Department and the Map Library at the California State University, Fresno, in Fresno, California. The findings of the aerial photograph review are summarized in Subsection 5.1

4.2 Sanborn Fire Insurance Map Review

Sanborn Fire Insurance Maps were reviewed at the Fresno County Library and the Map Library at California State University, Fresno, in Fresno, California. Sanborn Maps can provide historical information regarding a SITE. A summary of the results of the Sanborn Fire Insurance Map is presented in Subsection 5.2.

4.3 Historical City Directory Review

City directories published by R.L. Polk Directory were reviewed at the Fresno County Library. The city directories were reviewed for information concerning past and current occupancy of the Site. The findings of the historical city directory review are summarized in Subsection 5.3.

4.4 Review of Site Use

Data concerning past and current ownership and use of the Site were assembled from a variety of sources including records at the local building department, assessor's office and interviews with individuals having knowledge of the Site.

4.5 Site Reconnaissance

A reconnaissance of the Site was performed by Rebecca Fraser, planning consultant, on July 6, 2006. The findings of the Site reconnaissance are summarized in subsection 5.5. A Site plan depicting the Site, adjoining property use, and observed on-Site features is presented in Appendix 1. Photographs of the Site were taken during the reconnaissance and copies of selected photographs are presented in Appendix 3.

4.6 List, Record, Permit Review, and Interviews

Federal, state, and local government regulatory agency lists, records, and permits were researched for information regarding potential impacts to the Site by off-Site sources. A copy of the regulatory list check data report (Environmental Data Resources Report) is presented in Appendix 5. A summary of the list, record, and permits reviewed and respective search parameters for each is presented in Subsection 5.6. Findings of the list, record, and permit review are also summarized in Subsection 6.2.

4.7 Asbestos

Asbestos is a fibrous material and has been used in many different applications for its fireproofing abilities and resistance to many chemicals. Common uses of asbestos included thermal and acoustical insulation, fireproofing, textiles, concrete, plastic products such as vinyl floor tiles, roofing felts and paper and electrical insulation.

Asbestos containing materials are generally divided into two categories, friable and non-friable. A friable asbestos product is one that will crumble, pulverize or otherwise release dust by the application of hand pressure. In a non-friable asbestos containing building material, the asbestos is bound tightly in a matrix or sealed by a protective layer and the asbestos will not be released by hand pressure. Some material is friable as installed and remains friable throughout their lifetime in a building. Other materials are not friable when installed but may become friable due to damage, disturbance or decay. Friable materials or damaged non-friable materials are more likely to release fibers into the air and are therefore of greater concern. As of June 1978, the manufacture of all friable asbestos containing products in the United State (U.S.) was banned by the Environmental Protection Agency (EPA).

Recently imposed federal regulation which took effect on July 10, 1995, require that all fire-proofing, sprayed-on acoustical ceiling materials, thermal system insulation, floor tiles, other materials must be considered "Presumed Asbestos Containing Materials" (PACM) if installed in structures prior to 1980 unless sampling has determined that these materials are not asbestos containing.

5.0 FINDINGS

The findings of the PHASE I are presented in the following subsections.

5.1 Aerial Photograph Review

Available historical aerial photographs of the Site and vicinity for the years 1937, 1950, 1961, 1967, 1977, 1987, 1994 and 2002 were reviewed for indications of past Site use and / or Site activities which may have involved the manufacture, generation, use, storage and / or disposal of hazardous materials.

- In 1937, 1950 and 1957 Gottschalk's is constructed and there are several buildings located at 887 Fulton Mall. The site is surrounded by several commercial structures. Hotel Californian was located just northeast of the Site.
- In 1961, the Berkeley's Building was constructed. A large parking lot is located west of the Site.
- In 1973, the Fulton Mall becomes a pedestrian mall and parking lots are located south and west of the Site
- In the year 1977, 1987 and 1994, there were no changes to the Berkeley's and Gottschalk's Building and the surrounding properties.
- In the Year 2002, the Grizzly Stadium is fully constructed.

5.2 Sanborn Fire Insurance Map Review

The Site and surrounding property are included in Sanborn Maps in the Years 1888, 1898, 1906, 1918 and 1948.

840-860 Fulton Mall

- Year 1888 parcel is occupied with three single-family houses and an armory hall. The parcel east of the site is vacant. There are two large commercial structures on the north and west sides.
- Year 1898 the parcel has two single-family houses and the Armory Livery Stables. There is a single-family house on the parcel to the east of the site. There are two large commercial structures on the north and west.
- Year 1906 the site is now vacant; however the Armory Livery Stables are still on a portion of the site. There are shops and a painting store on the eastern parcel. A novelty theater is located on the parcel, west of the site.
- Year 1918 E. Gottschalk's & Company has now occupied the site. The building was constructed in 1913. The parcel east of the site is vacant. A Bakery and Row Wood parts is located north of the parcel. Van Ness Garage is also located north of the site. A wall paper, printing and picture framing shop are located on the west side of the Site. Kern Street has a median in the middle of the street.
- Year 1948 E. Gottschalk's & Company is located on the site. The Californian Hotel is located northwest of the Site. Furne Hotel parking is located east of the site.

887 Fulton Mall

• Year 1888 – the parcel is vacant; however it is surrounded by single-family houses on the north. The site on the east is vacant.

- Year 1898 the parcel is occupied with Hopkins Agricultural. A wo yard is located on the south side of the Site. There are vacant parcels on the east and west sides.
- Year 1906 central shops (machine works) and wood working building is located on the site. Apartments are located on the northern portion of the site. A wood yard, feed stables and a treatment center are located on the parcel south of the Site. Liquor store and a lodging area are also located on the parcel south of the site. A building labeled Portland is west of the site and agricultural imports is located on the parcel just east of the Site.
- Year 1918 central shops (machine shop), printing and other shops occupy the Site. There is a
 vulcanizing and auto repair shops east of the site. Billiards, restaurants and other shops are located
 south of the Site. A wood yard is located west of the Site. Kern Street has a median in the middle of the
 street.
- Year 1948 Furne Hotel is located on the parcel. Furne Hotel is also located southwest of the Site. A
 wood yard is still west of the Site.

5.3 Historical City Directory Review

The Polk city directories between 1951 and 1999 were reviewed. There were several owners of the commercial structures over the past 50 to 60 years.

840 through 860 Fulton Mall

The building record indicates that in 1913, a new structure (retail store) was constructed and a sign was installed. In 1920, a pent house was constructed on the top of the structure. In the Year 1922, the store was altered and re-roofed in 1936. In 1937 there were general alterations to the interior and stairs were re-built in 1943. The stairway to the basement was altered in 1944. In 1949, general alterations were made for a beauty parlor. In 1950 the mezzanine floor was altered and interior partitions were altered in 1954.

In 1954, minor repairs were made to the existing 3-story building and in 1959 interior alterations were made for the new owners (F. F. Black) E. Gottschalk's & Company. An electrical permit was approved for the Gottschalk's building in 1960. In 1961, the parking lot entrance was completed and the fitting rooms were remodeled. The City of Fresno sent the Gottschalk's & Company a letter in 1963, stating that they need to remove the extra cords and install receptacles. A sign was installed in 1963. The City of Fresno sent F.F. Black a letter stating that the fire sprinklers systems has developed a leak through the alarm system causing water to keep running onto the alley. In 1965, there was interior remodeling and in 1966, two windows were installed at the mezzanine office. Additions to offices and stairways occurred in 1968 and a temporary toy store was located in the parking lot of the Gottschalk's Department Store. A new sign was installed and minor alterations were made in 1969. Alterations to close the exit doors on the mall side were completed in 1972. Interior alterations occurred in 1974 after they received the dangerous building ordinance in 1973. In 1992, Twinning Laboratories, Inc inspected to current welding within the Fresno Discount Mall.

887 Fulton Mall

In June 1960, a building permit was approved to demolish the existing commercial structure. In October 1960, a building permit was obtained to construct a new commercial-retail building and to install a single-faced sign on Fulton Street side. In 1961, two cast aluminum trade marks were installed on the corner of the Building. In June 1968, new walls were installed inside the building. In 1984 a building permit was obtained for interior remodeling for new offices.

5.4 Review of Site Use

The sites have been owned by several different owners in the past 50 to 60 years. The building at 840-860 Fulton Mall was owned by Mr. Bloom since the early 1920's. In 1959, F.F. Black owned the property and he owned the property until 1976. In 1992, Jorge Capacete purchased the property. The current owner of the site is Dale Lee. The current owner of the E. Gottschalk's Building (840-860 Fulton Mall) did not respond to the questionnaire.

In 1960, the current owner of the 887 Fulton Mall was O.J. Woodward. From the 1968 through the 1980's, Berkeley Associates owned the building. In 1984, Eaton purchased the property. The current owners bought the property in 1988.

The current owner, Leon & Israel Green, of the Berkeley's Building (887 Fulton Mall) did respond to the questionnaire. Mr. Green completed the Environmental Questionnaire and Disclosure Statement. Mr. Green reported that he knew of no current or former ASTs, USTs, or disposal area on the Project Site. The site has been occupied as a store since the 1960's. Mr. Green reported that there was no site waste generation, storage or disposal of hazardous materials at the Site.

5.5 Site Reconnaissance

SUMMARY OF SITE RECONNAISSANCE OBSERVATIONS							
FEATURE	OBSERVED	NOT OBSERVED					
AST (other than propane and / or water ASTs)		X					
Chemical / pesticide / hazardous material storage area		X					
Debris		X					
Discolored or stained soil or water		X					
Electrical equipment (not owned by a utility)		X					
Pipes of unknown use or origin		X					
Ponding basins		X					
Storage drums		X					
Storm drains		X					
Structures (existing Gottschalk's and Berkeley's Buildings)	X						
Structures (evidence of former single-family houses and other shops)	X						
USTs or evidence of USTs		X					
Waste or wastewater discharge to surface or surface waters of Site (not storm water)		X					
Waste oil storage		X					
Water wells		X					

5.6 List, Record, and Permit Review

Information regarding the list, record and permit review findings is summarized in the table below.

SUMMARY OF REGULATORY LISTS AND RECORDS REVIEWED									
SUMMARY OF R	SEARCH	PROXIMITY TO SITE (miles)							
SOURCE	DATE	RADIUS (mile)	ON-SITE	WITHIN-1/4	1/4 - 1/2	1/2 - 1			
US EPA, CERCLIS LIST	4-2005	1/2	NONE	NONE	1	NA			
US EPA, NPL	1-2005	11	NONE	NONE	NONE	NONE			
US EPA, ERNS LIST	1-2005	SITE	NONE	NA	NA	NA			
US EPA, RCRA Hazardous Waste Generators	1-2005	SITE & adjoining	NONE	3	1	NA			
US EPA, RCRA TSD Facilities	4-2005	1/2	NONE	NONE	NA	NONE			
US EPA, CORRACTS Facilities	4-2005	1	NONE	NONE	NONE	NONE			
State Equivalent CERCLIS	1-2005	1	NONE	NONE	NONE	NONE			
CAL-EPA, DTSC, Annual Workplan sites	1-2005	1	NONE	NONE	NONE	NONE			
CAL-EPA, RWQCB List of Facilities with Leaking USTs	4-2005	1/2	NONE	5	21	NA			
CAL-EPA, IWMB SWIS List of Active and Inactive Landfills	4-2005	1/2	NONE	NONE	NONE	NA			
CAL-EPA, SWRCB List of Registered USTs	1-2005	SITE & adjoining	NONE	12	NA	NA			
FCEHD, List of Leaking UST	SITE & adjoining	NONE	NONE	NA	NA				
FFD, Hazardous Materials Incid	SITE & Adjoining	NONE	NONE	NA	NA				
FFD, Registered USTs	SITE	NONE	32	NA	NA				

5.7 ASBESTOS FINDINGS

Based on review of the building department records and aerial photographs, the structures currently located at 840-860 Fulton Mall and 887 Fulton Mall were constructed before the 1978 ban on the manufacture of friable asbestos containing material the recently imposed July 10, 1995 federal regulations. However, it is not known if asbestos containing materials are present in the on site structures. An asbestos survey and sampling of the on-site structures was not conducted as part of this investigation.

6.0 EVALUATION

An evaluation of the PHASE I findings is summarized in the following subsections.

6.1 On-Site Concerns

The site appears to have been vacant from 1900' to the early 1940's. There were no environmental concerns identified at the Site during this assessment. An asbestos survey and sampling on the on-site structures is recommended.

6.2 Off-Site Concerns

Those facilities identified on the regulatory list and record reviews which are considered to present a possible environmental concern to the Site were reviewed. The results of that review are presented as follows:

Gottschalk's Building located at 760 Fulton Mall, on site, has an inactive underground storage tank. The underground storage tank was full of oil. There were no reported leaks.

Broadway Furniture Parking Lot (former service station) located at 755 Broadway, approximately 714 feet south of the project SITE. This facility contained one Leaking Underground Storage Tank (LUST). Gasoline was detected in the soil in the July 27, 2004. The LUST was closed by the Fresno County Environmental Health Department and the site cleanup was complete on October 6, 2004.

Van Ness & Inyo Parking Lot is located at 750 Van Ness Avenue, approximately 728 feet east southeast of the SITE. This facility contained one Leaking Underground Storage Tank (LUST). In 1987 gasoline was detected in the soil and groundwater-no MTBE. Fresno County Environmental Health Department was the lead agency in the contaminated Lust's. The site cleanup is now complete and was closed in 1999.

Archives Record Storage is located 742 Fulton Street, approximately 758 feet southeast of the SITE. This facility contained one Leaking Underground Storage Tank (LUST). In 1992, gasoline was detected in the soil. Information on leak and status of the case is not reported.

Office Building is located on 850 "L" Street, approximately 804 feet east northeast of the SITE. This facility contained one Leaking Underground Storage Tank (LUST). In 1993, waste oil was detected in the soil when the tank was closed. Fresno County Environmental Health Department was the lead agency in the contaminated Lust's. The site cleanup was complete and the case was closed in 2002.

No information was found indicating that these impacts have affected or have migrated toward the Site. The environmental concern posed to the Site by off-Site sources appears low.

7.0 CONCLUSIONS

A Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E 1527-00 of the project site was performed. The assessment has revealed no evidence of recognized environmental conditions in connection with the project site.

The material content of this report is intended to be consistent with a standard of practice as defined by ASTM practice E 1527. However, the report format differs in style, arrangement, and presentation of material facts from the format described by ASTM. Only the current owner of the property was located or contacted for the Phase I Environmental Site Assessment.

8.0 LIMITATIONS

The purpose of an environmental assessment is to reasonably assess the potential for, or actual impact of, past practices on a given site which may pose an environmental impairment to it. No assessment is thorough enough to identify all potential environmental impairment at a given site. If environmental impairments have not been identified during the assessment, such a finding should not, therefore, be consistent as a guarantee of the absence of such conditions on the Site, but rather the result of the services performed within the scope, limitations, and cost of the work performed.

Information obtained from the aerial photographs is an interpretation of features observed in the photographs. Actual conditions at the Site may be different from those interpreted.

The conclusion presented in this report are solely professional opinions based on information provided regarding the Site and the findings of the reconnaissance and records search. Conclusions presented are based on conditions as they existed at the time the work was performed. Changes in existing conditions of the Site due to time lapse, natural causes, or operations adjacent to the Site may deem conclusions presented invalid, unless the changes are reviewed and the conclusions reevaluated. Such conditions may require additional field and laboratory investigations to assess if the conclusions are applicable considering the changed conditions.

9.0 CLOSING

I appreciate the opportunity to be of service to you on this project. If you have questions regarding this report, please feel free to contact me at (559) 213-3347.

Sincerely,

Rebecca Fraser, Planning Consultant

REFERENCES


American Society for Testing and Materials, 2000, ASTM Standards on Environmental Site Assessment for Commercial Real Estate, 2nd ed., E 1527-00, Philadelphia, Pennsylvania.

United States Department of Agriculture, 1971, United States Department of Agriculture, Soil Conservation Service, Soil Survey of Eastern Fresno County, California. Government Printing Office, Washington D.C.


United States Geological Survey Topographic Map, 7.5 Minute Series: Fresno North, California Quadrangle, 1981.

Fresno County Library


City of Fresno Development Department

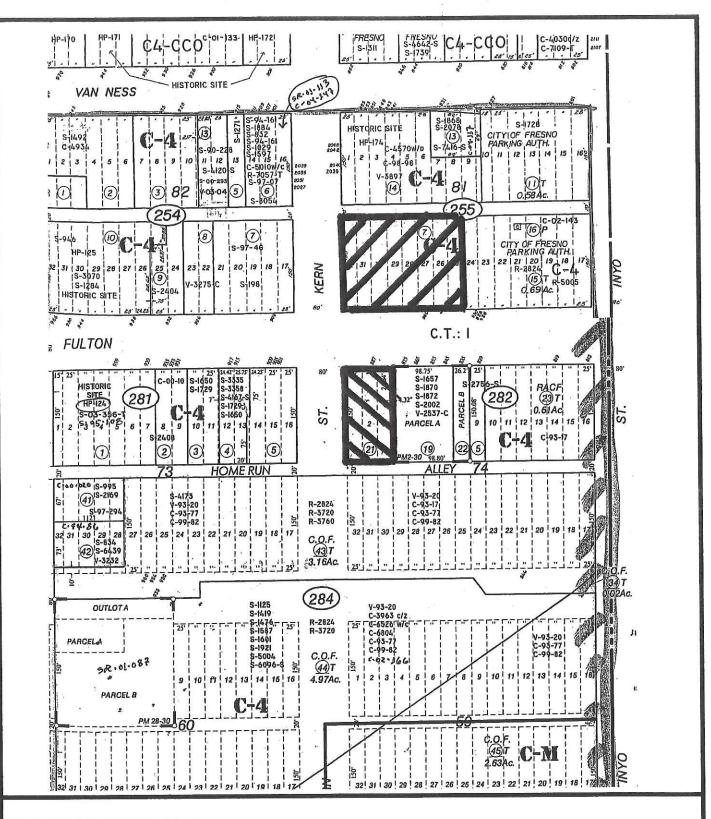


ASSESSOR PARCEL MAP LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

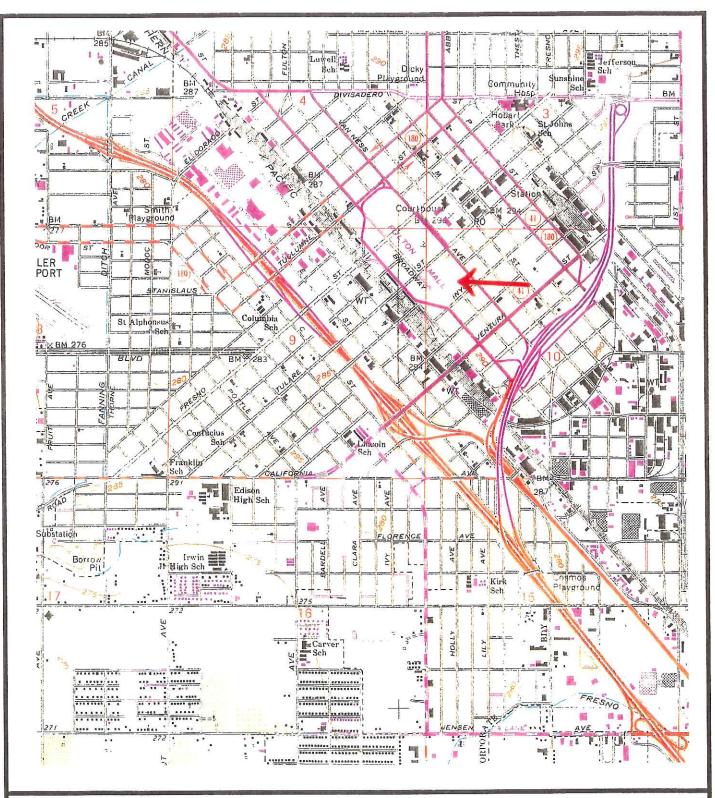


TOPOGRAPHIC MAP LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

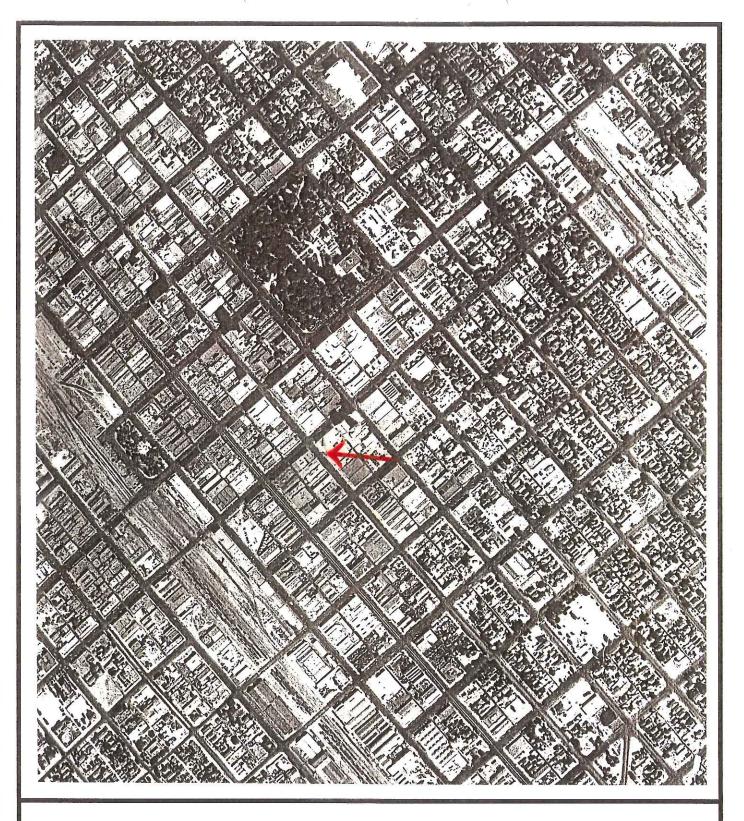


AERIAL PHOTO 1937 LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

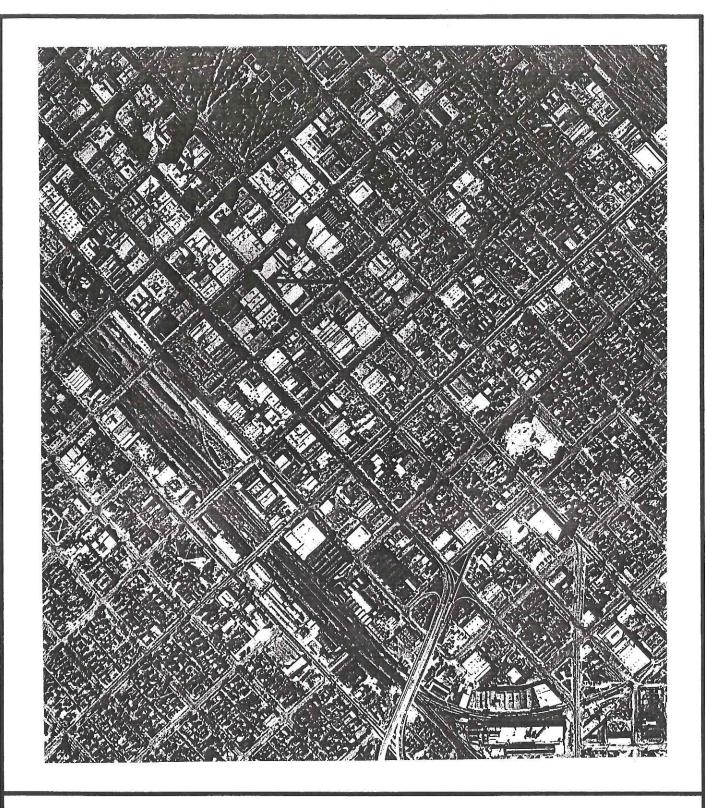


AERIAL PHOTO 1950 LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

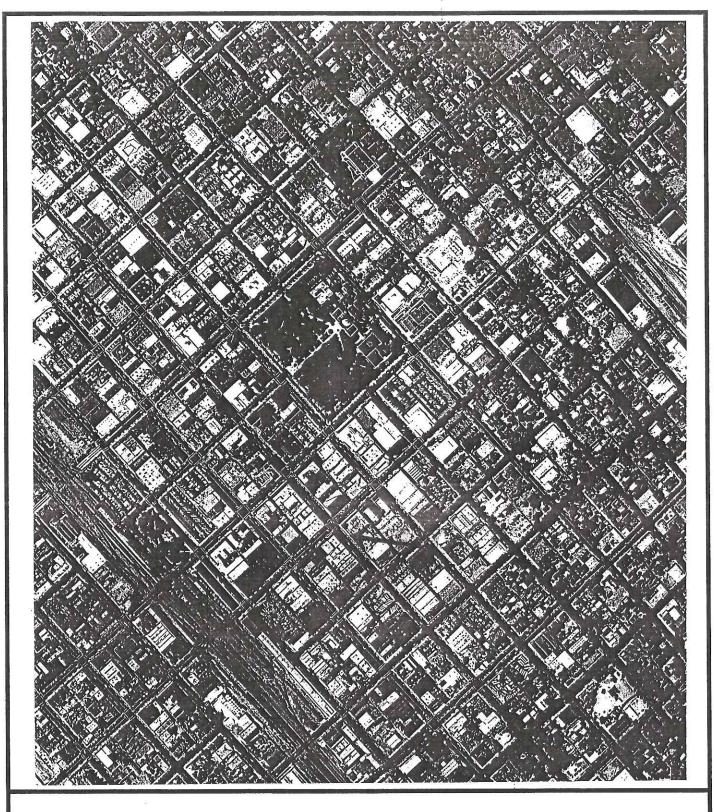


AERIAL PHOTO 1957 LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

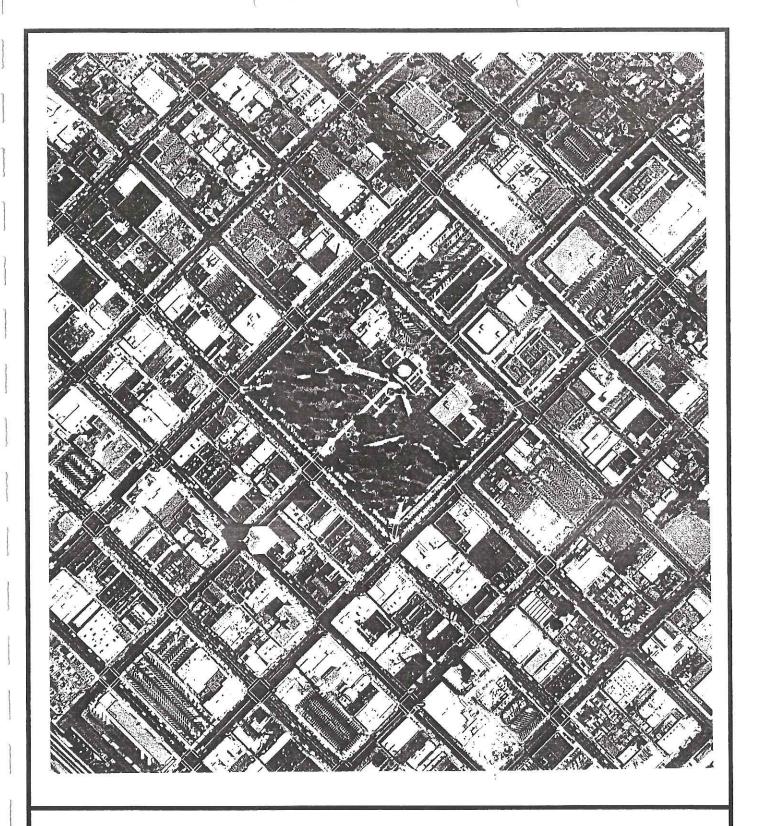


AERIAL PHOTO 1961 LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

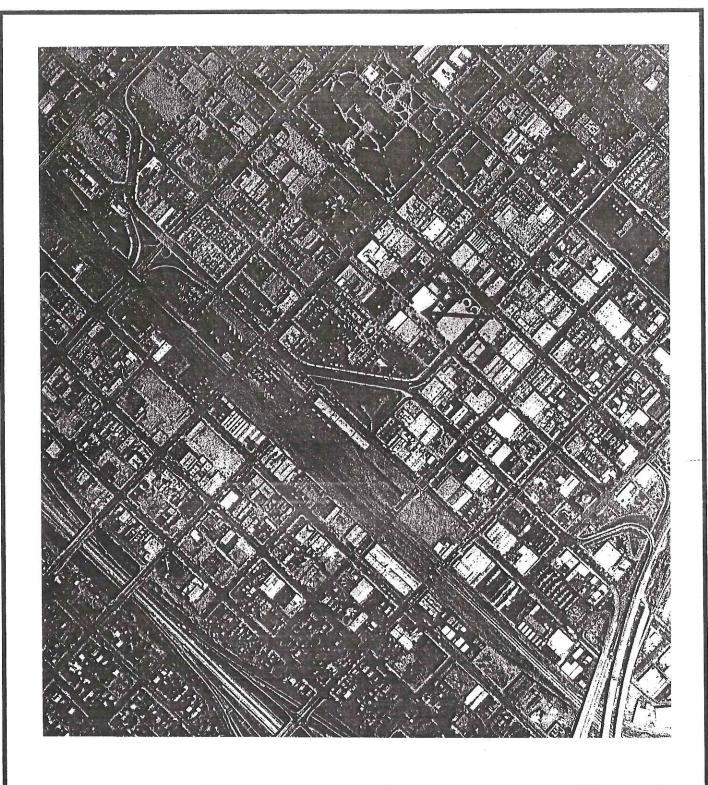


AERIAL PHOTO 1973 LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

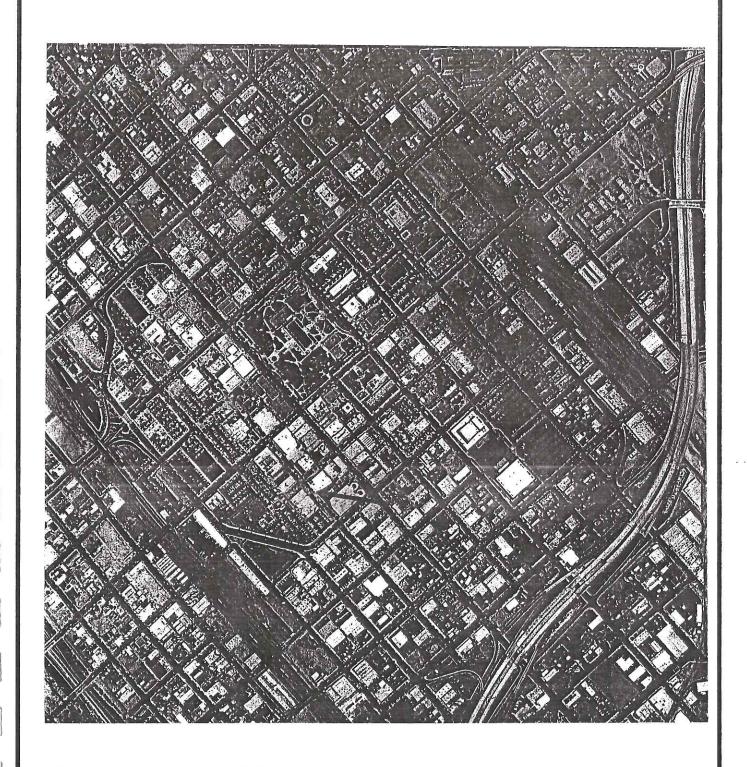


AERIAL PHOTO 1977 LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

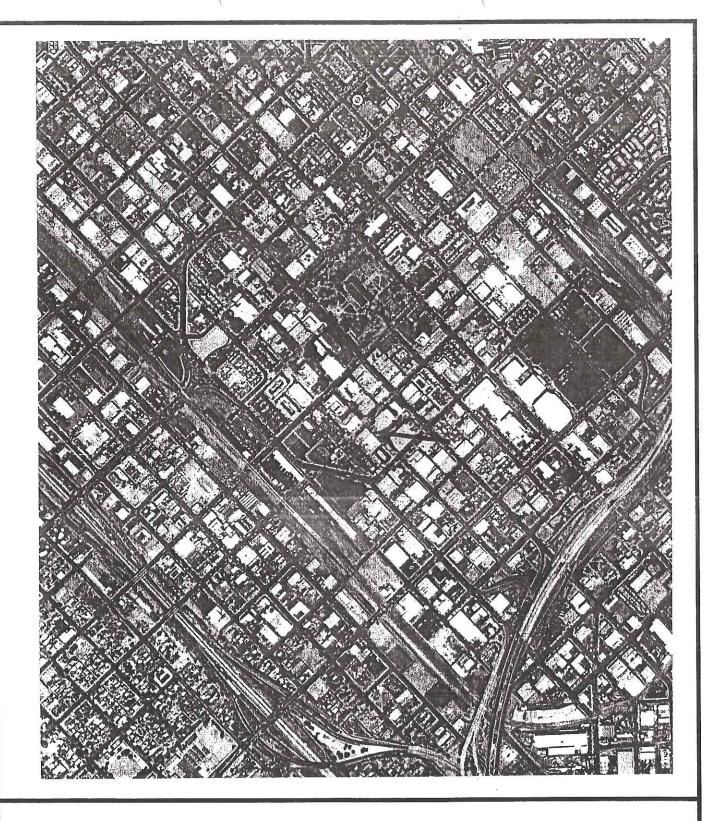


AERIAL PHOTO 1987 LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

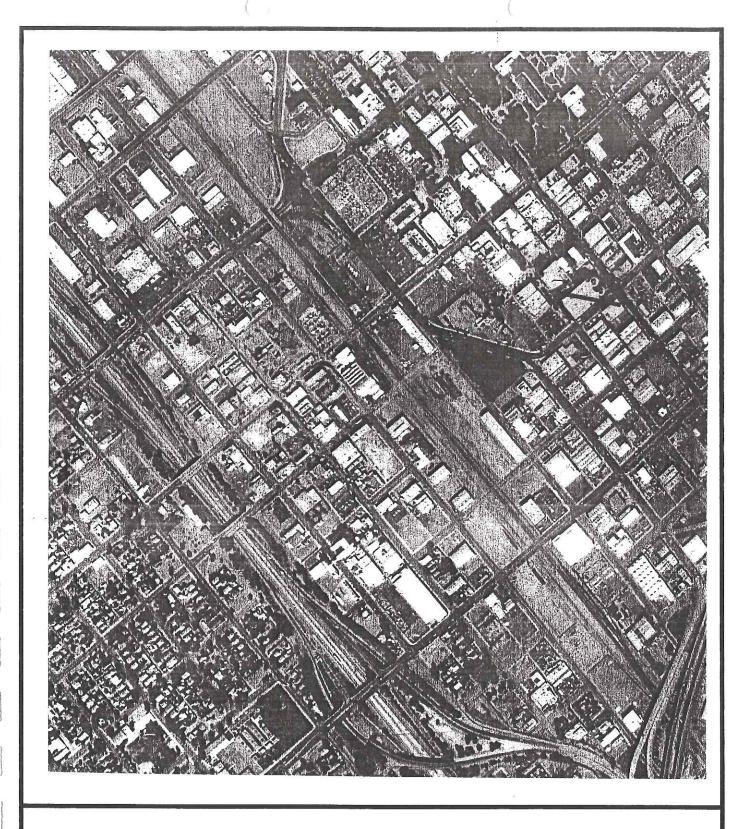


AERIAL PHOTO 1994 LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

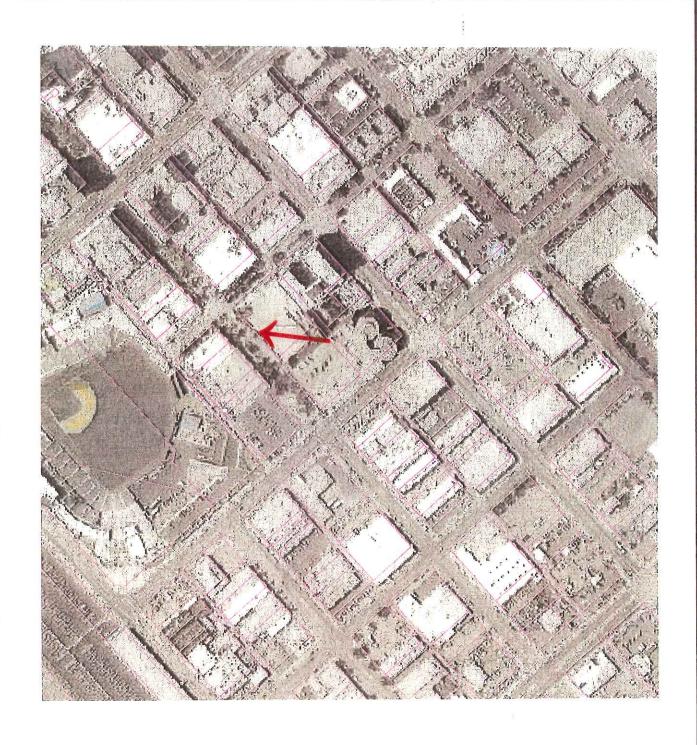


AERIAL PHOTO 2002 LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

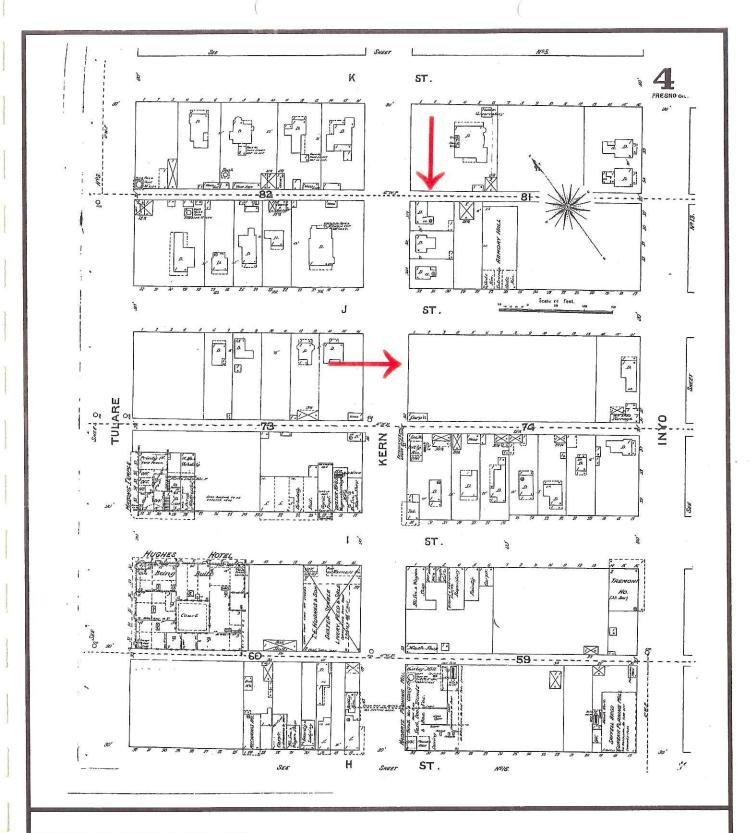


SANBORN MAP (YEAR 1888) LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

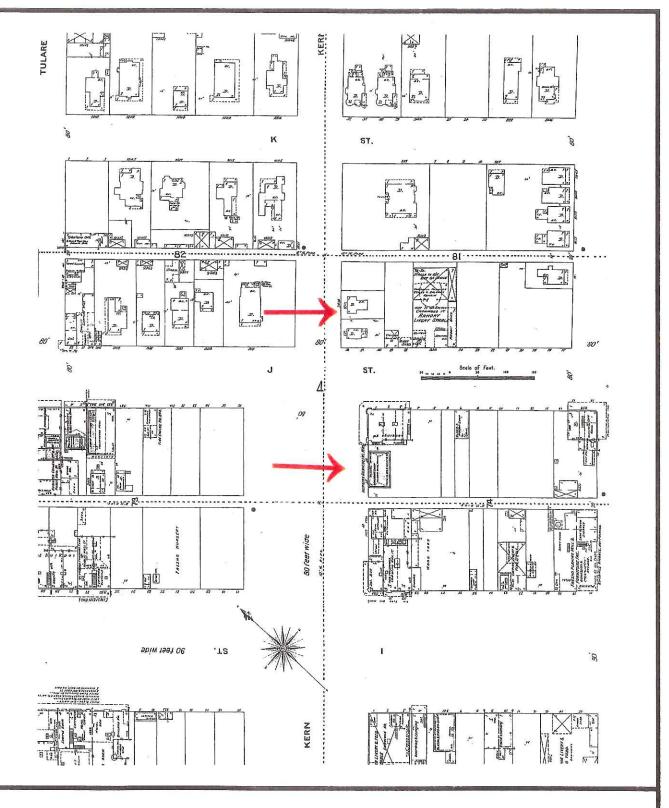


SANBORN MAP (YEAR 1898) LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

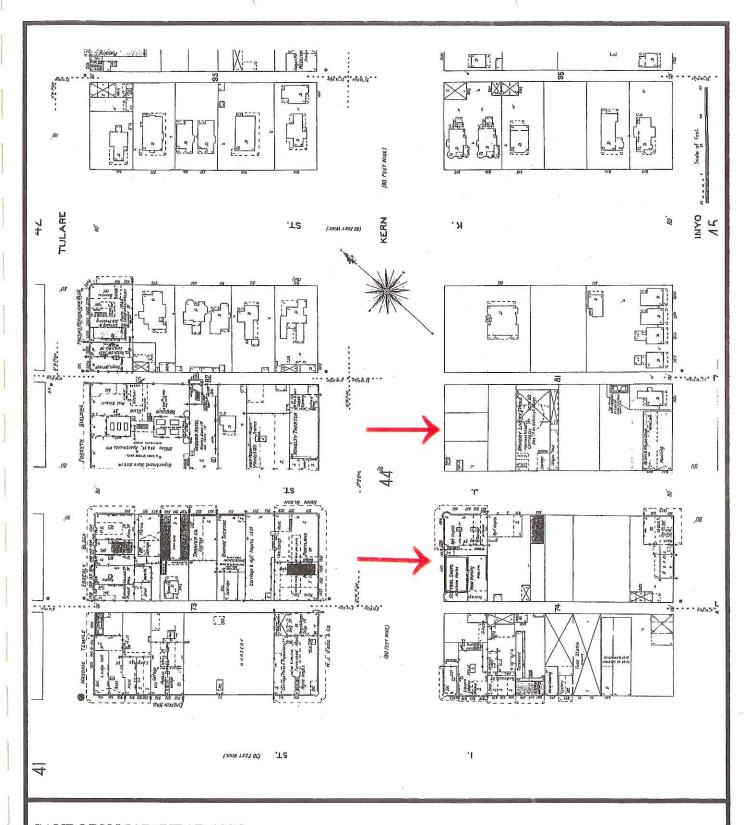

SANBORN MAP (YEAR 1906) LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

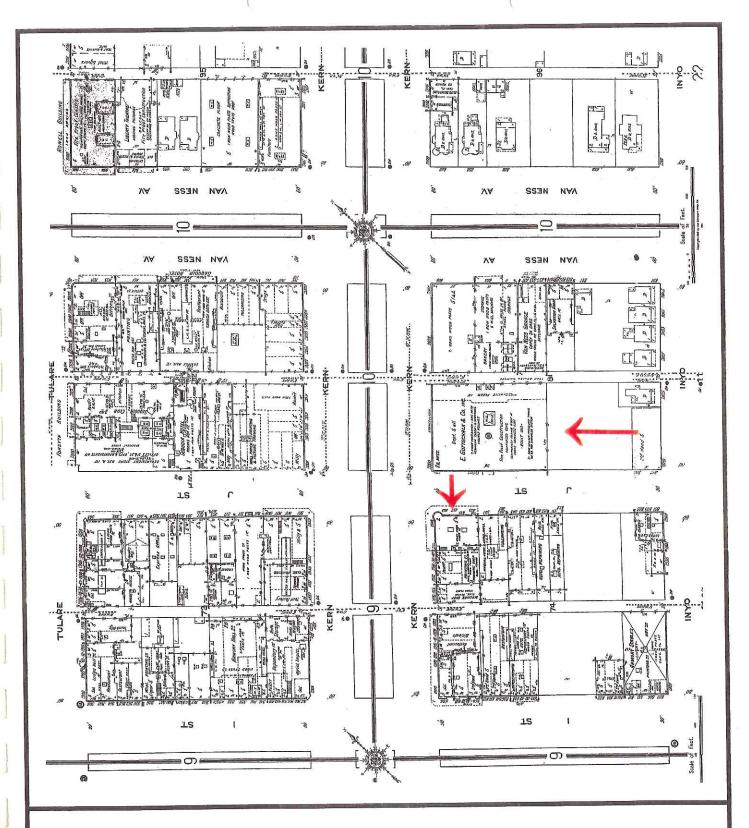

SANBORN MAP (YEAR 1918) LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA

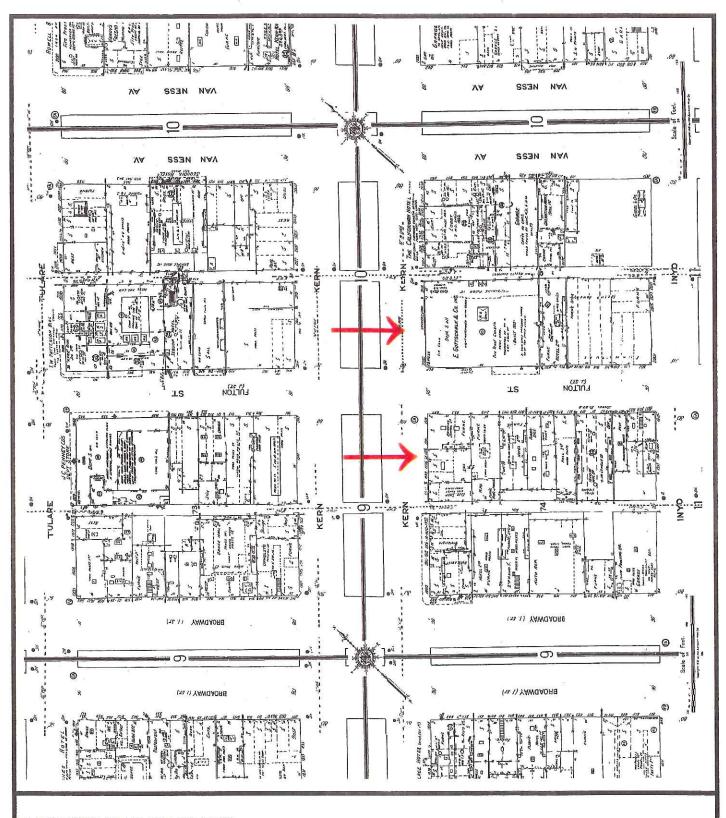

SANBORN MAP (YEAR 1948) LOCATED ON THE CORNER OF KERN STREET AND FULTON MALL 840-860 FULTON MALL (468-255-07) AND 887 FULTON MALL (468-282-21) FRESNO, CALIFORNIA




Former Gottschalks, looking east



Former Gottschalks, looking north



Former Gottschalks, looking southeast

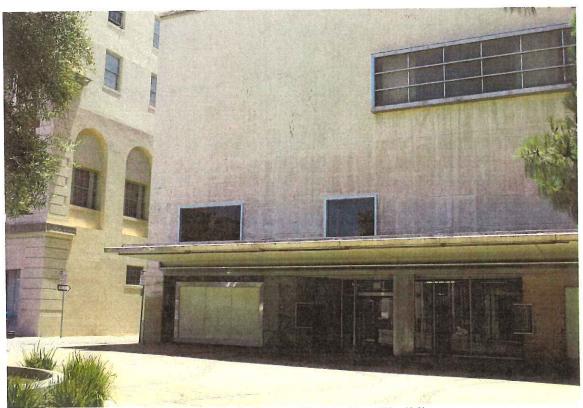

Former Gottschalks, northeast side of building



Former Gottschalks, looking south



Alley between former Gottschalks and the Californian



Looking South



Looking west



Parking structure next to the former Gottschalks




Former Gottschalks, looking northwest



Berkeley's Building, looking southwest



Berkeley's Building, looking south

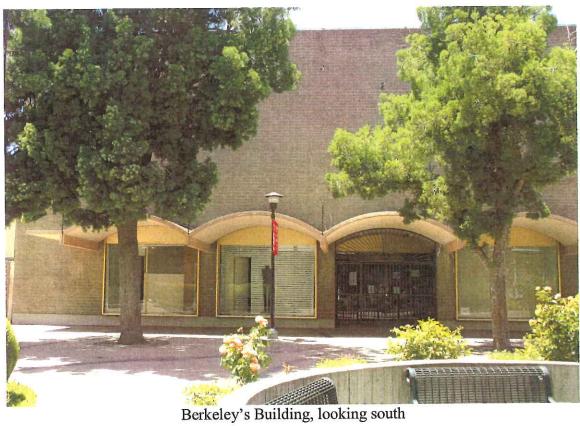



Berkeley's Building, looking toward the Grizzly Stadium




Southern portion of Berkeley's Building



Southern portion of Building




Back of Berkeley's Building

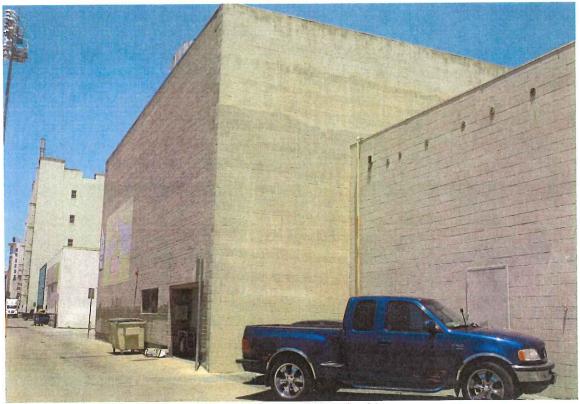

Back of Berkeley's Building, looking west



Berkeley's Building, looking north

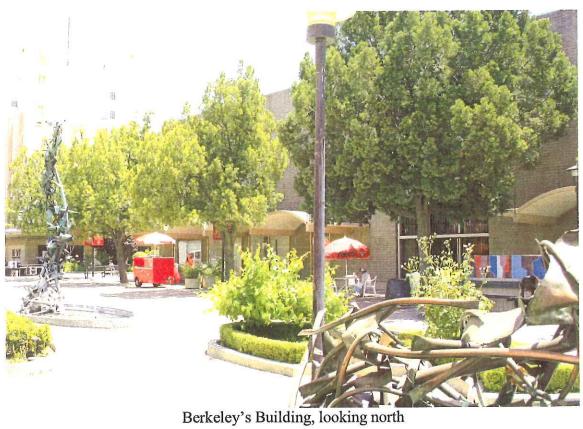

ENVIRONMENTAL QUESTIONNAIRE AND DISCLOSURE STATEMENT

GENERAL INSTRUCTIONS: Please fill-in the blanks to the best of your ability. If you do not know the answers, please check the "DON'T KNOW" box. If you answer "YES" or the answer requires explanation please use additional pages and reference the table. Thank you, for your time and cooperation.

SITE INFORMATION				
Current Site Address	887 Fulton Mall			
Current Site Use	Commercial Building			
Current Site Zoning	C-4	MANUAL TO A STATE OF THE STATE		
Current Assessor's Parcel Number	468-282-21			
Addresses Formerly Assigned to Site (if any)				

SITE OWNERSHIP AND PAST USE				
OWNER NAME, ADDRESS & PHONE #	PERIOD OF OWNERSHIP	TYPE OF USE		
Current: Leon - ISRAELA GREEK 40 W. Holland Auc Clous Coc	93612	Resail		
Former: EATON INSURGE Cy. Former:				
rormer:				

	ADJACENT PROPERTY USE	
DIRECTION	TYPE OF USE	LENGTH OF USE
North	Kern Street + Lufterbergs	Unknown
East.	Fulton MAII + Formar Gotschalks	
South	FORMAN INS Bulaing	Cı
West	Stadium-Grizzlia	, .

STRUCTURE DESCRIPTION	LOCATION	USE	DATE OF CONSTRUCTION
WOOD FARME, Power in place counts Comp. Rest	Sucken Fulty	Commercial	1960-1

STRUCTURE DESCRIPTION	FORMER LOCATION	USE	DATE OF DEMOLITION
	UN KNOW.	V	

SITE LESSEES				
NAME, ADDRESS & PHONE #	LENGTH / YEARS OF LEASE	TYPE OF USE		
Present: I Sal Aburto	1/2/03 ->	Restaurant/ SNACKBAR		
Former: Various Refail				
Former:				

SITE UTILITIES	
PROVIDER	1000
PGVE	Albert
P6.76	APPROXIMATION
City	A
City	
Citis	
City	
PETE	
	Literatus lineary organizacione de consegue anticon consegue con consegue

PLEASE PROVIDE DETAILS FOR ALL YES ANWSERS

#	SPECIFIC USES OF SITE OR	SITE			ADJACENT		
	ADJACENT PROPERTY	YES	NO	DON'T KNOW	YES	NO	DON'T
1	Agricultural chemical formulation, distribution, or application	· -	X				
2	Airport and / or airplane maintenance		X				
3	Automotive wrecking yard		X				
4	Bulk chemical or fuel storage		4				
5	Commercial printing		Х				
6	Dry Cleaning		X				
7	Landfill		À				
8	Metal plating or finishing		χ				36.5
9	Mining or minerals processing		X				
10	Motor vehicle or equipment repair and / or maintenance		X				
11	Photographic laboratory		χ				
12	Service station		X			£1==	
13	Skeet shooting or gun club		X				
14	Waste treatment, storage, disposal, processing or recycling, other than a landfill		X				

[&]quot;Adjacent Property" includes those properties that border the immediate site and properties located across the street from the site.

PLEASE PROVIDE DETAILS FOR ALL YES ANWSERS

			b va	27 47 7 7707
#	ON-SITE HAZARDOUS MATERIALS USE, STORAGE, AND DISPOSAL	YES	МО	DON'T KNOW
1	Are asbestos-containing materials present in on-site structures?		X	
2	Has an asbestos survey been conducted for on-site structures? yes, but do wot have a copy of.	Х		10.00
3	Are any electrical transformers or capacitors on-site?			_ ×
4	Are any electrical transformers or capacitors on-site not owned by an electrical utility?		N. 11	X
5	Has an Environmental Audit or Assessment been conducted for the site?			×
6	Do you know of any current or former aboveground storage tanks?		X	1
7	Do you know of any current or former underground storage tanks (not septic)?	2.	X	
8	Do you know of any fill dirt having been imported to the site?		X	
9	Do you know of any current or former wells on site, including, domestic drinking water, irrigation water, disposal, oil and / or abandoned wells?		X	
10	Do you know of any pesticides / herbicides permits for the site?		×	
11	Do you know of any pesticides / herbicides stored or used on- site?		X	
12	Are solvents, petroleum products, or paint products stored on- site?		X	
13	Are you aware of any permits having been issued for the site by the local fire, environmental health, or air pollution control agencies?			X

PLEASE PROVIDE DETAILS FOR ALL YES ANWSERS

#	SITE WASTE GENERATION, STORAGE AND DISPOSAL	YES	NO	DON'T KNOW
1	Is liquid waste disposed of to a septic tank on-site?	X		
2	Is liquid waste disposed of elsewhere on-site?		Х	
3	Are any ponds, sumps, basins, lagoons, or clarifiers used on- site to collect, treat, or dispose of liquid?		X	
4	If liquid waste is disposed of on-site, is a waste discharge permit required?		•	
5	Is liquid waste disposed of to an off-site treatment works?		X	
6	Is solid waste disposed of on-site (burned or buried)?		X	
7	Does any solid or liquid off-site waste disposal require a waste manifest or disposal permit?		×	4444
8	Is any hazardous waste generated, stored, or treated on-site?		X	
9	Are any spills or releases of hazardous materials known or suspected to have occurred at the site?		X	19gy
10	Is there another individual who may have additional or more complete information regarding the former use and activities at the site?			×

THIS ENVIRONMENTAL QUESTIONNAIRE AND DISCLOSURE STATEMENT WAS PREPARED BY:

Name: Leon Green	Title:	7	Wer
Firm: Ouvel	_ Relationship to S		SWILER
Address: 40 w. Halland	Clavis 936	3/2	***
			1
Telephone Number: 291. 3396	Date: 6	1/20	106
PREPARER REPRESENTS THAT	TO THE BEST OF	FTHE	PREPARÊR'S KNOWLEDGE
THE ABOVE STATEMENTS AND			
THE BEST OF THE PREPARER'S	KNOWLEDGE N	O MAI	TERIAL FACTS HAVE
BEEN SUPPRASSED OR MISSTA	TED.		/
cheen.		_	6/20/06
Signature			Date



The EDR Radius Map with GeoCheck®

Gottschalks / Berkeleys 840-880 Fulton Mall Fresno, CA 93721

Inquiry Number: 1706388.1s

June 28, 2006

The Standard in Environmental Risk Management Information

440 Wheelers Farms Road Milford, Connecticut 06461

Nationwide Customer Service

Telephone: 1-800-352-0050 Fax: 1-800-231-6802 Internet: www.edrnet.com

TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map	2
Detail Map.	3
Map Findings Summary	. 4
Map Findings.	. 6
Orphan Summary.	. 94
EPA Waste Codes.	EPA-1
Government Records Searched/Data Currency Tracking.	GR-1
GEOCHECK ADDENDUM	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary.	. A-2
Physical Setting SSURGO Soil Map	. A-5
Physical Setting Source Map.	. A-10
Physical Setting Source Map Findings	A-11
Physical Setting Source Records Searched	Δ-36

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

840-880 FULTON MALL FRESNO, CA 93721

COORDINATES

Latitude (North): Longitude (West): 36.732700 - 36° 43' 57.7"

Universal Tranverse Mercator: Zone 11

119.788800 - 119° 47' 19.7"

UTM X (Meters): UTM Y (Meters):

250963.4 4068644.5

Elevation:

292 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:

36119-F7 FRESNO SOUTH, CA

Most Recent Revision:

1981

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

FEDERAL RECORDS

National Priority List

Proposed NPL Proposed National Priority List Sites
Delisted NPL National Priority List Deletions
NPL RECOVERY Federal Superfund Liens CORRACTS...... Corrective Action Report

ERNS..... Emergency Response Notification System

HMIRS..... Hazardous Materials Information Reporting System

US ENG CONTROLS...... Engineering Controls Sites List US INST CONTROL...... Sites with Institutional Controls DOD...... Department of Defense Sites

FUDS....... Formerly Used Defense Sites US BROWNFIELDS....... A Listing of Brownfields Sites

CONSENT..... Superfund (CERCLA) Consent Decrees

ROD...... Records Of Decision UMTRA..... Uranium Mill Tailings Sites ODI_____Open Dump Inventory

TRIS...... Toxic Chemical Release Inventory System

TSCA..... Toxic Substances Control Act

FTTS______FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

SSTS...... Section 7 Tracking Systems

ICIS..... Integrated Compliance Information System

PADS..... PCB Activity Database System MLTS..... Material Licensing Tracking System

MINES..... Mines Master Index File

FINDS...... Facility Index System/Facility Registry System

STATE AND LOCAL RECORDS

AWP..... Annual Workplan Sites

NFA...... No Further Action Determination NFE...... Properties Needing Further Evaluation

REF...... Unconfirmed Properties Referred to Another Agency

SCH..... School Property Evaluation Program Toxic Pits _____ Toxic Pits Cleanup Act Sites SWF/LF_____ Solid Waste Information System

CA WDS...... Waste Discharge System
WMUDS/SWAT...... Waste Management Unit Database

AST..... Aboveground Petroleum Storage Tank Facilities CHMIRS...... California Hazardous Material Incident Report System

DEED...... Deed Restriction Listing

VCP..... Voluntary Cleanup Program Properties

CLEANERS Cleaner Facilities
WIP WIP Well Investigation Program Case List

CDL Clandestine Drug Labs HAZNET Facility and Manifest Data EMI_____ Emissions Inventory Data

TRIBAL RECORDS

INDIAN RESERV...... Indian Reservations

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

INDIAN UST...... Underground Storage Tanks on Indian Land

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in bold italics are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

FEDERAL RECORDS

CERCLIS: The Comprehensive Environmental Response, Compensation and Liability Information System contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

A review of the CERCLIS list, as provided by EDR, and dated 02/01/2006 has revealed that there is 1 CERCLIS site within approximately 0.5 miles of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
PG&E GAS PLANT FRESNO 325 3A	F/MARIPOSA BET F G FRES	1/4 - 1/2 W	Q70	60

CERCLIS-NFRAP: Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

A review of the CERC-NFRAP list, as provided by EDR, and dated 02/01/2006 has revealed that there are 3 CERC-NFRAP sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
SIERRA NATIONAL FOREST	1130 O STREET	1/4 - 1/2NNE	85	79
Lower Elevation	Address	Dist / Dir	Map ID	Page
WILSHIRE PAINT CO	701 & 712 FULTON ST	0 - 1/8 SE	A5	7

RCRAInfo: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System(RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-TSDF list, as provided by EDR, and dated 03/09/2006 has revealed that there is 1 RCRA-TSDF site within approximately 0.5 miles of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
VOPAK USA INCORPORATED	1152 G STREET	1/4 - 1/2W	76	66

RCRAInfo: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System(RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-LQG list, as provided by EDR, and dated 03/09/2006 has revealed that there is 1 RCRA-LQG site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
WILSHIRE PAINT CO	712 FULTON ST	1/8 - 1/4SE	C21	19

RCRAInfo: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System(RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-SQG list, as provided by EDR, and dated 03/09/2006 has revealed that there are 2 RCRA-SQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
WHEEL CREATIONS PLUS	706 H ST	1/8 - 1/45	44	37
Lower Elevation	Address	Dist / Dir	Map ID	Page
DENSMORE ENGINE RE-NU & SUPPLY	665 FULTON ST	1/8 - 1/4SE	H33	27

STATE AND LOCAL RECORDS

CAL-SITES: Formerly known as ASPIS, this database contains both known and potential hazardous substance sites. The source is the California Department of Toxic Substance Control.

A review of the Cal-Sites list, as provided by EDR, and dated 08/08/2005 has revealed that there is 1 Cal-Sites site within approximately 1 mile of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
PG&E G STREET SUBSTATION	1131 G STREET	1/4 - 1/2 W	Q72	61
Facility Status: BACKLOG, POTENTIAL A	NNUAL WORKPLAN (AWP) SITE		2012-01/201	100 PM

BEP: Department of Health Services developed a site-specific expenditure plan as the basis for an appropriation of Hazardous Substance Cleanup Bond Act funds. It is not updated.

A review of the CA BOND EXP. PLAN list, as provided by EDR, and dated 01/01/1989 has revealed that there is 1 CA BOND EXP. PLAN site within approximately 1 mile of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
FRESNO COUNTY EMPLOYEES CREDIT	2211 MERCED STREET	1/4 - 1/2 NNW	R79	72

CORTESE: This database identifies public drinking water wells with detectable levels of contamination, hazardous substance sites selected for remedial action, sites with known toxic material identified through the abandoned site assessment program, sites with USTs having a reportable release and all solid waste disposal facilities from which there is known migration. The source is the California Environmental Protection Agency/Office of Emergency Information.

A review of the Cortese list, as provided by EDR, and dated 04/01/2001 has revealed that there are 19 Cortese sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
VAN NESS & INYO PARKING LOT	750 VAN NESS AVE	1/8 - 1/4 ESE	D13	11
OFFICE BLDG	850 L ST	1/8 - 1/4 ENE	E16	16
ACE S/S	565 BROADWAY	1/4 - 1/2SSE	P64	53
FRESNO CITY POLICE DEPT.	2323 MARIPOSA	1/4 - 1/2 N	66	54
ABANDONED S/S	655 G ST	1/4 - 1/2SSW	68	<i>57</i>
S & J MINI MART	476 H ST	1/4 - 1/2SSE	77	70
FRESNO CLINTON B.P.	2409 FRESNO ST N	1/4 - 1/2 N	82	<i>75</i>
KALASHIAN PACKING CO.	401 H ST	1/4 - 1/2SSE	86	80
DEPT OF TRANSPORTATION	1283 WEST AVE N	1/4 - 1/2 N	91	<i>87</i>
TWINING LABORATORIES INC	2527 FRESNO ST	1/4 - 1/2NNE	92	89
Lower Elevation	Address	Dist / Dir	Map ID	Page
ARCHIVES RECORD STORAGE	742 FULTON ST	1/8 - 1/4SE	C14	13
DEL MONTE FOODS PARKING L	1626 TULARE	1/4 - 1/2 WSW	060	48
DEL MONTE	1625 TULARE	1/4 - 1/2WSW	O61	49
JENSEN & PILEGARD	1111 G ST	1/4 - 1/2 W	Q69	58
PG&E G STREET SUBSTATION	1131 G	1/4 - 1/2 W	Q71	61
FRESNO CO. CREDIT UNION	2211 MERCED	1/4 - 1/2 NNW	R81	75
BLUES AUTO	620 F ST	1/4 - 1/2SSW	83	76
ADAM'S AUTOMOTIVE	1402 VAN NESS AVE N	1/4 - 1/2 NNW	89	84
PEPSI-COLA BOTTLING CO	1150 NORTH AVE E	1/4 - 1/2 W	90	86

SWRCY: A listing of recycling facilities in California.

A review of the SWRCY list, as provided by EDR, and dated 04/07/2006 has revealed that there is 1 SWRCY site within approximately 0.5 miles of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
MERCADO PLAZA PARTNERS	1435 FRESNO ST	1/4 - 1/2 W	88	84

LUST: The Leaking Underground Storage Tank Incident Reports contain an inventory of reported leaking underground storage tank incidents. The data come from the State Water Resources Control Board Leaking Underground Storage Tank Information System.

A review of the LUST list, as provided by EDR, and dated 04/10/2006 has revealed that there are 26 LUST sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
VAN NESS & INYO PARKING LOT Facility Status: Case Closed	750 VAN NESS AVE	1/8 - 1/4 ESE	D13	11
OFFICE BLDG Facility Status: Case Closed	850 L ST	1/8 - 1/4 ENE	E16	16
ACE TIRE Facility Status: Case Closed	565 BROADWAY	1/4 - 1/2SSE	P63	51
HARON MOTOR SALES Facility Status: Case Closed	2222 VENTURA	1/4 - 1/2 ESE	<i>65</i>	<i>53</i>
FRESNO CITY POLICE DEPT. Facility Status: Leak being confirmed	2323 MARIPOSA	1/4 - 1/2N	66	54
FRESNO COUNTY JAIL Facility Status: Leak being confirmed	1155 M ST	1/4 - 1/2N	67	56
ABANDONED S/S Facility Status: Preliminary site assessment und	655 G ST	1/4 - 1/2SSW	68	<i>57</i>
FELIX AUTO MECHANIC Facility Status: Case Closed	804 F ST	1/4 - 1/2SW	73	62
TRINI'S BEACON Facility Status: Leak being confirmed	603 G ST	1/4 - 1/25	<i>75</i>	64
S & J MINI MART Facility Status: Case Closed	476 H ST	1/4 - 1/2SSE	77	70
FRESNO CLINTON B.P. Facility Status: Preliminary site assessment work	2409 FRESNO ST N	1/4 - 1/2N	82	<i>75</i>
FIRE DEPT HEADQUARTERS Facility Status: Pollution Characterization	450 M ST	1/4 - 1/2ESE	84	78
KALASHIAN PACKING CO. Facility Status: Leak being confirmed	401 H ST	1/4 - 1/2SSE	86	80
DEPT OF TRANSPORTATION Facility Status: Case Closed	1283 WEST AVE N	1/4 - 1/2N	91	87
TWINING LABORATORIES INC Facility Status: Case Closed	2527 FRESNO ST	1/4 - 1/2 NNE	92	89
Lower Elevation	Address	Dist / Dir	Map ID	Page
BROADWAY FURNITURE PARKING LOT Facility Status: Case Closed	755 BROADWAY	1/8 - 1/4S	B8	8
ARCHIVES RECORD STORAGE Facility Status: Leak being confirmed	742 FULTON ST	1/8 - 1/4SE	C14	13
GREYHOUND BUS DEPOT Facility Status: Pollution Characterization	1033 BROADWAY	1/8 - 1/4 W	J45	37
DEL MONTE FOODS PARKING L Facility Status: Case Closed	1626 TULARE	1/4 - 1/2 WSW	O60	48
YORKSHIRE DRIED FRUIT&NUTS INC Facility Status: Case Closed	1625 TULARE ST	1/4 - 1/2WSW	062	49

Lower Elevation	Address	Dist / Dir	Map ID	Page
JENSEN & PILEGARD Facility Status: Case Closed	1111 G ST	1/4 - 1/2W	Q69	58
FRESNO CO EMPLOYEES CREDIT UN Facility Status: Case Closed	2211 MERCED ST	1/4 - 1/2NNW	R80	72
BLUES AUTO Facility Status: Case Closed	620 FST	1/4 - 1/2SSW	83	76
FRANKS SERVICE STATION Facility Status: Case Closed	1060 E ST	1/4 - 1/2WSW	87	81
ADAM'S AUTOMOTIVE Facility Status: Pollution Characterization	1402 VAN NESS AVE N	1/4 - 1/2NNW	89	84
PEPSI-COLA BOTTLING CO Facility Status: Case Closed	1150 NORTH AVE E	1/4 - 1/2W	90	86

CA FID: The Facility Inventory Database contains active and inactive underground storage tank locations. The source is the State Water Resource Control Board.

A review of the CA FID UST list, as provided by EDR, and dated 10/31/1994 has revealed that there are 12 CA FID UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
VAN NESS & INYO PARKING LOT	750 VAN NESS AVE	1/8 - 1/4 ESE	D13	11
FORMER SHELL STATION	2210 KERN ST	1/8 - 1/4 NE	F24	21
PEP BOYS #624	716 BROADWAY	1/8 - 1/4SSE	G29	24
GOLDEN STATE PLAZA	2220 TULARE	1/8 - 1/4NNE	134	27
ADVANTAGE TIRE SERVICE	650 FULTON	1/8 - 1/4SE	H38	31
FRESNO OFFICE MACHINES	660 VAN NESS	1/8 - 1/4 ESE	K40	34
SECURITY BANK GARAGE	1060 FULTON MALL	1/8 - 1/4 NW	L43	36
HAL'S TRUCK RENTAL	621 VAN NESS	1/8 - 1/4 ESE	N59	46
Lower Elevation	Address	Dist / Dir	Map ID	Page
GOTTSCHALKS	760 FULTON MALL	0 - 1/8 SE	A2	6
ARCHIVES RECORD STORAGE	742 FULTON ST	1/8 - 1/4SE	C14	13
HOBBS PARSONS PRODUCE	951 H ST	1/8 - 1/4 W	J39	32
GREYHOUND BUS DEPOT	1033 BROADWAY	1/8 - 1/4W	J46	40

CA SLIC: SLIC Region comes from the California Regional Water Quality Control Board.

A review of the SLIC list, as provided by EDR, and dated 04/10/2006 has revealed that there are 3 SLIC sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page	
FMFCD - NURP Facility Status: Case Closed	2100 TULARE ST, ROWELL	1/8 - 1/4 N	7	8	
Lower Elevation	Address	Dist / Dir	Map ID	Page	
PG&E G STREET SUBSTATION Facility Status: Case Open	1131 G STREET	1/4 - 1/2 W	Q72	61	

Lower Elevation	Address	Dist / Dir	Map ID	Page
VOPAK USA INCORPORATED Facility Status: Remediation Plan	1152 G STREET	1/4 - 1/2 W	76	66

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the State Water Resources Control Board's Hazardous Substance Storage Container Database.

A review of the UST list, as provided by EDR, and dated 04/10/2006 has revealed that there is 1 UST site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
PEP BOYS #624	716 BROADWAY	1/8 - 1/4SSE	G30	24

HIST UST: Historical UST Registered Database.

A review of the HIST UST list, as provided by EDR, and dated 10/15/1990 has revealed that there are 9 HIST UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page	
RUBEN SHELL SERVICE PEP BOYS-FRESNO #24 GOLDEN STATE PLAZA FRESNO OFFICE MACHINES SECURITY BANK GARAGE EDUCATION CENTER HAL'S TRUCK RENTAL	2210 KERN ST 716 BROADWAY ST 2220 TULARE ST 660 VAN NESS AVE 1060 FULTON MALL TULARE / M STREETS 621 VAN NESS AVE	1/8 - 1/4 NE 1/8 - 1/4 SSE 1/8 - 1/4 NNE 1/8 - 1/4 ESE 1/8 - 1/4 NW 1/8 - 1/4 N 1/8 - 1/4 ESE	F23 G28 I35 K41 L42 56 N57	20 23 29 35 35 45 46	
Lower Elevation	Address	Dist / Dir	Map ID	Page	
GOTTSCHALKS AUTO CENTER GREYHOUND LINES, INCWEST	760 FULTON ST 1033 BROADWAY ST	1/8 - 1/4SE 1/8 - 1/4W	C10 J47	10 40	

Fresno Co. CUPA: Certified Unified Program Agency. CUPA's are responsible for implementing a unified hazardous waste management regulatory program. The agency provides oversight of businesses that deal with hazardous materials, operate underground storage tanks or aboveground storage tanks.

A review of the Fresno Co. CUPA list, as provided by EDR, and dated 04/10/2006 has revealed that there are 32 Fresno Co. CUPA sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
FC BLDG/MAINT PARKING GARAGE ROWELL COMPANY PROPERTY UNITED SECURITY BANK VAN NESS/INYO PARKING LOT OFFICE BLDG VAN NESS & INYO PARKING LOT NAMANS PROPERTY ROWELL COMPANY PROPERTY CALTRANS SHELL	862 VAN NESS 2148 KERN 2126 INYO 750 VAN NESS 850 L ST 732 VAN NESS 730 VAN NESS 917 L 826/850 L 2210 KERN	0 - 1/8 ENE 0 - 1/8 NE 0 - 1/8 E 1/8 - 1/4 ESE 1/8 - 1/4 ENE 1/8 - 1/4 ESE 1/8 - 1/4 NE 1/8 - 1/4 ENE 1/8 - 1/4 NE		6 7 7 11 16 18 18 19 20 22

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
SECURITY PACIFIC BANK BUILDING	1058 FULTON	1/8 - 1/4 NW	27	23
PEP BOYS #624	716 BROADWAY	1/8 - 1/4SSE	G30	24
CITY OF FRESNO CONSTRUCTION TR	752 H	1/8 - 1/4SSW		26
URBAN FRESNO STORMWATER DICH	2220 TULARE STREET, 6TH	1/8 - 1/4 NNE	136	30
MCI TELECOMMUNICATIONS	2220 TULARE 21ST FLOOR	1/8 - 1/4 NNE	137	31
ADVANTAGE TIRE SERVICE	650 FULTON	1/8 - 1/4 SE	H38	31
R&N AUTOMOTIVE	901 M	1/8 - 1/4 NE	48	41
LONG CONSTRUCTION INC	850 M ST	1/8 - 1/4 NE	49	41
ARROW ELECTRIC MOTOR SERVICE	645 BROADWAY	1/8 - 1/4SSE	M50	41
HALL OF RECORDS	2281 TULARE	1/8 - 1/4 NNE	53	44
THOMAS RADIATOR	627 BROADWAY	1/8 - 1/4SSE	M54	44
SCHEDLER'S ENGINE REBUILDING &	626 BROADWAY	1/8 - 1/4SSE	M55	45
HAUS TRUCK RENTAL	621 VAN NESS	1/8 - 1/4ESE	N58	46
Lower Elevation	Address	Dist / Dir	Map ID	Page
GOODYEAR TIRE	745 FULTON	0 - 1/8 SE	A6	8
BROADWAY FURNITURE	755 BROADWAY	1/8 - 1/4S	B9	10
PARNELLI JONES-STORE #47	760 FULTON	1/8 - 1/4SE	C11	11
ARCHIVES RECORD STORAGE	742 FULTON	1/8 - 1/4SE	C15	15
BASKINS AUTO SUPPLY	729 BROADWAY	1/8 - 1/4SSE	B20	19
WILSHIRE PAINT COMPANY	701 FULTON	1/8 - 1/4SE	26	23
DENSMORE ENGINES	665 FULTON	1/8 - 1/4SE	H32	27
GREYHOUND BUS DEPOT	1033 BROADWAY	1/8 - 1/4 W	J45	37
POLICE DRESSING STATION	940 BROADWAY	1/8 - 1/4W	51	44

SWEEPS: Statewide Environmental Evaluation and Planning System. This underground storage tank listing was updated and maintained by a company contacted by the SWRCB in the early 1980's. The listing is no longer updated or maintained. The local agency is the contact for more information on a site on the SWEEPS list.

A review of the SWEEPS UST list, as provided by EDR, and dated 06/01/1994 has revealed that there are 14 SWEEPS UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page	
VAN NESS & INYO PARKING LOT	750 VAN NESS AVE	1/8 - 1/4 ESE	D13	11	
OFFICE BLDG	850 L ST	1/8 - 1/4 ENE	E16	16	
VAN NESS & INYO PARKING LOT	732 VAN NESS	1/8 - 1/4 ESE	D17	18	
FORMER SHELL STATION	2210 KERN ST	1/8 - 1/4NE	F24	21	
PEP BOYS #624	716 BROADWAY	1/8 - 1/4SSE	G30	24	
GOLDEN STATE PLAZA	2220 TULARE	1/8 - 1/4 NNE	134	27	
ADVANTAGE TIRE SERVICE	650 FULTON	1/8 - 1/4SE	H38	31	
FRESNO OFFICE MACHINES	660 VAN NESS	1/8 - 1/4 ESE	K40	34	
SECURITY BANK GARAGE	1060 FULTON MALL	1/8 - 1/4 NW	L43	36	
HAL'S TRUCK RENTAL	621 VAN NESS	1/8 - 1/4 ESE	N59	46	
Lower Elevation	Address	Dist / Dir	Map ID	Page	
GOTTSCHALKS	760 FULTON MALL	0 - 1/8 SE	A2	6	
ARCHIVES RECORD STORAGE	742 FULTON ST	1/8 - 1/4SE	C14	13	
HOBBS PARSONS PRODUCE	951 H ST	1/8 - 1/4 W	J39	32	
GREYHOUND BUS DEPOT	1033 BROADWAY	1/8 - 1/4 W	J45	<i>37</i>	

NOTIFY 65: Notify 65 records contain facility notifications about any release that could impact drinking water and thereby expose the public to a potential health risk. The data come from the State Water Resources Control Board's Proposition 65 database.

A review of the Notify 65 list, as provided by EDR, and dated 10/21/1993 has revealed that there is 1 Notify 65 site within approximately 1 mile of the target property.

Equal/Higher Elevation Address		Dist / Dir	Map ID	Page	
ACE SERVICE INC.	BROADWAY / VENTURA	1/8 - 1/4SSE	52	44	

EDR PROPRIETARY RECORDS

EDR Manufactured Gas Plants: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the Manufactured Gas Plants list, as provided by EDR, has revealed that there is 1 Manufactured Gas Plants site within approximately 1 mile of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
PGANDE MANUFACTURED GAS PLANT	BLOCK OF F,G, FRESNO AN	1/4 - 1/2W	74	64

Due to poor or inadequate address information, the following sites were not mapped:

Site Name

MID-CAL MACHINE WORKS FRESNO STATE BUILDING SOUTH FRESNO REGIONAL GROUNDWATER PLUME **CALTRANS** A&B PAYLESS TRANSMISSION TRAILWAYS, INC.

JAMES H WALLACE CITY OF FRESNO ANGELICA HEALTH CARE **GUS COZETTE PARCEL** PRIVATE RESIDENCE FRESNO EXECUTIVE PLAZA AMERICAN AMBULANCE **BURLINGTON NORTHERN AND SANTA FE RR EDUCATIONAL CENTER** FORMER FRANK J SAUNDERS **TEXACO FOOD MART #275*** RED CARPET CAR WASH CITY OF FRESNO/PROPOSED STADIUM **BEKINS MOVING & STORAGE CALIFORNIA AQUEDUCT** ANGELICA HEALTH CARE **GREYHOUND BUS DEPOT** CAL FUND RAISIN INC FRANKS EXXON FIRE DEPT HEADQUARTERS FRESNO COUNTY JAIL HARON MOTOR SALES PG&E GAS PLANT FRESNO 325 3 PG & E FRESNO 2 PACIFIC AIRMOTIVE CHATEAU FRESNO LDFL **BASIN 112 DISPOSAL SITE** NICK'S TRUCKING, INC. **TEXACO ELECTRIC MOTOR SHOP** HOBBS PARSONS COMPANY CONVENTION CENTER MAINTENANCE LISLE FUNERAL HOME AMERICAN AMBULANCE SHELL OIL CO/WCD PIPELINES EMMANUEL LUTHERAN CHURCH SCHOOL

Database(s)

SWEEPS UST **SWEEPS UST** Cal-Sites, AWP Fresno Co. CUPA Fresno Co. CUPA HAZNET, HIST UST, Fresno Co. CUPA HAZNET, Fresno Co. CUPA HAZNET, Fresno Co. CUPA LUST, Fresno Co. CUPA Fresno Co. CUPA

Fresno Co. CUPA Fresno Co. CUPA Fresno Co. CUPA Fresno Co. CUPA Fresno Co. CUPA Fresno Co. CUPA Fresno Co. CUPA Fresno Co. CUPA Fresno Co. CUPA Fresno Co. CUPA CHMIRS, Fresno Co. CUPA

LUST, Cortese, HIST UST HAZNET, Cortese

LUST, Cortese, HIST UST


LUST, Cortese LUST, Cortese LUST, Cortese LUST, Cortese, HIST UST

CERCLIS, FINDS CERCLIS, FINDS **CERC-NFRAP CERC-NFRAP** SWF/LF SWF/LF LUST HIST UST HIST UST HIST UST HIST UST

AST

RCRA-SQG, FINDS


SCH

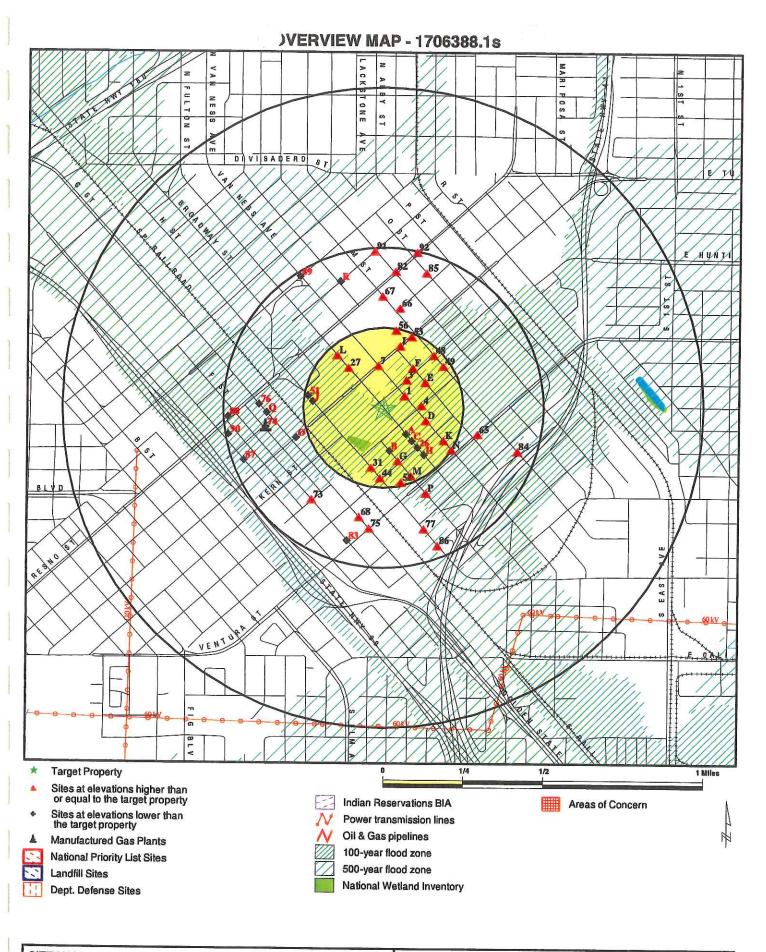

SITE NAME: Gottschalks / Berkeleys ADDRESS: 840-880 Fulton Mall Fresno CA 93721 LAT/LONG: 36.7327 / 119.7888

CLIENT: Rebecca Fraser Consulting

CONTACT: Becky Fraser INQUIRY #: 1706388.1s DATE: June 28, 2006

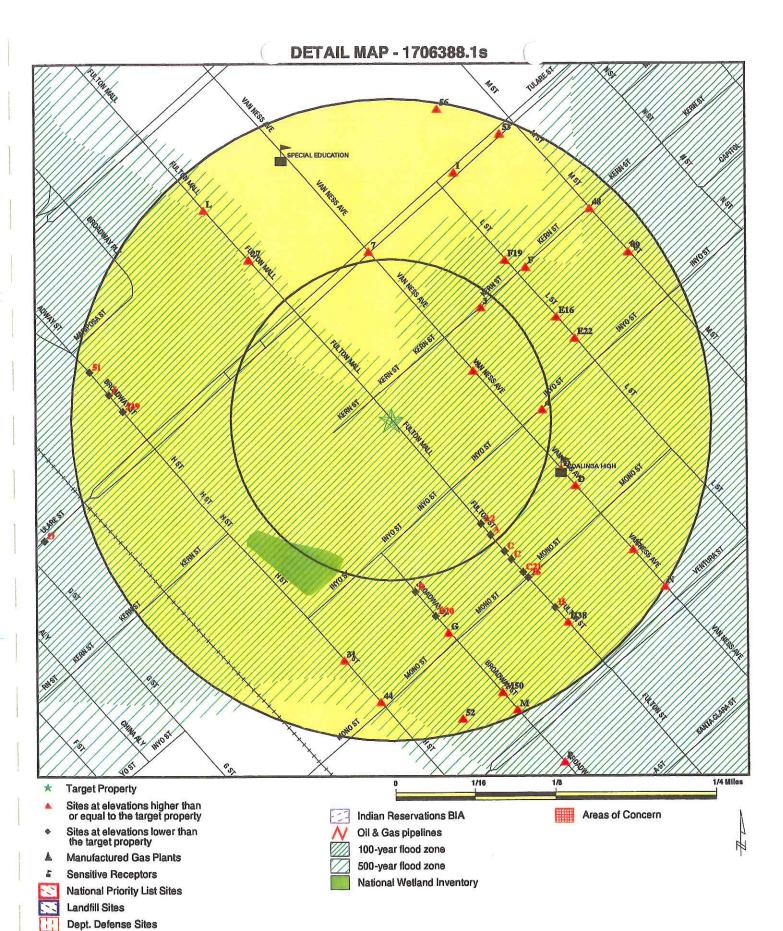

SITE NAME: Gottschalks / Berkeleys 840-880 Fulton Mall Fresno CA 93721 ADDRESS: LAT/LONG: 36.7327 / 119.7888

Rebecca Fraser Consulting

CLIENT: Rebecca Fraser Becky Fraser INQUIRY #: 1706388.1s June 28, 2006

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
FEDERAL RECORDS								
NPL Proposed NPL Delisted NPL NPL RECOVERY CERCLIS CERC-NFRAP CORRACTS RCRA TSD RCRA Lg. Quan. Gen. RCRA Sm. Quan. Gen. ERNS HMIRS US ENG CONTROLS US INST CONTROL DOD FUDS US BROWNFIELDS CONSENT ROD UMTRA ODI TRIS TSCA FTTS SSTS ICIS PADS MLTS MINES FINDS RAATS		1.000 1.000 1.000 TP 0.500 0.500 1.000 0.250 0.250 TP TP 0.500 0.500 1.000 1.000 1.000 1.000 0.500 TP	000K010000KK000000000KKKKKKKKKKKKKKKKK	000月00012円円00000000円円円円円円円円円円円円円円円円円円円円円	000K1201KKKKO0000000KKKKKKKKKKKKKKKKKKKK	000000000000000000000000000000000000000	\text{NNC}	000013011200000000000000000000000000000
STATE AND LOCAL RECOR	os					1411	1411	9
AWP Cal-Sites CA Bond Exp. Plan NFA NFE REF SCH Toxic Pits State Landfill CA WDS WMUDS/SWAT Cortese SWRCY LUST		1.000 1.000 0.250 0.250 0.250 0.250 1.000 0.500 TP 0.500 0.500 0.500	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	0 1 1 NR NR NR NR 0 0 NR 0 16 1	0 0 0 NR NR NR NR NR NR NR NR	NR NR NR NR NR NR NR NR NR NR NR	0 1 1 0 0 0 0 0 0 0 0 0 19 1 26

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	>1	Total Plotted
CA FID UST		0.250	1	11	NR	NR	NR	12
SLIC		0.500	0	1	2	NR	NR	3 1
UST		0.250	0	1	NR	NR	NR	1
HIST UST		0.250	0	9	NR	NR	NR	9
AST		0.250	0	0	NR	NR	NR	0
Fresno Co. CUPA		0.250	4	28	NR	NR	NR	32
SWEEPS UST		0.250	1	13	NR	NR	NR	14
CHMIRS		TP	NR	NR	NR	NR	NR	0
Notify 65		1.000	0	1	0	0	NR	1
DEED		0.500	0	0	0	NR	NR NR	0
VCP		0.500	0	0	0 NR	NR NR	NR	0
DRYCLEANERS		0.250 0.250	0	0	NR	NR	NR	Ö
WIP		0.250 TP	NR	NR	NR	NR	NR	ő
CDL HAZNET		TP	NR	NR	NR	NR	NR	0
EMI		Τ̈́P	NR	NR	NR	NR	NR	ő
TRIBAL RECORDS								
INDIAN RESERV	4	1.000	0	0	0	0	NR	0
INDIAN RESERV		0.500	ő	Ö	ŏ	NR	NR	Ö
INDIAN UST		0.250	ŏ	Ö	NR	NR	NR	0
EDR PROPRIETARY RECOR	RDS							
Manufactured Gas Plants		1.000	0	0	1	0	NR	1

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID Direction Distance Distance (ft.)

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

ENE

Elevation

FC BLDG/MAINT PARKING GARAGE

Fresno Co. CUPA

S106175224

< 1/8

862 VAN NESS

Owner Name:

398 ft.

FRESNO, CA 93702

N/A

Relative: Equal

CUPA:

Facility ID: Region:

FA0272837

Site

CUPA

Actual:

Program Element: UST REMOVAL/CLOSURE W/14 TANKS

292 ft.

FRESNO, COUNTY OF

APM Number: Not reported

A2 SE **GOTTSCHALKS**

CA FID UST

S101630133

< 1/8

760 FULTON MALL

SWEEPS UST

N/A

566 ft.

FRESNO, CA 93721

Site 1 of 3 in cluster A

Relative: Lower

FID:

Facility ID:

10001568

Regulate ID:

00013980

Actual: 291 ft.

Reg By:

Inactive Underground Storage Tank Location

Cortese Code:

Not reported

SIC Code:

Not reported

Status:

Inactive

Facility Tel:

Mail To:

Not reported

PO BOX

Not reported

Contact:

FRESNO, CA 93721 Not reported

Contact Tel: NPDES No:

Not reported

DUNs No: Creation:

Not reported 10/22/93

Modified:

Not reported 00/00/00

EPA ID:

Not reported

Comments:

Not reported

SWEEPS:

Status: Comp Number: Not reported 13980

Number:

Not reported

Board Of Equalization: Ref Date:

44-003752

Not reported

Act Date:

Not reported

Created Date:

Not reported

Tank Status:

Not reported

Owner Tank Id:

Not reported

Swrcb Tank Id:

10-000-013980-000001

Actv Date:

Not reported

Capacity: Tank Use: 500 OIL

Stg:

WASTE

WASTE OIL

Content: Number Of Tanks:

Status: Comp Number: Not reported

Number:

13980 Not reported

Board Of Equalization: 44-003752 Ref Date:

Not reported Not reported

Act Date : Created Date:

Not reported Not reported

Tank Status: Owner Tank Id:

Not reported 10-000-013980-000002

Swrcb Tank Id: Actv Date:

Not reported

Map ID Direction Distance Distance (ft.) Site

Elevation

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S101630133

GOTTSCHALKS (Continued)

Capacity:

1000

Tank Use:

M.V. FUEL **PRODUCT**

Stg: Content:

PRM UNLEADED

Number Of Tanks:

Not reported

Status:

Not reported 13980

Comp Number: Number:

Board Of Equalization: 44-003752

Not reported

Ref Date:

Not reported

Act Date :

Not reported

Created Date:

Not reported

Tank Status: Owner Tank Id: Not reported

Not reported

Swrcb Tank Id: Actv Date:

10-000-013980-000003

Capacity:

Not reported

Tank Use:

1000

M.V. FUEL

Stg:

PRODUCT

Content:

REG UNLEADED Not reported

ROWELL COMPANY PROPERTY

Number Of Tanks:

Fresno Co. CUPA S104869618

Fresno Co. CUPA

CERC-NFRAP

WA

3 NE

2148 KERN

< 1/8

FRESNO, CA 93721

596 ft.

CUPA:

Relative: Higher

Facility ID:

FA0274156

Region:

CUPA

Actual:

293 ft.

Program Element: CLOSED UST FACILITY/NO CLOSURE REPORT Owner Name: **ROWELL COMPANY**

APM Number:

468-252-11

UNITED SECURITY BANK

East

2126 INYO

S106630702 N/A

< 1/8

FRESNO, CA 93721

624 ft.

Relative: Equal

CUPA:

Facility ID:

FA0273720

Actual:

Region: **CUPA**

Program Element: UST REMOVAL/CLOSURE W/1 TANK

292 ft.

Owner Name: UNITED SECURITY BANK

Not reported

A5 SE **WILSHIRE PAINT CO** 701 & 712 FULTON ST

APM Number:

< 1/8

FRESNO, CA 93721

626 ft.

Site 2 of 3 in cluster A

Relative: Lower

Actual: 291 ft.

1004654693

CAD028211076

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

WILSHIRE PAINT CO (Continued)

1004654693

S106175441

NA

SLIC S106486252

N/A

S106567719

N/A

CERCLIS-NFRAP Classification Data:

Federal Facility:

Not a Federal Facility

Non NPL Code:

NFRAP

NPL Status:

Not on the NPL CERCLIS-NFRAP Assessment History:

Assessment:

DISCOVERY

Assessment:

PRELIMINARY ASSESSMENT

Assessment:

ARCHIVE SITE

Completed: Completed: 04/01/1986

Completed:

11/01/1986 11/01/1986

Fresno Co. CUPA

A6 SE **GOODYEAR TIRE**

745 FULTON < 1/8

FRESNO, CA 93721

643 ft.

Relative:

Site 3 of 3 in cluster A

Lower

CUPA:

Facility ID:

FA0266885

Actual: 291 ft.

Region:

CUPA

Program Element: UST REMOVAL/CLOSURE W/1 TANK

Owner Name:

GOODYEAR TIRE & RUBBER CO

APM Number:

Not reported

North

FMFCD - NURP

2100 TULARE ST, ROWELL BLDG#300

1/8-1/4

701 ft.

FRESNO, CA 93721

Relative: Higher

CA STATE SLIC: Global Id:

SLT5FT234498

Actual: 293 ft.

Region: Assigned Name:

STATE SLICSITE

Lead Agency Contact: Lead Agency:

JONG HAN

Lead Agency Case Number:

CENTRAL VALLEY RWQCB (REGION 5F) SLT5FT023

Responsible Party:

Not reported

Recent Dtw: **Facility Status:**

Not reported Case Closed

Substance Released:

B8 South BROADWAY FURNITURE PARKING LOT (FORMER SERVICE STA

755 BROADWAY

FRESNO, CA 93721

1/8-1/4 714 ft.

Site 1 of 3 in cluster B

Relative: Lower

State LUST:

Cross Street:

INYO STREET

Actual: 291 ft.

Qty Leaked:

Not reported 5T10000837

Case Number

Reg Board: Chemical:

5F

Lead Agency:

8006619,1203

Local Agency: Case Type:

Local Agency 10000

Status:

Soil only Case Closed 2004-07-29 00:00:00

Confirm Leak:

2004-07-29 00:00:00

LUST

Review Date: Workplan:

Not reported

Not reported

Map ID Direction Distance Distance (ft.)

Elevation

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number**

BROADWAY FURNITURE PARKING LOT (FORMER SERVICE STA (Continued)

S106567719

Pollution Char:

Not reported

Remed Plan:

Not reported

Remed Action: Monitoring:

Not reported Not reported

Close Date: Release Date: 2004-10-06 00:00:00 2004-07-27 00:00:00

Cleanup Fund Id: Not reported

Discover Date :

2004-07-27 00:00:00

Enf Type:

Enforcement Dt: Not reported CLOS

Enter Date:

Not reported

Funding:

LOC

Staff Initials:

JRA

How Discovered: PST How Stopped:

Close Tank Not reported

Interim: Leak Cause:

UNK

Leak Source: MTBE Date:

Tank Not reported

Max MTBE GW: Not reported MTBE Tested:

Not Required to be Tested.

Priority: Local Case #:

Not reported FA0277130

Beneficial:

Not reported

Staff:

DAM

GW Qualifier:

Not reported

Max MTBE Soil: Not reported Soil Qualifier:

Not reported

Hydr Basin #:

Not reported

Operator:

Not reported

Oversight Prgm: LUST

Review Date: Stop Date:

Not reported Not reported

Work Suspended Not reported

Responsible PartyMR ALEX EGETIAN RP Address:

745 BROADWAY STREET

Global Id:

T0601989283

Org Name:

Not reported Contact Person: Not reported

MTBE Conc:

Mtbe Fuel:

Water System Name:

Not reported Not reported

Well Name:

Distance To Lust:

Waste Discharge Global ID: Not reported

Waste Disch Assigned Name: Not reported

Summary:

FRESNO COUNTY ENVIRONMENTAL HEALTH SYSTEM HAS ADVISED THE SITE

REPONSIBLE PARTY THAT THEY MAY NEED TO HIRE AN ENVIRONMENTAL

ENGINEERING CONSULTING FIRM.

LUST Region 5:

Substance:

Not reported

Case Closed

Case Type:

Soil only

Program:

LUST

Staff Initials:

DAM

Case Number:

5T10000837

Status:

MTBE Code:

Lead Agency:

N/A Local

Map ID Direction Distance Distance (ft.) Elevation

Site

Database(s)

HIST UST

Fresno Co. CUPA

EDR ID Number EPA ID Number

S106487465

WA

U001592335

WA

B9 South 1/8-1/4 **BROADWAY FURNITURE** 755 BROADWAY

FRESNO, CA 93721

714 ft.

Site 2 of 3 in cluster B

Relative: Lower

CUPA:

Facility ID:

FA0277130

Actual: 291 ft.

Region: CUPA

Owner Name:

Program Element: MISCELLANEOUS SITE ASSESSMENT EGETIAN, ALEX

APM Number:

468-286-03

Facility ID:

FA0277130

Region:

CUPA

Program Element: FORMER CONTAMINATED SITE/CLEANUP COMPLETE

Owner Name: **APM Number:**

EGETIAN, ALEX 468-286-03

C10 SE

GOTTSCHALKS AUTO CENTER

760 FULTON ST

1/8-1/4 715 ft.

FRESNO, CA 93718

Site 1 of 5 in cluster C

Relative: Lower

Actual:

291 ft.

UST HIST:

Facility ID:

13980 Total Tanks:

Owner Address: P.O. BOX 1872

FRESNO, CA 93718

FRANK RUEGERO

Tank Used for:

WASTE Tank Num: 00000500

Tank Capacity: Type of Fuel:

WASTE OIL Leak Detection: None

Contact Name:

Facility Type:

Other

Facility ID: 13980

Total Tanks:

Owner Address: P.O. BOX 1872

FRESNO, CA 93718 PRODUCT

00010000

REGULAR

13980

Stock Inventor

Tank Used for:

Tank Num:

Tank Capacity:

Type of Fuel:

Leak Detection:

Contact Name:

FRANK RUEGERO Facility Type:

Other

Facility ID:

Total Tanks:

Owner Address: P.O. BOX 1872

3

00001000

UNLEADED

Stock Inventor

FRESNO, CA 93718 **PRODUCT**

Tank Used for:

Tank Num:

Tank Capacity:

Type of Fuel:

Leak Detection:

FRANK RUEGERO Contact Name:

Facility Type: Other

Owner Name:

Region:

E. GOTTSCHALKS CO. INC.

STATE

Container Num: 1-001 Year Installed: 1979

Tank Construction: 1/4 inches

Telephone: Other Type: (209) 237-9178 TBA TIRE CENTER

Owner Name:

Region:

E. GOTTSCHALKS CO. INC.

STATE

Container Num: 1-003 Year Installed: 1982 Tank Construction: 1/4 inches

Telephone: Other Type:

(209) 237-9178 TBA TIRE CENTER

Owner Name:

E. GOTTSCHALKS CO. INC.

Region:

Container Num:

STATE

1-002

Year Installed: 1982 Tank Construction: 1/4 inches

Telephone: Other Type: (209) 237-9178 TBA TIRE CENTER

Map ID Direction Distance Distance (ft.)

Elevation

Database(s)

EDR ID Number EPA ID Number

C11 SE

PARNELLI JONES-STORE #47

Fresno Co. CUPA

S104869000

1/8-1/4

760 FULTON FRESNO, CA 93721 WA

715 ft.

Site 2 of 5 in cluster C

Relative: Lower

CUPA:

Facility ID:

FA0268384

Actual: 291 ft.

Region: CUPA

Program Element: UST REMOVAL/CLOSURE W/3 TANKS

Owner Name: APM Number: DEUTSCH, FRED Not reported

D12 ESE **VAN NESS/INYO PARKING LOT**

Fresno Co. CUPA \$106176758

WA

1/8-1/4 728 ft.

750 VAN NESS **FRESNO, CA 93721**

Relative: Equal

Site 1 of 4 in cluster D

CUPA:

Facility ID:

FA0170337 **CUPA**

Actual: 292 ft.

Region:

Program Element: UST REMOVAL/CLOSURE W/1 TANK

Owner Name:

NAMAN, EVINS R

APM Number:

Not reported

Facility ID:

FA0170337 CUPA

Region:

Program Element: CONTAMINATED UST SITE/RWQCB LEAD AGENCY

Owner Name:

NAMAN, EVINS R

Confirm Leak:

Prelim Assess:

Remed Plan:

APM Number:

Not reported

D13 ESE **VAN NESS & INYO PARKING LOT**

750 VAN NESS AVE

1/8-1/4 728 ft.

FRESNO, CA 93721

Site 2 of 4 in cluster D

LUST S101581303 Cortese WA

CA FID UST SWEEPS UST

Not reported

Not reported

Not reported

Relative: Equal

State LUST:

INYO

Actual: 292 ft.

Cross Street: Qty Leaked:

Not reported 5T10000054

Case Number Reg Board:

5F

Chemical:

Gasoline

Lead Agency:

Regional Board

Local Agency: Case Type:

10000 **Drinking Water Aquifer affected**

Status: Abate Method: **Case Closed** Vapor Extraction

Review Date:

Not reported

Workplan:

Not reported

Pollution Char: Remed Action: Not reported

Monitoring:

1997-03-10 00:00:00

1998-05-11 00:00:00

Close Date:

1999-10-12 00:00:00

Release Date:

1987-11-17 00:00:00

Cleanup Fund Id: 01617

Enforcement Dt: 1965-01-01 00:00:00

Discover Date: 1987-11-16 00:00:00

Enf Type:

None Taken

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S101581303

VAN NESS & INYO PARKING LOT (Continued)

Enter Date:

1987-11-24 00:00:00

Funding:

Federal Funds

Staff Initials:

JIM

How Stopped:

How Discovered: Not reported Not reported

Interim:

Not reported

Leak Cause:

Not reported

Leak Source:

Not reported

MTBE Date:

1998-08-20 00:00:00

Max MTBE GW: 5 Parts per Billion

MTBE Tested:

MTBE Detected. Site tested for MTBE & MTBE detected

Priority:

Local Case #:

FA0273312

Beneficial:

Not reported

Staff:

DAM

GW Qualifier:

Max MTBE Soil: Not reported

Soil Qualifier:

Not reported

Hydr Basin #:

SAN JOAQUIN (5-22)

Operator:

NAMAN, EVIUS R. LUST

Oversight Prgm:

Review Date:

2002-02-13 00:00:00

Stop Date:

Not reported

Work Suspended :No

Responsible PartyNAMAN, EVIUS R.

RP Address:

2460 W. MENLO, FRESNO, CA 93711

Global Id:

T0601900053

Ora Name:

Not reported

Contact Person: MTBE Conc:

Not reported

Mtbe Fuel:

Water System Name:

ARBOR MOBILE HOME PARK

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: W0603900831

Waste Disch Assigned Name: 2000831-001GEN

Summary:

550 gal gasoline ust removed in 1987. BTEX and 1,2-dca in soil & groundwater-no MTBE. 90 ft deep aquifer impacted. SVE operated 3/97 to 9/97. BTEX reduced to ND & DCA to near ND in GW after

Case Number:

5T10000054

SVE. Significant soil conc Reduction.

LUST Region 5:

Substance:

GASOLINE

Case Type:

Drinking Water Aquifer affected

Program: Staff Initials: LUST DAM

Case Closed

Status:

MTBE Code: Lead Agency: Regional

CORTESE:

Region:

CORTESE

Fac Address 2:

750 VAN NESS AVE

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

VAN NESS & INYO PARKING LOT (Continued)

S101581303

FID:

Facility ID:

10000072 Inactive Underground Storage Tank Location

Regulate ID:

Not reported

Reg By: Cortese Code:

Not reported

SIC Code:

Not reported

Status:

Inactive

Facility Tel:

Not reported

Mail To:

Not reported

2460 W MENLO

FRESNO, CA 93721

Contact: **DUNs No:** Not reported Not reported 10/22/93

Contact Tel: NPDES No: Modified:

Not reported Not reported 00/00/00

Creation: EPA ID: Comments:

Not reported Not reported

SWEEPS:

Status:

Not reported

Comp Number:

551

Number:

Not reported Board Of Equalization: Not reported

Ref Date:

Not reported Not reported

Act Date: Created Date:

Not reported Not reported

Tank Status: Owner Tank Id:

Not reported 10-000-000551-000001

Swrcb Tank ld: Actv Date:

Not reported

Capacity:

500

Tank Use:

M.V. FUEL

Stq:

PRODUCT

Content:

LEADED

Number Of Tanks:

C14 SE

1/8-1/4 758 ft.

ARCHIVES RECORD STORAGE

742 FULTON ST FRESNO, CA 93721

LUST Cortese **CA FID UST**

SWEEPS UST

1992-09-04 00:00:00

Not reported

Not reported

Confirm Leak:

Prelim Assess:

Remed Plan:

S101581369 N/A

Site 3 of 5 in cluster C

Relative: Lower

State LUST:

Cross Street:

INYO

Actual: 291 ft.

Qty Leaked:

Not reported

Case Number Reg Board:

5T10000394 5F

Chemical:

Diesel Local Agency

Lead Agency:

10000

Local Agency: Case Type:

Undefined

Status:

Leak being confirmed

Review Date:

1992-09-04 00:00:00

Workplan:

Pollution Char:

Not reported

Remed Action:

Not reported

Monitoring: Close Date: Not reported Not reported

Release Date:

Not reported

1992-09-15 00:00:00

Cleanup Fund ld: Not reported

Enforcement Dt: 1965-01-01 00:00:00

Discover Date: 1992-09-04 00:00:00

Enf Type:

Not reported

Map ID Direction Distance Distance (ft.) Elevation

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S101581369

ARCHIVES RECORD STORAGE (Continued)

Enter Date:

1992-09-28 00:00:00 Responsible Party

Funding: Staff Initials:

JRA How Discovered: Tank Closure

How Stopped: Interim:

Not reported Not reported

Leak Cause:

UNK

Leak Source: MTBE Date:

UNK Not reported

Max MTBE GW: Not reported MTBE Tested:

Not Required to be Tested.

Priority: Local Case #: Medium priority

Beneficial:

FA0268373 Not reported

Staff:

DAM

GW Qualifier:

Not reported Max MTBE Soil: Not reported Not reported

Soil Qualifier: Hydr Basin #:

SAN JOAQUIN (5-22)

Operator:

TARJIAN BEDOIAN

Oversight Prgm: LUST

Review Date:

1992-09-15 00:00:00 1992-08-10 00:00:00

Stop Date: Work Suspended :No

Responsible PartyTARJIAN BEDOIAN

RP Address:

103 S. ACADEMY - SANGER, CA 93657

Global ld:

T0601900385 Not reported

Org Name: Contact Person:

Not reported 0

MTBE Conc: Mtbe Fuel:

Water System Name:

ARBOR MOBILE HOME PARK

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: W0603900831 Waste Disch Assigned Name: 2000831-001GEN

Summary:

FRESNO CO DEPT OF HEALTH HAS REQUIRED TO RESPONSIBLE PARTY TO SECURE THE SERVICES OS AN ENVIRONMENTAL ENGINEERING CONSULTING

Case Number:

5T10000394

FIRM.

LUST Region 5:

Substance:

DIESEL Undefined

Case Type:

LUST

Program: Staff Initials:

DAM

Leak being confirmed

Status: MTBE Code:

Lead Agency:

N/A Local

CORTESE:

Region:

CORTESE

Fac Address 2:

Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

ARCHIVES RECORD STORAGE (Continued)

S101581369

FID:

Facility ID:

10000358

Regulate ID:

Not reported

Reg By: Cortese Code:

Not reported

SIC Code:

Not reported

Status:

Inactive

Facility Tel:

Not reported

Not reported

Inactive Underground Storage Tank Location

Mail To:

103 S ACADEMY FRESNO, CA 93721

Contact Tel:

Not reported

Fresno Co. CUPA

Contact: **DUNs No:** Not reported Not reported 10/22/93

NPDES No: Modified:

Not reported 00/00/00

Creation: EPA ID: Comments:

Not reported Not reported

SWEEPS:

Status:

Not reported

Comp Number:

2882

Number:

Not reported

Ref Date:

Board Of Equalization: Not reported Not reported

Act Date:

Not reported Not reported

Created Date: Tank Status: Owner Tank Id:

Not reported Not reported

Swrcb Tank Id:

10-000-002882-000001

Actv Date:

Not reported

Capacity:

300

Tank Use:

UNKNOWN

Stg:

PRODUCT

Content:

Not reported

Number Of Tanks:

C15

ARCHIVES RECORD STORAGE 742 FULTON

SE 1/8-1/4

FRESNO, CA 93721

758 ft.

Site 4 of 5 in cluster C

Relative: Lower

CUPA:

Facility ID:

FA0268373

Actual:

Region:

CUPA

291 ft.

Program Element: CONTAMINATED UST SITE/EHS LEAD AGENCY

Owner Name:

BEDOIAN, MARY

APM Number:

Not reported

Facility ID:

FA0268373

Region: Program Element: UST REMOVAL/CLOSURE W/1 TANK

CUPA

Owner Name:

BEDOIAN, MARY

APM Number:

Not reported

S106174622

N/A

Map ID Direction Distance Distance (ft.) Elevation

Database(s)

EDR ID Number EPA ID Number

S104869704

WA

E16 ENE

804 ft.

OFFICE BLDG

850 L ST 1/8-1/4

FRESNO, CA 93721

LUST Cortese Fresno Co. CUPA **SWEEPS UST**

Not reported

Not reported

Not reported

Confirm Leak:

Prelim Assess:

Remed Plan:

Relative: Equal

Actual:

292 ft.

State LUST:

Cross Street: Qty Leaked:

Site 1 of 2 in cluster E

KERN ST Not reported 5T10000431

Case Number Reg Board: Chemical:

Waste Oil

Lead Agency: Local Agency: Case Type:

Status:

Local Agency 10000 Soil only Case Closed Not reported

Review Date: Workplan: Pollution Char: Remed Action:

Not reported Not reported Not reported Not reported

Monitoring: Close Date: Release Date:

2002-09-23 00:00:00 1993-06-14 00:00:00

Cleanup Fund Id: Not reported Discover Date :

1993-06-09 00:00:00 Enforcement Dt: 1965-01-01 00:00:00 Not reported Enf Type:

Enter Date:

1993-06-18 00:00:00

Funding: Not reported Staff Initials: osc How Discovered: Tank Closure How Stopped: Not reported Not reported Interim: Leak Cause: UNK Leak Source: UNK MTBE Date: Not reported

Max MTBE GW: Not reported MTBE Tested:

Priority:

Not Required to be Tested. Not reported

Local Case #:

FA0269339 Not reported

Beneficial: Staff: GW Qualifier:

DAM Not reported Max MTBE Soil: Not reported Not reported

Soil Qualifier: Hydr Basin #: Operator:

SAN JOAQUIN (5-22)

Oversight Prgm:

PETERSON INVESTMENTS LUST

Review Date:

Stop Date:

1993-06-18 00:00:00 1993-05-20 00:00:00

Work Suspended :No

Responsible PartyPETERSEN INVESTMENTS

RP Address: Global Id:

8011 N. LOCAN, CLOVIS CA 93612 T0601900422

Org Name: Contact Person:

Not reported Not reported

MTBE Conc: Mtbe Fuel:

Water System Name:

SIERRA NATIONAL FOREST

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

5T10000431

EDR ID Number EPA ID Number

S104869704

OFFICE BLDG (Continued)

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: W0603900695 Waste Disch Assigned Name: 2000695-001GEN

Summary:

FRESNO CO. COMMUNITY HEALTH DEPT. HAS REQUIRED THE SITE RESPONDIBLE PART TO SECURE THE SERVICES OF AN ENVIRONMENTAL

Case Number:

ENGINEERING CONSULTING FIRM.

LUST Region 5:

Substance:

WASTE OIL

Case Type:

Soil only

Program:

LUST

Staff Initials:

DAM

Case Closed

Status: MTBE Code:

N/A

Lead Agency:

Local

CORTESE:

Region:

CORTESE

Fac Address 2:

850 L ST

CUPA:

Facility ID:

FA0269339

Region:

CUPA

Program Element: CLOSED UST FACILITY/DATA VAULT

Owner Name: APM Number:

PETERSEN INVESTMENTS Not reported

Facility ID:

FA0269339

Region:

CUPA

Program Element: FORMER CONTAMINATED SITE/CLEANUP COMPLETE

Owner Name:

PETERSEN INVESTMENTS

APM Number:

Not reported

SWEEPS:

Status:

Not reported

Comp Number:

1228

Number: Board Of Equalization: Not reported

Not reported

Ref Date:

Not reported

Act Date:

Not reported

Created Date:

Not reported Not reported

Tank Status:

Not reported

Owner Tank Id: Swrcb Tank Id:

10-000-001228-000001

Actv Date:

Not reported

Capacity:

Tank Use:

600 OIL

Stg:

WASTE

Content: Number Of Tanks: WASTE OIL

Not reported

Status: Comp Number:

1228

Number:

Not reported

Board Of Equalization: Not reported

Ref Date:

Act Date:

Not reported

Created Date:

Not reported Not reported

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S104869704

OFFICE BLDG (Continued)

Tank Status: Owner Tank Id:

Not reported Not reported

Swrcb Tank Id:

10-000-001228-000002

Actv Date:

Not reported

Capacity: Tank Use : 600 OIL

Stg:

WASTE

Content: Number Of Tanks: WASTE OIL Not reported

D17 ESE VAN NESS & INYO PARKING LOT

732 VAN NESS

1/8-1/4 806 ft.

FRESNO, CA 93721

Fresno Co. CUPA S106176757 **SWEEPS UST** N/A

Fresno Co. CUPA

Relative:

Site 3 of 4 in cluster D

Equal

CUPA:

Facility ID:

FA0272706

Actual: 292 ft.

CUPA

Region:

Program Element: CLOSED UST FACILITY/DATA VAULT

Owner Name:

NAMAN, EVINS R Not reported

APM Number:

SWEEPS:

Status:

Not reported

Comp Number:

552

Number: Board Of Equalization: Not reported

Not reported

Ref Date:

Not reported

Act Date:

Not reported

Created Date:

Not reported

Tank Status ;

Not reported Not reported

Owner Tank Id: Swrcb Tank Id:

10-000-000552-000001

Actv Date: Capacity:

Not reported

Tank Use:

5000 M.V. FUEL

Stg:

PRODUCT GASOLINE

Content:

Number Of Tanks:

D18 ESE NAMANS PROPERTY 730 VAN NESS

1/8-1/4

FRESNO, CA 93728

812 ft.

Site 4 of 4 in cluster D

Relative: Equal

CUPA:

Facility ID:

Actual: 292 ft.

FA0273312 **CUPA**

Region:

Program Element: CONTAMINATED UST SITE/RWQCB LEAD AGENCY

Owner Name:

FRESNO, CITY OF

APM Number:

Not reported

S104871526

N/A

Map ID Direction Distance Distance (ft.) Elevation

Site

Database(s)

EDR ID Number **EPA ID Number**

F19 NE

ROWELL COMPANY PROPERTY

Fresno Co. CUPA

S104869706 WA

1/8-1/4

917 L

812 ft.

FRESNO, CA 93721

Site 1 of 4 in cluster F

Relative: Higher

CUPA:

Facility ID:

FA0274155 **CUPA**

Actual: 293 ft.

Region: Program Element: CLOSED UST FACILITY/NO CLOSURE REPORT

Owner Name:

ROWELL COMPANY

APM Number:

486-251-13

B20 SSE **BASKINS AUTO SUPPLY**

Fresno Co. CUPA

S104867715

1/8-1/4

729 BROADWAY

WA

FRESNO, CA 93721

828 ft.

Site 3 of 3 in cluster B

Relative: Lower

CUPA:

Facility ID:

Actual: 291 ft.

FA0271552 Region: **CUPA**

Program Element: HAZ MAT DISCLOSURE-BELOW REPORTING QUANTITY

Waste

D002 D007

F003

Quantity (Lbs) 642.20

> 9422.02 9422.02

Owner Name: APM Number: BASKIN, RICHARD A Not reported

WILSHIRE PAINT CO 712 FULTON ST

SE 1/8-1/4

C21

FRESNO, CA 93721

830 ft.

Site 5 of 5 in cluster C

Relative: Lower

RCRAInfo:

Owner:

DARRELL EDWARDS

Actual: 291 ft.

EPA ID:

CAC002558981

Contact:

DARRELL EDWARDS

(559) 240-8002

Classification:

Large Quantity Generator

TSDF Activities: Not reported

BIENNIAL REPORTS:

Last Biennial Reporting Year: 2003

Waste	Quantity (Lbs)
D001	39472.48
D005	9422.02
D008	9422.02
F005	9422.02

Violation Status: No violations found

RCRA-LQG

1008194340 CAC002558981

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

E22

CALTRANS ENE 826/850 L

Fresno Co. CUPA

1/8-1/4

FRESNO, CA 93721

S105870468 N/A

830 ft.

Site 2 of 2 in cluster E

Relative: Equal

CUPA:

Facility ID: Region:

FA0275735

Actual: 292 ft.

CUPA

Program Element: HAZ MAT DISCLOSURE-BELOW REPORTING QUANTITY

Owner Name:

CALIFORNIA, STATE OF

APM Number:

Not reported

F23 NE

RUBEN SHELL SERVICE

RUBEN SHELL SERVICE

STATE

Not reported

(209) 237-0198

RUBEN SHELL SERVICE

Not reported

Not reported

(209) 237-0198

Not reported

STATE

HIST UST U001592401 NA

1/8-1/4 842 ft.

2210 KERN ST FRESNO, CA 93721

Site 2 of 4 in cluster F

Relative: Higher Actual:

293 ft.

UST HIST:

Facility ID:

57437

Total Tanks:

Owner Address:

2210 KERN STR. FRESNO, CA 93721

PRODUCT

00014000

None

57437

UNLEADED

Gas Station

Tank Used for:

Tank Num:

Tank Capacity:

Type of Fuel:

Leak Detection: Contact Name:

Facility Type:

Facility ID:

Total Tanks:

Owner Address: 2210 KERN STR.

FRESNO, CA 93721 PRODUCT

VIGEN HONARCHIAN

Tank Used for:

Tank Num:

Tank Capacity:

Type of Fuel:

Leak Detection:

Contact Name:

Facility Type:

None

00014000

REGULAR

VIGEN HONARCHIAN Gas Station

Facility ID: 57437 Total Tanks:

Owner Address: 2210 KERN STR.

FRESNO, CA 93721 **PRODUCT**

Tank Used for:

Tank Num:

3 Tank Capacity: 00014000

Type of Fuel:

Leak Detection:

PREMIUM None

Contact Name: Facility Type:

VIGEN HONARCHIAN

Gas Station

Telephone:

Other Type:

Owner Name: Region:

Container Num:

Owner Name:

Container Num:

Tank Construction: Not Reported

Year Installed:

Telephone:

Other Type:

Owner Name:

Container Num:

Year Installed:

Region:

Region:

RUBEN SHELL SERVICE

STATE

3

Year Installed:

Not reported

Tank Construction: Not Reported

Tank Construction: Not Reported

Telephone:

(209) 237-0198

Other Type:

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

CA FID UST

SWEEPS UST

EDR ID Number EPA ID Number

S101581474

NA

F24 NE

FORMER SHELL STATION

2210 KERN ST 1/8-1/4

842 ft.

FRESNO, CA 93721

Site 3 of 4 in cluster F

Relative: Higher

Facility ID:

10001399

Regulate ID: Inactive Underground Storage Tank Location

SIC Code:

00057437 Not reported

Actual: 293 ft.

Reg By: Cortese Code:

Not reported Inactive

Facility Tel:

(209) 486-1321

Status: Mail To:

Not reported

230 W PAUL AVE

FRESNO, CA 93721

Not reported Not reported 10/22/93

Contact Tel: NPDES No: Modified:

Not reported Not reported 00/00/00

DUNs No: Creation: EPA ID: Comments:

Contact:

Not reported Not reported

SWEEPS:

Status:

Not reported 57437

Comp Number: Number:

Not reported Board Of Equalization: 44-004527

Ref Date: Act Date:

Not reported Not reported Not reported

Created Date: Tank Status:

Not reported Not reported

Owner Tank Id: Swrcb Tank Id:

10-000-057437-000001

Actv Date: Capacity:

Not reported 10000 M.V. FUEL

Tank Use: Stg: Content:

PRODUCT **REG UNLEADED**

Number Of Tanks:

Status:

Not reported 57437

Comp Number: Number:

Not reported Board Of Equalization: 44-004527 Not reported

Ref Date: Act Date :

Not reported Not reported Not reported

Created Date: Tank Status: Owner Tank ld:

10-000-057437-000002

Swrcb Tank Id: Actv Date: Capacity:

Not reported 500

Not reported

Tank Use: Stg:

M.V. FUEL PRODUCT LEADED

Content: Number Of Tanks:

Not reported

Status:

Not reported

Comp Number: Number:

57437

Board Of Equalization:

Not reported 44-004527

Ref Date:

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S101581474

FORMER SHELL STATION (Continued)

Act Date : Created Date: Not reported

Tank Status:

Not reported Not reported

Owner Tank Id:

Not reported

Swrcb Tank Id:

10-000-057437-000003

Actv Date:

Not reported

Capacity: Tank Use: 4000

Stg:

M.V. FUEL PRODUCT

Content:

REG UNLEADED

Number Of Tanks:

Not reported

Status:

Not reported

Comp Number:

57437

Number: Board Of Equalization:

Not reported 44-004527

Ref Date:

Not reported

Act Date:

Not reported Not reported

Created Date: Tank Status:

Not reported

Owner Tank Id: Swrcb Tank Id:

Not reported 10-000-057437-000004

Actv Date:

Not reported

Capacity:

500

Tank Use:

M.V. FUEL

Stg:

PRODUCT LEADED

Content: Number Of Tanks:

Not reported

Status:

Not reported

Comp Number:

57437 Not reported

Number: Board Of Equalization: 44-004527 Ref Date:

Not reported

Act Date:

Not reported Not reported

Created Date: Tank Status:

Not reported Not reported

Owner Tank Id: Swrcb Tank Id:

Number Of Tanks:

10-000-057437-000005

Actv Date: Capacity:

Not reported 500

Tank Use:

M.V. FUEL

Stg:

PRODUCT

LEADED

Content:

Not reported

F25 NE

SHELL

2210 KERN

1/8-1/4 842 ft.

FRESNO, CA 93721

Site 4 of 4 in cluster F

Relative: Higher

CUPA:

FA0169959

Facility ID: Region:

Actual:

293 ft.

CUPA

Owner Name:

Program Element: UST REMOVAL/CLOSURE W/5 TANKS

HAMAYELIAN, ARMEN M & ODET

APM Number:

468-215-21

S106176328

N/A

Fresno Co. CUPA

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

Fresno Co. CUPA

EDR ID Number EPA ID Number

1002850499

WA

26 SE WILSHIRE PAINT COMPANY

701 FULTON

1/8-1/4

FRESNO, CA 93721

860 ft.

Relative:

CUPA:

Lower

Facility ID: Region:

FA0169665 **CUPA**

Owner Name:

Program Element: HAZ MAT DISCLOSURE/CLOSED SITE WILSHIRE PAINT COMPANY

Actual: 291 ft.

APM Number: Not reported

FA0169665

Facility ID:

CUPA

Region:

Program Element: UST REMOVAL/CLOSURE W/1 TANK WILSHIRE PAINT COMPANY

Owner Name: APM Number:

Not reported

Facility ID:

FA0169665

Region:

CUPA

Program Element: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

Owner Name:

WILSHIRE PAINT COMPANY

APM Number:

Not reported

27 NW SECURITY PACIFIC BANK BUILDING

Fresno Co. CUPA \$104868987

N/A

1/8-1/4

1058 FULTON **FRESNO, CA 93721**

883 ft.

CUPA:

Relative: Higher

Facility ID:

FA0170810 **CUPA**

Actual:

Region: Program Element: CLOSED UST FACILITY/DATA VAULT

293 ft.

Owner Name:

1060 FULTON LEASING INC

466-172-12

APM Number:

G28 SSE PEP BOYS-FRESNO #24 716 BROADWAY ST **FRESNO, CA 93721**

1/8-1/4 905 ft.

Site 1 of 3 in cluster G

Relative: Equal

Actual:

292 ft.

UST HIST:

Facility ID: Total Tanks:

13452

Owner Address:

1124 W. WASHINGTON BLVD.

LOS ANGELES, CA 90015 WASTE

Tank Used for:

Tank Num:

Tank Capacity:

00000550 Type of Fuel: WASTE OIL

Leak Detection: Contact Name:

Visual **DWAIN RAGSDALE**

Facility Type:

Other

Facility ID:

Total Tanks:

13452

2

Owner Address:

1124 W. WASHINGTON BLVD.

LOS ANGELES, CA 90015

Tank Used for:

WASTE

1000105164

N/A

HIST UST

PEP BOYS-MANNY, MOE & JACK

Other Type: Region:

Telephone:

(213) 748-5751 WASTE TANK

Not reported

Owner Name:

Owner Name:

Container Num:

Tank Construction: Not Reported

Year Installed:

Region:

PEP BOYS-MANNY, MOE & JACK

STATE

STATE

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

1000105164

PEP BOYS-FRESNO #24 (Continued)

Tank Num:

Tank Capacity:

Type of Fuel:

Leak Detection:

Contact Name:

Facility Type:

Visual **DWAIN RAGSDALE**

Other

10001971

Active

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

10/22/93

3111 W ALLEGHENY AVE FRESNO, CA 93721

00000550

WASTE OIL

Telephone:

Container Num:

Year Installed:

(213) 748-5751

Tank Construction: Not Reported

Active Underground Storage Tank Location

Other Type:

Regulate ID:

SIC Code:

Facility Tel:

Contact Tel:

NPDES No:

Modified:

WASTE TANK

Not reported

G29 SSE

PEP BOYS #624 716 BROADWAY

FRESNO, CA 93721

1/8-1/4 905 ft.

Site 2 of 3 in cluster G

Relative: **Equal**

Actual:

292 ft.

FID:

Facility ID:

Reg By: Cortese Code:

Mail To:

Status:

Contact:

DUNs No: Creation:

EPA ID: Comments:

PEP BOYS #624

SSE 1/8-1/4 905 ft.

G30

716 BROADWAY **FRESNO, CA 93721**

Site 3 of 3 in cluster G

Relative: Equal

Actual: 292 ft.

HAZNET:

Tons:

Gepaid: TSD EPA ID:

CAD981662505 NVR000037432 Fresno

Gen County: Tsd County:

Fresno 1.07 Not reported

Facility Address 2:

Waste Category:

Disposal Method:

Recycler

Contact: ANGELA BANKS PROJECT MGR Telephone: (215) 430-9645

Mailing Name:

Not reported

Mailing Address: 3111 W ALLEGHENY AVENUE

PHILADELPHIA, PA 19132 - 1116

County

Fresno

Gepaid: TSD EPA ID: Gen County:

CAD981662505 CAD099452708 Fresno

Tsd County: Tons:

Fresno 1.15

Facility Address 2:

Not reported

Waste Category: Disposal Method:

Unspecified aqueous solution Recycler

Unspecified aqueous solution

Contact:

ANGELA BANKS PROJECT MGR

Telephone:

(215) 430-9645

CA FID UST \$101581544

NΑ

00013452

Not reported (209) 264-3029

Not reported Not reported

00/00/00

HAZNET U003941078 UST N/A

Fresno Co. CUPA **SWEEPS UST**

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

U003941078

PEP BOYS #624 (Continued)

Mailing Name:

Not reported

Mailing Address: 3111 W ALLEGHENY AVENUE

PHILADELPHIA, PA 19132 - 1116

County

Fresno

Gepaid: TSD EPA ID: CAD981662505 CAD099452708

Gen County:

Fresno Fresno

Tsd County: Tons:

12.45

Facility Address 2:

Not reported

Waste Category:

Waste oil and mixed oil

Disposal Method:

Recycler

Contact:

ANGELA BANKS PROJECT MGR

Telephone:

(215) 430-9645

Mailing Name:

Not reported

Mailing Address: 3111 W ALLEGHENY AVENUE

PHILADELPHIA, PA 19132 - 1116

County

Fresno

Gepaid:

CAD981662505

TSD EPA ID: Gen County:

NVR000001925

Tsd County:

Fresno Fresno

Tons:

1.06

Facility Address 2:

Not reported

Waste Category:

Unspecified aqueous solution

Recycler

Disposal Method: Contact:

ANGELA BANKS PROJECT MGR

Telephone:

(215) 430-9645

Mailing Name:

Not reported

Mailing Address: 3111 W ALLEGHENY AVENUE

PHILADELPHIA, PA 19132 - 1116

County

Fresno

Gepaid: TSD EPA ID: CAD981662505

Gen County:

CAD099452708

Tsd County:

Fresno

Fresno

Tons:

5.12

Not reported

Facility Address 2:

Waste oil and mixed oil

Waste Category: Disposal Method:

Not reported

Contact:

ANGELA BANKS PROJECT MGR

Telephone:

(215) 430-9645

Mailing Name:

Not reported

Mailing Address: 3111 W ALLEGHENY AVENUE

PHILADELPHIA, PA 19132 - 1116

County

Fresno

CUPA:

Facility ID:

FA0169028

Region:

CUPA

Owner Name:

Program Element: LARGE QUANTITY GENERATOR

APM Number:

PEP BOYS INC

Not reported

Facility ID: Region:

FA0169028 **CUPA**

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

PEP BOYS #624 (Continued)

U003941078

Program Element: UST REMOVAL/CLOSURE W/1 TANK PEP BOYS INC Owner Name:

APM Number:

Not reported

Facility ID:

FA0169028

Region:

CUPA

Program Element: AUTO REPAIR/MAINTENANCE MODEL PLAN

Owner Name:

PEP BOYS INC

APM Number:

Not reported

Facility ID:

FA0169028

Region:

CUPA

Owner Name:

Program Element: CLOSED UST FACILITY/DATA VAULT

PEP BOYS INC

APM Number:

Not reported

SWEEPS:

Status:

Comp Number:

13452

Number:

Board Of Equalization: 44-003742

Ref Date:

07-28-92

Act Date:

01-29-93

Created Date:

02-29-88

Tank Status: Owner Tank Id:

Swrcb Tank Id:

Not reported 10-000-013452-000001

Actv Date:

07-28-92

Capacity:

550

Tank Use:

OIL

Stg:

W

Content: Number Of Tanks: WASTE OIL

State UST:

Facility ID:

Region:

FA0169028

Local Agency:

STATE 10000

31

CITY OF FRESNO CONSTRUCTION TRAILER

SSW 1/8-1/4

FRESNO, CA 93721

752 H

1009 ft.

Fresno Co. CUPA \$105047383 NA

Relative: Equal

CUPA:

Facility ID: Region:

FA0275125

CUPA

Actual: 292 ft.

Program Element: UST REMOVAL/CLOSURE W/1 TANK

Owner Name: APM Number: FRESNO, CITY OF

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

Fresno Co. CUPA

RCRA-SQG

FINDS

EDR ID Number **EPA ID Number**

S104868998

1000383454

CAD028184281

NA

H32 SE

DENSMORE ENGINES

665 FULTON

1/8-1/4

FRESNO, CA 93721

1024 ft.

Site 1 of 3 in cluster H

Relative: Lower

CUPA:

Facility ID:

FA0271732 **CUPA**

Actual: 291 ft.

Region:

Program Element: SMALL QUANTITY GENERATOR

Owner Name: APM Number: SCHMIDT, LARRY

Not reported

Facility ID:

FA0271732

Region:

CUPA

Program Element: SMALL HAZARDOUS MATERIALS HANDLER

Owner Name:

SCHMIDT, LARRY

APM Number:

Not reported

H33 SE

DENSMORE ENGINE RE-NU & SUPPLY

665 FULTON ST

1/8-1/4 1030 ft. **FRESNO, CA 93721**

Relative:

Site 2 of 3 in cluster H

Lower

RCRAInfo:

Owner:

DENSMORE (415) 555-1212

Actual: 291 ft.

EPA ID:

CAD028184281

Contact:

ENVIRONMENTAL MANAGER

(209) 233-0764

Classification:

Small Quantity Generator

TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site: California - Hazardous Waste Tracking System - Datamart

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

134

GOLDEN STATE PLAZA 2220 TULARE

NNE 1/8-1/4

FRESNO, CA 93721

1051 ft.

Site 1 of 4 in cluster I

Relative: Higher

Actual: 293 ft.

CA FID UST S101622180 **SWEEPS UST** N/A

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

GOLDEN STATE PLAZA (Continued)

S101622180

FID:

Facility ID: Reg By:

10002345

Regulate ID: Active Underground Storage Tank Location

Cortese Code:

Not reported

SIC Code:

00054596

Status:

Active

Facility Tel:

Not reported

Mail To:

Not reported

2220 TULARE **FRESNO, CA 93721**

(209) 237-3121

Contact: DUNs No:

Not reported Not reported

Contact Tel: NPDES No: Modified:

Not reported Not reported 00/00/00

Creation: EPA ID: Comments:

10/22/93 Not reported

Not reported

SWEEPS:

Status:

Comp Number:

54596

Number:

Board Of Equalization: 44-004477 Ref Date:

07-01-85

Act Date:

Not reported

Created Date:

02-29-88 Α

Tank Status: Owner Tank Id:

#2

Swrcb Tank Id:

10-000-054596-000001

Actv Date:

07-01-85 Not reported

Capacity:

UNKNOWN

Tank Use: Stg:

3

Content:

Not reported

Number Of Tanks:

Status:

Comp Number: Number:

54596

Board Of Equalization: 44-004477 Ref Date:

07-01-85

Act Date:

Not reported

Created Date:

02-29-88

Tank Status:

Owner Tank Id:

#U

Swrcb Tank Id: Actv Date:

10-000-054596-000002 07-01-85

Capacity:

Not reported UNKNOWN

Tank Use:

Stg:

Content:

Number Of Tanks:

Not reported Not reported

Comp Number:

54596

Number:

Status:

Board Of Equalization: 44-004477

07-01-85

Ref Date: Act Date :

Not reported

Created Date:

02-29-88

Tank Status:

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

S101622180

GOLDEN STATE PLAZA (Continued)

Owner Tank Id:

Swrcb Tank Id:

10-000-054596-000003

Actv Date : Capacity:

07-01-85 Not reported

Tank Use:

UNKNOWN

Stg:

Number Of Tanks:

Not reported

Content:

Not reported

135 NNE **GOLDEN STATE PLAZA** 2220 TULARE ST **FRESNO, CA 93721**

HIST UST

FRESNO CIVIC CENTER PARTNERS L

FRESNO CIVIC CENTER PARTNERS L

FRESNO CIVIC CENTER PARTNERS L

U001592373 WA

1/8-1/4 1051 ft.

Site 2 of 4 in cluster I

Total Tanks:

Relative: Higher Actual:

293 ft.

UST HIST:

Facility ID:

54596

Owner Address: 2220 TULARE ST.

FRESNO, CA 93721

Tank Used for:

WASTE

Tank Num:

00000000 Tank Capacity: Type of Fuel: Not reported

Leak Detection:

None

WASTE

Not reported

Contact Name:

Facility Type:

DANN CARNAHAN Other

Facility ID:

54596

Total Tanks:

Owner Address: 2220 TULARE ST.

FRESNO, CA 93721

Tank Used for:

Tank Num:

Tank Capacity: 00000000

Type of Fuel:

Leak Detection: None DANN CARNAHAN

Contact Name:

Facility Type: Other

Facility ID:

54596

Total Tanks:

2220 TULARE ST. Owner Address:

FRESNO, CA 93721 WASTE

00000000

WASTE OIL

Tank Used for:

Tank Num:

Tank Capacity:

Type of Fuel:

Leak Detection:

None DANN CARNAHAN

Contact Name:

Facility Type: Other

54596

Facility ID:

Total Tanks:

Owner Address:

2220 TULARE ST.

FRESNO, CA 93721

Tank Used for: WASTE

Tank Num:

Tank Capacity: 00000000 Telephone: Other Type:

Owner Name:

Container Num:

Year Installed:

Telephone:

Other Type:

Region:

Owner Name:

Container Num:

Year Installed:

Telephone:

Other Type:

Owner Name:

Region:

Region:

STATE

#2

Tank Construction: Not Reported

1962

STATE

#U

Tank Construction: Not Reported

1962

STATE

1962

Tank Construction: Not Reported

(209) 237-3121

OFFICE BUILDING

(209) 237-3121

OFFICE BUILDING

Container Num:

Year Installed:

(209) 237-3121 OFFICE BUILDING

Owner Name:

Container Num:

Year Installed:

Region:

FRESNO CIVIC CENTER PARTNERS L STATE

#3

1962

TC1706388.1s Page 29

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

U001592373

GOLDEN STATE PLAZA (Continued)

Type of Fuel:

Not reported

Tank Construction: Not Reported

Leak Detection:

None

Contact Name: Facility Type:

DANN CARNAHAN Other

Telephone: Other Type: (209) 237-3121

136 NNE 1/8-1/4 **URBAN FRESNO STORMWATER DICH** 2220 TULARE STREET, 6TH FLOOR

OFFICE BUILDING

1051 ft.

FRESNO, CA 93721

Fresno Co. CUPA

S105689376 **CA WDS** WA

Relative: Higher

Site 3 of 4 in cluster I

Facility ID: **Facility Contact**

WDS:

San Joaquin 106000003 RICHARD L. BROGAN

SIC Code 2:

Facility Telephone (559) 262-4240 Not reported

Actual: 293 ft. SIC Code: Agency Name:

9999

COUNTY OF FRESNO

Agency Address: 2220 TULARE STREET, 6TH FLOOR

FRESNO 93721

Agency Contact: RICHARD L. BROGAN

Agency Phone:

(559) 262-4240

Design Flow:

Not reported

Facility Type:

Baseline Flow: Not reported

Municipal/Domestic - Facility that treats sewage or a mixture of predominantly sewage and other waste from districts, municipalities, communities, hospitals, schools, and publicly or privately owned systems (excluding individual subsurface leaching systems disposing of less than 1,000 gallons per day).

Facility Status:

Active - Any facility with a continuous or seasonal discharge that is under Waste Discharge Requirements.

Agency Type: County

Waste Type:

Stormwater Runoff - Nonhazardous Solid Wastes/Influent or Solid Wastes that contain

nonhazardous putrescible and non putrescible solid, semisolid, and liquid wastes (E.G., garbage, trash, refuse, paper, demolition and construction wastes, manure, vegetable or

animal solid and semisolid waste).

Major Threat to Water Quality. A violation could render unusable a ground water or surface Threat to Water:

water resource used as a significant drink water supply, require closure of an area used for contact recreation, result in long-term deleterious effects on shell fish spawning or growth areas of aquatic resources, or directly expose the public to toxic substances.

Category A - Any major NPDES facility, any non-NPDES facility (particularly those with toxic wastes) that would be a major if discharge was made to surface or ground waters, or any Class I disposal site. Includes any small-volume complex facility (particularly those with toxicwastes) with numerous discharge points, leak detection systems or ground water monitoring wells.

Reclamation:

Complexity:

No reclamation requirements associated with this facility.

POTW-

The facility is not a POTW.

NPDES Number: CAS0083500 The 1st 2 characters designate the state. The remaining 7 are assigned by the

Regional Board

Subregion:

5F

CUPA:

Facility ID:

FA0274624

Region:

CUPA

Program Element: HAZARDOUS WASTE TREATMENT-PERMIT BY RULE

Owner Name: APM Number:

FRESNO, COUNTY OF Not reported

Facility ID:

FA0274624 CUPA

Region:

Program Element: HAZARDOUS WASTE TREATMENT-PERMIT BY RULE

Owner Name:

FRESNO, COUNTY OF

APM Number:

Map ID Direction Distance Distance (ft.) Site Elevation

Database(s)

EDR ID Number EPA ID Number

URBAN FRESNO STORMWATER DICH (Continued)

S105689376

Facility ID:

FA0274624 CUPA

Region:

Program Element: LARGE QUANTITY GENERATOR

Owner Name:

FRESNO, COUNTY OF

APM Number:

Not reported

Facility ID:

FA0274624

Region:

CUPA

Program Element: HAZARDOUS WASTE TREATMENT-PERMIT BY RULE

Owner Name:

FRESNO, COUNTY OF

APM Number:

Not reported

Facility ID:

FA0274624

Region:

CUPA

Program Element: HAZARDOUS WASTE TREATMENT-PERMIT BY RULE

Owner Name:

FRESNO, COUNTY OF

APM Number:

Not reported

Facility ID:

FA0275320

Region:

CUPA

Program Element: UNSTAFFED FACILITY MODEL PLAN

Owner Name:

VERIZON WIRELESS

APM Number:

Not reported

137

MCI TELECOMMUNICATIONS 2220 TULARE 21ST FLOOR

NNE 1/8-1/4

1055 ft.

FRESNO, CA 93721

Site 4 of 4 in cluster I

Relative: Higher

CUPA:

Facility ID:

FA0271971

Actual:

CUPA Region:

293 ft.

Program Element: HAZ MAT DISCLOSURE/CLOSED SITE

Owner Name:

MCI WORLDCOM

APM Number:

Not reported

H38 SE

ADVANTAGE TIRE SERVICE

650 FULTON

1/8-1/4 1102 ft.

FRESNO, CA 93721

CA FID UST Fresno Co. CUPA **SWEEPS UST**

Fresno Co. CUPA

\$101581488 WA

S104871437

N/A

Site 3 of 3 in cluster H

Relative: Equal

FID:

Facility ID:

Regulate ID:

Not reported

Actual: 292 ft.

Reg By: Cortese Code:

Inactive Underground Storage Tank Location Not reported

SIC Code: Facility Tel:

Contact Tel:

NPDES No:

Modified:

Not reported Not reported

Not reported

Not reported

00/00/00

Status: Mail To: Inactive

Not reported

1555 ELSON

FRESNO, CA 93721

Contact: DUNs No: Not reported

Not reported

10/22/93

Creation: EPA ID: Comments:

Not reported Not reported

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number**

ADVANTAGE TIRE SERVICE (Continued)

S101581488

CUPA:

Facility ID:

FA0268280

Region:

CUPA

Program Element: UST REMOVAL/CLOSURE W/1 TANK

Owner Name:

HOOPER, MIKE

APM Number:

Not reported

SWEEPS:

Status:

Not reported

Comp Number:

Number: Board Of Equalization: Not reported

Not reported

Ref Date:

Not reported

Act Date :

Not reported

Created Date:

Not reported

Tank Status:

Not reported

Owner Tank ld:

Not reported

Swrcb Tank Id:

10-000-000031-000001

Actv Date:

Not reported

Capacity:

1000

Tank Use:

OIL

Stg:

WASTE

Content:

WASTE OIL

Number Of Tanks:

J39

West 1/8-1/4 1109 ft. **HOBBS PARSONS PRODUCE**

951 H ST

FRESNO, CA 93721

CA FID UST S101622184 **SWEEPS UST** N/A

Site 1 of 4 in cluster J

Relative: Lower

FID:

Facility ID:

10001022

Inactive Underground Storage Tank Location

Regulate ID:

00010563

Actual: 290 ft.

Reg By: Cortese Code:

Not reported

SIC Code:

Not reported

Status:

Inactive

Facility Tel:

(209) 237-6111

Mail To:

Not reported 951 H ST

Contact:

FRESNO, CA 93721 Not reported

Contact Tel: NPDES No:

Not reported Not reported

DUNs No: Creation:

Not reported

10/22/93

EPA ID: Not reported Modified:

00/00/00

Comments:

Not reported

SWEEPS:

Status:

Not reported 10563

Comp Number:

Not reported

Number: Board Of Equalization:

44-003646

Ref Date:

Not reported

Act Date:

Not reported

Created Date:

Not reported

Tank Status:

Not reported

Owner Tank Id: Swrcb Tank Id:

Not reported 10-000-010563-000001

Actv Date:

Not reported

Capacity:

Tank Use:

10000 M.V. FUEL

Map ID Direction Distance Distance (ft.) Elevation

Database(s)

EDR ID Number EPA ID Number

S101622184

HOBBS PARSONS PRODUCE (Continued)

Stg:

PRODUCT DIESEL

Content:

Number Of Tanks:

Status:

Not reported

10563 Comp Number: Number:

Not reported

Board Of Equalization:

44-003646

Ref Date:

Not reported

Act Date :

Not reported Not reported

Created Date: Tank Status:

Not reported Not reported

Owner Tank ld: Swrcb Tank Id:

10-000-010563-000002

Actv Date:

Not reported

Capacity:

2000

Tank Use:

M.V. FUEL

Stg:

PRODUCT

Content:

GASOLINE

Number Of Tanks:

Not reported

Status:

Not reported

Comp Number :

10563

Number:

Not reported

Board Of Equalization: 44-003646

Ref Date:

Not reported

Act Date :

Not reported

Created Date:

Not reported

Tank Status:

Not reported

Owner Tank Id:

Not reported

Swrcb Tank Id: Actv Date:

10-000-010563-000003

Capacity:

Not reported 1000

Tank Use:

M.V. FUEL

PRODUCT

Stg:

Content:

GASOLINE

Number Of Tanks:

Not reported

Not reported

Comp Number:

10563

Status: Number:

Not reported

Board Of Equalization: 44-003646

Ref Date:

Not reported

Act Date :

Not reported

Created Date:

Not reported

Tank Status:

Not reported

Owner Tank Id:

Not reported 10-000-010563-000004

Swrcb Tank ld:

Not reported

Actv Date: Capacity:

500

OIL

Tank Use:

WASTE

Stg:

WASTE OIL

Content: Number Of Tanks:

Map ID Direction Distance Distance (ft.) Elevation

Database(s)

EDR ID Number EPA ID Number

K40 -ESE 1/8-1/4

FRESNO OFFICE MACHINES

660 VAN NESS

FRESNO, CA 93721

Site 1 of 2 in cluster K

CA FID UST SWEEPS UST

S101622176 N/A

Relative: Equal

1126 ft.

FID:

Facility ID:

10003747

Regulate ID:

00058831

Actual: 292 ft.

Reg By:

Active Underground Storage Tank Location

SIC Code:

Cortese Code: Status:

Not reported Active

Facility Tel:

Not reported (209) 264-4667

Mail To:

Not reported

660 VAN NESS

FRESNO, CA 93721

Contact:

Not reported Not reported

Contact Tel: NPDES No: Not reported

DUNs No: Creation: EPA ID:

Comments:

10/22/93 Not reported

Not reported

Modified:

Not reported 00/00/00

SWEEPS:

Status:

A 58831

Comp Number: Number:

Board Of Equalization: 44-004555

Ref Date:

07-01-85

Act Date :

Not reported

Created Date:

02-29-88

Tank Status:

Owner Tank ld:

Swrcb Tank ld:

10-000-058831-000001

Actv Date:

07-01-85

Capacity:

Not reported

Tank Use:

UNKNOWN

Stg:

Content:

Not reported

Number Of Tanks:

2

Status:

Comp Number:

58831

Number:

Board Of Equalization: 44-004555 Ref Date:

07-01-85

Act Date:

Not reported

Created Date:

02-29-88

Tank Status:

Owner Tank Id: Swrcb Tank Id:

10-000-058831-000002

Actv Date:

07-01-85

Capacity:

Tank Use:

UNKNOWN

Stg:

Content: Number Of Tanks: Not reported Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

K41 **ESE** 1/8-1/4

FRESNO OFFICE MACHINES 660 VAN NESS AVE **FRESNO, CA 93721**

HIST UST

U001592367 WA

1126 ft. Relative:

Site 2 of 2 in cluster K

Total Tanks:

Equal Actual:

292 ft.

UST HIST:

Facility ID:

58831

Owner Address: 660 VAN NESS **FRESNO, CA 93721**

PRODUCT Tank Used for:

Tank Num:

Tank Capacity: 00000000 Type of Fuel: Not reported

Leak Detection: Visual Contact Name:

ROBERT RYAN Other

Facility Type:

Facility ID: 58831

Total Tanks:

Owner Address:

660 VAN NESS **FRESNO, CA 93721**

Tank Used for: PRODUCT

Tank Num: Tank Capacity: Type of Fuel:

Not reported Leak Detection: Visual Contact Name: ROBERT RYAN

00000025

Facility Type:

Owner Name:

ROBERT RYAN

Region:

STATE

Container Num: Year Installed: 1964 Tank Construction: 3/16 inches

Telephone:

(209) 264-4667

ROBERT RYAN

Other Type:

OFFICE MACHINE REPAI

Owner Name: Region:

STATE

Container Num: 2

Year Installed: 1952 Tank Construction: 3/16 inches

Telephone: Other Type: (209) 264-4667

OFFICE MACHINE REPAI

L42 NW 1/8-1/4 1159 ft. **SECURITY BANK GARAGE 1060 FULTON MALL FRESNO, CA 93721**

HIST UST U001592403 N/A

Site 1 of 2 in cluster L

Relative: Equal

UST HIST:

Facility ID:

2945

Region:

Owner Name:

CAHUENGA ASOCIATES I

STATE

Actual: 292 ft.

Total Tanks:

Owner Address:

6777 HOLLYWOOD BLVD, SUITE 700 HOLLYWOOD, CA 90028

PRODUCT

Tank Used for:

Tank Num:

00000500 Tank Capacity: UNLEADED

Type of Fuel: Leak Detection: Contact Name:

Facility Type:

Visual

Not reported Other

Telephone:

Container Num:

1969 Year Installed: Tank Construction: Not Reported

Other Type:

(209) 233-1602 PARKING GARAGE

Facility ID: Total Tanks:

2945

6777 HOLLYWOOD BLVD, SUITE 700

HOLLYWOOD, CA 90028 PRODUCT

Tank Used for: Tank Num:

Owner Address:

Type of Fuel:

Facility Type:

Tank Capacity:

00000500 REGULAR Leak Detection: Visual Contact Name: Not reported

Other

Owner Name: Region:

CAHUENGA ASOCIATES I

STATE

Container Num: Year Installed:

Not reported Tank Construction: Not Reported

Telephone: Other Type: (209) 233-1602 PARKING GARAGE

Map ID MAP FINDINGS

Direction Distance Distance (ft.)

Site Elevation

Database(s)

EDR ID Number **EPA ID Number**

L43 NW 1/8-1/4 **SECURITY BANK GARAGE**

1060 FULTON MALL FRESNO, CA 93721

CA FID UST SWEEPS UST

S101622197 WA

Site 2 of 2 in cluster L

Relative: Equal

1159 ft.

FID:

10005036

Regulate ID:

Actual: 292 ft.

Facility ID: Reg By:

Active Underground Storage Tank Location

00002945

Cortese Code:

Not reported

SIC Code:

Not reported

Not reported

Not reported

00/00/00

Status:

Active

Facility Tel:

Contact Tel:

NPDES No:

Modified:

(209) 233-1602

Mail To:

Contact:

DUNs No:

Not reported 1060 FULTON MALL

FRESNO, CA 93721

Not reported

Not reported

10/22/93

Creation: EPA ID: Comments:

Not reported

Not reported

SWEEPS:

Status:

Comp Number:

2945

Number:

Board Of Equalization: 44-003472

Ref Date:

07-01-85

Act Date :

Not reported

Created Date:

02-29-88

Tank Status:

Owner Tank Id:

Swrcb Tank Id:

10-000-002945-000001

Actv Date:

07-01-85

Capacity:

500

Tank Use:

M.V. FUEL

Stg:

Content: **REG UNLEADED**

Number Of Tanks:

Status:

Comp Number:

2945

Number:

Board Of Equalization: 44-003472 Ref Date:

07-01-85

Act Date :

Not reported

Created Date:

02-29-88

Tank Status:

Owner Tank Id:

Swrcb Tank Id: Actv Date:

10-000-002945-000002 07-01-85

Capacity:

Tank Use:

500 M.V. FUEL

Stg:

Content: Number Of Tanks: LEADED Not reported

Map ID Direction Distance Distance (ft.) Elevation

Database(s)

RCRA-SQG

FINDS

EDR ID Number **EPA ID Number**

1000203476

CAD982500415

44 South WHEEL CREATIONS PLUS

706 H ST

1/8-1/4

FRESNO, CA 93721

1161 ft.

Relative: Higher

RCRAInfo:

Owner:

WHEEL CREATIONS INC

(415) 555-1212

Actual: 293 ft.

EPA ID: Contact:

CAD982500415 **ENVIRONMENTAL MANAGER**

(209) 233-3654

Classification:

Small Quantity Generator

TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Confirm Leak:

Prelim Assess:

Remed Plan:

J45 West 1/8-1/4 1169 ft.

GREYHOUND BUS DEPOT 1033 BROADWAY

FRESNO, CA 93721

LUST S106175454 Fresno Co. CUPA WA CA WDS

SWEEPS UST

Not reported

Not reported

Not reported

Relative:

Site 2 of 4 in cluster J

Lower Actual:

290 ft.

State LUST:

Cross Street:

Qty Leaked: Not reported 5T10000457 Case Number

Reg Board:

5F Chemical:

Lead Agency:

Diesel Local Agency

TULARE

Local Agency:

10000

Case Type:

Undefined

Status:

Pollution Characterization

Review Date: Workplan:

Not reported Not reported

Pollution Char:

Not reported

Remed Action:

Not reported

Monitoring:

Not reported

Close Date:

Not reported

Release Date:

1993-11-10 00:00:00

Cleanup Fund Id: Not reported

1993-04-14 00:00:00

Discover Date:

Enforcement Dt: 1965-01-01 00:00:00

Enf Type:

None Taken

Enter Date:

1993-12-07 00:00:00 Responsible Party

Funding: Staff Initials:

JRA

How Discovered: Not reported

How Stopped:

Not reported

Interim:

Leak Cause:

Not reported

Leak Source:

UNK UNK

MTBE Date:

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S106175454

GREYHOUND BUS DEPOT (Continued)

Max MTBE GW: Not reported

MTBE Tested: Not Required to be Tested.

Priority: Medium priority Local Case # : FA0169029

Beneficial: Not reported Staff: DAM GW Qualifier: Not reported

GW Qualifier: Not reported
Max MTBE Soil: Not reported
Soil Qualifier: Not reported
Hydr Basin #: SAN JOAQUIN (5-22)

Operator : VINCENT HERNANDEZ
Oversight Prgm: LUST

Review Date : 1993-12-07 00:00:00 Stop Date : 1993-01-26 00:00:00

Work Suspended No

Responsible PartyGREYHOUND LINES, INC.

RP Address:

P.O. BOX 660362, DALLAS, TX 75266-0362

Global Id: T0601900447
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0

Mtbe Fuel: 0

Water System Name:

LANCASTER PARK MOBILE HOME PARK

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: W0601900038 Waste Disch Assigned Name: 1000038-001GEN

Waste Disch Assigned Name: 1000038-001GEN
Summary: FRESNO COUNTY COMMUN

FRESNO COUNTY COMMUNITY HEALTH DEPARTMENT HAS REQUIRED THE

RESPONSIBLE PARTY TO SECURE THE SERVICES OF AN ENVIRONMEN- TAL

Case Number:

5T10000457

ENGINEERING CONSULTING FIRM.

LUST Region 5:

Substance: DIESEL
Case Type: Undefined
Program: LUST

Staff Initials:

DAM

Statt Initials:

Pollution Characterization

MTBE Code: N/A

Lead Agency: Local

WDS:

Facility ID: 5F 10I004606 Facility Contact Not reported

SIC Code: No

Not reported Facility Telephone Not reported SIC Code 2: Not reported

Agency Name: GREYHOUND LINES INC

Agency Address: Not reported Agency Contact: Not reported

Design Flow: Not reported Not r

Not reported
Not reported
Not reported
Not reported
Not reported
Not reported

Facility Status: Active - Any facility with a continuous or seasonal discharge that is under Waste Discharge Requirements.

Agency Type: Not reported Waste Type: Not reported

Threat to Water: Minor Threat to Water Quality. A violation of a regional board order should cause a

relatively minor impairment of beneficial uses compared to a major or minor threat. Not: All nurds without a TTWQ will be considered a minor threat to water quality unless coded at a higher Level. A Zero (0) may be used to code those NURDS that are found to represent

no threat to water quality.

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S106175454

GREYHOUND BUS DEPOT (Continued)

Complexity:

Category C - Facilities having no waste treatment systems, such as cooling water dischargers or thosewho must comply through best management practices, facilities with passive waste treatment and disposal systems, such as septic systems with subsurface disposal, or dischargers having waste storage systems with land disposal such as dairy

waste ponds.

Reclamation: POTW:

Not reported Not reported

NPDES Number:

CAS000001 The 1st 2 characters designate the state. The remaining 7 are assigned by the

Regional Board

Subregion:

CUPA:

Facility ID: Region:

FA0169029

CUPA

Program Element: CONTAMINATED UST SITE/EHS LEAD AGENCY

Owner Name:

GREYHOUND LINES INC

APM Number:

Not reported

Facility ID:

FA0169029

Region:

CUPA

Program Element: UST REMOVAL/CLOSURE W/2 TANKS

Owner Name:

GREYHOUND LINES INC

APM Number:

Not reported

Facility ID:

FA0169029 **CUPA**

Region:

Program Element: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

Owner Name:

GREYHOUND LINES INC

APM Number:

Not reported

Facility ID:

FA0169029

Region:

CUPA

Program Element: AUTO REPAIR/MAINTENANCE MODEL PLAN Owner Name:

APM Number:

GREYHOUND LINES INC

Not reported

SWEEPS:

Status:

Comp Number:

10531

Number:

Board Of Equalization: 44-003644

Ref Date:

01-31-89

Act Date:

01-31-89

Created Date:

02-29-88

Tank Status:

Owner Tank Id:

10-000-010531-000001

Swrcb Tank Id: Actv Date:

01-31-89 12000

Capacity: Tank Use:

M.V. FUEL

Stg:

DIESEL

Content: Number Of Tanks:

2

Status:

Comp Number:

10531

Number:

Board Of Equalization: 44-003644

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S106175454

GREYHOUND BUS DEPOT (Continued)

Ref Date:

01-31-89

Act Date: Created Date: 01-31-89 02-29-88

Tank Status: Owner Tank Id:

Α

Swrcb Tank Id:

10-000-010531-000002 01-31-89

Actv Date: Capacity:

10000 M.V. FUEL

Tank Use: Stg:

Content:

DIESEL

Number Of Tanks:

Not reported

J46 West **GREYHOUND BUS DEPOT**

CA FID UST \$101581562

N/A

U001592374

N/A

1/8-1/4 1169 ft.

1033 BROADWAY **FRESNO, CA 93721**

Site 3 of 4 in cluster J

Relative: Lower

Actual:

290 ft.

FID:

Facility ID:

10002182

Regulate ID:

00010531

Reg By: Cortese Code:

Active Underground Storage Tank Location Not reported

Status:

Active

SIC Code: Facility Tel:

Contact Tel:

Not reported (209) 264-0009

Mail To:

Not reported 1033 BROADWAY

FRESNO, CA 93721

Contact: **DUNs No:**

Not reported Not reported

Creation:

10/22/93

NPDES No: Modified:

Not reported Not reported 00/00/00

EPA ID: Comments:

Not reported Not reported

J47

1033 BROADWAY ST

West 1/8-1/4 **GREYHOUND LINES, INC.-WEST**

FRESNO, CA 93721

1169 ft.

Site 4 of 4 in cluster J

Relative: Lower

Actual:

290 ft.

UST HIST:

Facility ID: Total Tanks:

2

10531

Owner Name: Region:

GREYHOUND LINES, INC.

HIST UST

Owner Address: GREYHOUND TOWER

PHOENIX, AZ 85077

Tank Used for:

PRODUCT

Tank Num: Tank Capacity: Type of Fuel:

00012000

DIESEL

Stock Inventor

N. DUNFORD

Year Installed: Tank Construction: 1/4 inches

Container Num:

1973

STATE

Leak Detection: Contact Name:

Telephone:

(209) 264-0009

Facility Type:

Owner Address:

Other

Other Type:

BUS TRANSPORTATION

Facility ID: Total Tanks:

10531

Owner Name:

GREYHOUND TOWER

PHOENIX, AZ 85077 Tank Used for:

Tank Num:

PRODUCT

2

Region:

GREYHOUND LINES, INC.

STATE

2

Container Num:

Map ID Direction Distance Distance (ft.) Elevation

Database(s)

EDR ID Number EPA ID Number

GREYHOUND LINES, INC.-WEST (Continued)

U001592374

Tank Capacity: Type of Fuel:

00010000 DIESEL

Other

Year Installed: Tank Construction: Not Reported

1960

Stock Inventor Leak Detection: Contact Name:

Telephone:

(209) 264-0009

Facility Type:

N. DUNFORD

Other Type:

BUS TRANSPORTATION

48

R&N AUTOMOTIVE

NE

Fresno Co. CUPA

\$104869819 WA

1/8-1/4

901 M **FRESNO, CA 93710**

1198 ft.

CUPA:

Relative: Higher

Facility ID:

FA0270694

Actual: 293 ft.

CUPA Region:

Program Element: UST REMOVAL/CLOSURE W/3 TANKS FRESNO, COUNTY OF

Owner Name: APM Number:

Not reported

49 NE LONG CONSTRUCTION INC

S103674237 HAZNET Fresno Co. CUPA WA

1/8-1/4

850 M ST

1199 ft.

FRESNO, CA 93721

Relative: Higher

HAZNET:

Gepaid:

CAC001223872 CAT080013352

Actual: 293 ft.

TSD EPA ID: Gen County:

Fresno

Tsd County:

Los Angeles

Tons:

2.3685

Facility Address 2:

Not reported

Waste Category:

Unspecified oil-containing waste

Disposal Method:

Recycler

Contact:

LONG CONSTRUCTION INC

Telephone:

(209) 438-5695

Mailing Name:

Not reported

Mailing Address: PO BOX 2475

FRESNO, CA 93729

County

Fresno

CUPA:

Facility ID:

FA0272835

Region:

CUPA Program Element: UST REMOVAL/CLOSURE W/1 TANK

Owner Name:

BUD LONG CONSTRUCTION

APM Number:

Not reported

M50

ARROW ELECTRIC MOTOR SERVICE

HAZNET Fresno Co. CUPA S104575213 NA

SSE

645 BROADWAY FRESNO, CA 93721

1/8-1/4

1208 ft.

Site 1 of 3 in cluster M

Relative: Equal

Actual: 292 ft.

EMI

TC1706388.1s Page 41

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

ARROW ELECTRIC MOTOR SERVICE (Continued)

S104575213

HAZNET:

Gepaid: TSD EPA ID:

CAL000000403

Gen County: Tsd County:

Not reported Fresno Los Angeles

Tons:

1.00 Not reported

Facility Address 2: Waste Category:

Contaminated soil from site clean-ups

Disposal Method:

Disposal, Land Fill

Contact:

LARRY KRAGH - PRESIDENT

Telephone:

(559) 266-0104 Not reported

Mailing Name:

Mailing Address: 645 BROADWAY ST

FRESNO, CA 93721 - 2805

County

Not reported

Gepaid: TSD EPA ID: CAL000000403 CAD044429835

Gen County:

Fresno

Tsd County:

Los Angeles

Tons:

.2475

Facility Address 2: Waste Category:

Not reported Degreasing sludge Treatment, Incineration

Disposal Method: Contact:

LARRY KRAGH

Telephone: Mailing Name:

(209) 266-0104 Not reported Mailing Address: 645 BROADWAY ST

FRESNO, CA 93721 - 2805

County

Fresno

Gepaid: TSD EPA ID: CAL000000403 CAT000613893

Gen County:

Fresno

Tsd County:

Los Angeles

Tons: Facility Address 2: .0810

Waste Category:

Not reported

Disposal Method:

Oxygenated solvents (acetone, butanol, ethyl acetate, etc.) **Transfer Station**

Contact:

LARRY KRAGH (209) 266-0104

Telephone: Mailing Name:

Not reported Mailing Address: 645 BROADWAY ST

FRESNO, CA 93721 - 2805

County

Fresno

Gepaid: TSD EPA ID: CAL000000403 CAT080013352

Gen County: Tsd County:

Fresno Los Angeles

Tons:

1.8348 Not reported

Facility Address 2: Waste Category:

Waste oil and mixed oil

Disposal Method: Contact:

Recycler LARRY KRAGH

Telephone:

(209) 266-0104

Mailing Name:

Not reported Mailing Address: 645 BROADWAY ST

Map ID Direction . Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S104575213

ARROW ELECTRIC MOTOR SERVICE (Continued)

FRESNO, CA 93721 - 2805

County

Fresno

Gepaid: TSD EPA ID: CAL000000403

Gen County:

CAT080033681

Tsd County:

Fresno Los Angeles

Tons:

.2475 Not reported

Facility Address 2: Waste Category:

Degreasing sludge

Disposal Method:

Recycler

Contact: Telephone: LARRY KRAGH (209) 266-0104

Mailing Name:

Not reported

Mailing Address: 645 BROADWAY ST

FRESNO, CA 93721 - 2805

County

Fresno

Click this hyperlink while viewing on your computer to access 19 additional CA HAZNET record(s) in the EDR Site Report.

CUPA:

Facility ID:

FA0276007

Region:

CUPA

Program Element: SMALL HAZARDOUS MATERIALS HANDLER

Owner Name:

ARROW ELECTRIC MOTOR SVC INC

APM Number:

Not reported

Facility ID:

FA0276007 **CUPA**

Region:

Program Element: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

Owner Name:

ARROW ELECTRIC MOTOR SVC INC

APM Number:

Not reported

EMISSIONS:

Year:

2002

Facility ID: Air District Code : 61 SJU

SIC Code:

7629

Air Basin :

SJV

Air District Name:

SAN JOAQUIN VALLEY UNIFIED APCD

Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule:

Not reported

County Code:

10

County ID:

10

1

Total Organic Hydrocarbon Gases Tons/Yr:

Reactive Organic Gases Tons/Yr:

0

Carbon Monoxide Emissions Tons/Yr: NOX - Oxides of Nitrogen Tons/Yr:

0

SOX - Oxides of Sulphur Tons/Yr: Particulate Matter Tons/Yr:

0 0

Part. Matter 10 Micrometers and Smaller Tons/Yr: 0

MAP FINDINGS

Database(s)

Notify 65

Fresno Co. CUPA

HAZNET

Fresno Co. CUPA

Fresno Co. CUPA

EDR ID Number EPA ID Number

S106176037

U000050461

S104871404

S102815640

WA

WA

N/A

N/A

51 West POLICE DRESSING STATION

940 BROADWAY

1/8-1/4

FRESNO, CA 93721

1260 ft.

Relative: Lower

CUPA:

Facility ID:

FA0170680 **CUPA**

Actual:

Region:

289 ft.

Program Element: CLOSED UST FACILITY/DATA VAULT Owner Name: FRESNO, CITY OF

APM Number:

Not reported

52 SSE ACE SERVICE INC.

BROADWAY / VENTURA

FRESNO, CA 92028

1261 ft.

1/8-1/4

NOTIFY 65:

Relative: Higher

Date Reported:

Not reported

Staff Initials: Not reported

Actual: 293 ft.

Board File Number: Facility Type:

Not reported Not reported

Discharge Date:

Not reported

Incident Description: 92028

53 NNE

HALL OF RECORDS **2281 TULARE**

1/8-1/4

FRESNO, CA 93721

1263 ft.

Relative: Higher

CUPA:

Facility ID:

FA0267107

Region: **CUPA**

Actual: 293 ft.

Program Element: UST REMOVAL/CLOSURE W/1 TANK

Owner Name:

FRESNO, COUNTY OF

APM Number:

Not reported

M54 SSE **THOMAS RADIATOR**

627 BROADWAY FRESNO, CA 93721

1/8-1/4 1297 ft.

Site 2 of 3 in cluster M

Relative: Equal Actual:

HAZNET:

Gepaid: TSD EPA ID:

CAL000079388 CAT080033681

292 ft. Gen County: Fresno Los Angeles

Tsd County: Tons:

.2475

Facility Address 2: Waste Category: Disposal Method:

Not reported Degreasing sludge Disposal, Other

Contact: Telephone: HALL JAMES (000) 000-0000 Not reported

Mailing Name:

Mailing Address: 627 BROADWAY ST FRESNO, CA 93721

County

Fresno

Map ID Direction Distance Distance (ft.) Site Elevation

Database(s)

EDR ID Number **EPA ID Number**

THOMAS RADIATOR (Continued)

S102815640

Gepaid: TSD EPA ID: CAL000079388 CAT080022148

Gen County:

Fresno

Tsd County: Tons:

San Bernardino .2475

Facility Address 2: Waste Category:

Not reported Degreasing sludge

Disposal Method: Contact: Telephone:

Transfer Station HALL JAMES (000) 000-0000

Mailing Name: Mailing Address:

Not reported 627 BROADWAY ST FRESNO, CA 93721

County

Fresno

CUPA:

Facility ID:

FA0271551

Region: CUPA

Owner Name:

Program Element: HAZ MAT DISCLOSURE-BELOW REPORTING QUANTITY CHANCE, LEE R

APM Number:

Not reported

M55 SSE **SCHEDLER'S ENGINE REBUILDING & SUPL**

Fresno Co. CUPA \$104867713

N/A

1/8-1/4

626 BROADWAY FRESNO, CA 93721

1297 ft.

Site 3 of 3 in cluster M

Relative: Equal

CUPA:

Facility ID:

FA0271550

Actual:

Region:

CUPA

292 ft.

Owner Name:

Program Element: MV FUEL/OIL/PROPANE ONLY IN AGST/UST MODEL PL

APM Number:

SCHEDLER'S ENG REBLDG/SUPL INC

468-291-09

Facility ID:

FA0271550

Region:

CUPA

Program Element: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

Owner Name:

SCHEDLER'S ENG REBLDG/SUPL INC

APM Number:

468-291-09

56 North **EDUCATION CENTER**

U001592355 HIST UST

N/A

1/8-1/4 1297 ft. **TULARE/M STREETS** FRESNO, CA 93721

Relative: Higher

UST HIST:

Facility ID: Total Tanks: 46243

Owner Name:

FRESNO UNIFIED SCHOOL DISTRICT

Region:

STATE

15

Actual: 294 ft.

Owner Address:

TULARE AND M STREETS

FRESNO, CA 93721

Tank Used for:

Tank Num: Tank Capacity:

PRODUCT

Type of Fuel:

00010000

DIESEL

Container Num:

Year Installed:

1939 Tank Construction: Not Reported

Leak Detection: Contact Name:

None

SUPERINTENDANT/CUSTODIAN

Telephone:

(209) 441-3000 SCHOOL DISTRICT

Facility Type:

Other Type:

Map ID Direction Distance Distance (ft.)

MAP FINDINGS

Elevation

Database(s)

EDR ID Number EPA ID Number

N57 ESE 1/8-1/4 HAL'S TRUCK RENTAL **621 VAN NESS AVE FRESNO, CA 93721**

Site 1 of 3 in cluster N

HIST UST

U001592377 N/A

1317 ft. Relative: Equal

Actual:

292 ft.

UST HIST:

Facility ID: Total Tanks: 49625

621 VAN NESS FRESNO, CA 93721

Tank Used for: **PRODUCT**

Tank Num:

Owner Address:

Tank Capacity: 00005500 Type of Fuel: REGULAR Leak Detection: Stock Inventor

Contact Name: TYRONE JOUROYAN Facility Type: Gas Station

Facility ID:

49625 Total Tanks:

Owner Address: 621 VAN NESS

FRESNO, CA 93721 Tank Used for: **PRODUCT**

Tank Capacity:

Type of Fuel: REGULAR Leak Detection:

Contact Name: Facility Type:

Owner Name:

HAL'S TRUCK RENTAL, INC.

Region:

STATE

Container Num:

Year Installed: Not reported Tank Construction: Not Reported

Telephone: Other Type: (209) 266-9441

TRUCK RENTAL YARD

Owner Name: Region:

HAL'S TRUCK RENTAL, INC. STATE

Tank Num: 00007500

Stock Inventor

TYRONE JOUROYAN Gas Station

Container Num:

Year Installed: Not reported Tank Construction: Not Reported

Telephone: Other Type:

(209) 266-9441

TRUCK RENTAL YARD

N58 ESE 1/8-1/4

HAUS TRUCK RENTAL **621 VAN NESS FRESNO, CA 93721**

Site 2 of 3 in cluster N

Relative: Equal

Actual:

292 ft.

1317 ft.

CUPA:

Facility ID: Region:

FA0268256 CUPA

Program Element: CLOSED UST FACILITY/DATA VAULT

Owner Name:

JOUROYAN, HAROLD

APM Number:

Not reported

N59 ESE 1/8-1/4

HAL'S TRUCK RENTAL **621 VAN NESS FRESNO, CA 93721**

Site 3 of 3 in cluster N

CA FID UST S101622182 **SWEEPS UST** N/A

Fresno Co. CUPA S106175501

N/A

Relative: Equal

1317 ft.

Actual: 292 ft.

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

HAL'S TRUCK RENTAL (Continued)

S101622182

FID:

Facility ID:

Regulate ID:

00049625

Reg By: Cortese Code: Inactive Underground Storage Tank Location Not reported

SIC Code:

Not reported

Status:

Inactive

Facility Tel:

(209) 266-9441

Not reported

Mail To:

621 VAN NESS **FRESNO, CA 93721**

Contact Tel:

Not reported

Contact: **DUNs No:** Not reported Not reported

NPDES No: Modified:

Not reported 00/00/00

Creation:

10/22/93 Not reported

EPA ID: Comments: Not reported

SWEEPS:

Status: Comp Number: Not reported

Number: Board Of Equalization:

49625 Not reported Not reported

Ref Date: Act Date:

Not reported Not reported Not reported Not reported

Tank Status: Owner Tank Id: Swrcb Tank Id:

Created Date:

Not reported 10-000-049625-000001

Actv Date: Capacity:

Not reported 60000 M.V. FUEL

Tank Use: Stg:

PRODUCT LEADED

Content: Number Of Tanks:

Status:

Not reported

49625

Comp Number: Number:

Not reported Board Of Equalization: Not reported Not reported Not reported

Ref Date: Act Date : Created Date: Tank Status:

Not reported Not reported Not reported

Owner Tank Id: Swrcb Tank ld:

10-000-049625-000002

Actv Date:

Not reported 10000

Capacity: Tank Use:

M.V. FUEL **PRODUCT**

Content:

Stg:

REG UNLEADED

Number Of Tanks:

Not reported

Status:

Not reported 49625

Comp Number: Number:

Not reported

Board Of Equalization: Not reported Ref Date:

Not reported

Act Date:

Not reported Not reported

Created Date: Tank Status:

MAP FINDINGS

Confirm Leak:

Prelim Assess:

Remed Plan:

Not reported

Not reported

Not reported

Database(s)

EDR ID Number EPA ID Number

S101622182

HAL'S TRUCK RENTAL (Continued)

Owner Tank Id:

Not reported

Swrcb Tank Id:

10-000-049625-000003

Actv Date: Capacity:

Not reported

Tank Use:

7500

Stg:

M.V. FUEL **PRODUCT**

Content:

REG UNLEADED

Number Of Tanks:

Not reported

O60 WSW 1/4-1/2 1517 ft.

DEL MONTE FOODS PARKING L

1626 TULARE

FRESNO, CA 93706

LUST S102444880 Cortese N/A

Relative: Lower

Site 1 of 3 in cluster O

State LUST:

Cross Street:

Actual: 289 ft.

G ST

Qty Leaked: Case Number Not reported 5T10000630

Reg Board:

5F

Chemical:

Bunker Fuel Oil

Lead Agency:

Regional Board

Local Agency:

Case Type:

10000

Soil only

Status: Review Date: **Case Closed**

Not reported

Workplan:

Not reported

Pollution Char:

Remed Action:

Not reported Not reported

Monitoring:

Not reported

Close Date:

1996-10-21 00:00:00

Release Date:

1991-07-15 00:00:00

Cleanup Fund ld: Not reported

Discover Date: 1989-11-02 00:00:00

Enforcement Dt: 1965-01-01 00:00:00

Enf Type:

None Taken

Enter Date:

1996-10-21 00:00:00

Funding:

Responsible Party

Staff Initials:

UNK How Discovered: Subsurface Monitoring

How Stopped:

Not reported

Interim: Leak Cause: No UNK

Leak Source:

Tank

MTBE Date:

Not reported

Max MTBE GW:

Not reported

MTBE Tested:

Not Required to be Tested.

Priority: Local Case #:

FA0266637

Beneficial:

Not reported

Staff:

DAM

GW Qualifier:

Not reported

Max MTBE Soil: Soil Qualifier:

Not reported

Not reported

Hydr Basin #:

SAN JOAQUIN (5-22)

Operator: Oversight Prgm: DEL MONTE FOODS, USA

Review Date:

LUST 1996-10-21 00:00:00

Stop Date:

Map ID Direction Distance Distance (ft.) Elevation

Database(s)

EDR ID Number EPA ID Number

S102444880

1000124547

\$105003991

NA

WA

Cortese

LUST

CA WDS

DEL MONTE FOODS PARKING L (Continued)

Work Suspended :No

Responsible PartyDEL MONTE FOODS, USA

RP Address:

P.O. BOX 9004, WALNUT CREEK, CA 94598

Global Id: Org Name: T0601900610 Not reported

Contact Person: Not reported

MTBE Conc:

n

Mtbe Fuel: Water System Name:

DANISH CREAMERY ASSOCIATION

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: W0601900375 Waste Disch Assigned Name: 1000375-001GEN

Not reported Summary:

LUST Region 5:

Substance:

BUNKER FUEL OIL

Case Type:

Program:

Soil only

Staff Initials:

LUST DAM

Status:

Case Closed

MTBE Code:

Regional Lead Agency:

CORTESE:

Region:

CORTESE

Fac Address 2:

Not reported

061

WSW

DEL MONTE 1625 TULARE

1/4-1/2

1526 ft.

FRESNO, CA 93706 Site 2 of 3 in cluster O

Relative: Lower

CORTESE:

Region:

Fac Address 2:

CORTESE 1625 TULARE

Actual: 289 ft.

062

YORKSHIRE DRIED FRUIT&NUTS INC

1625 TULARE ST FRESNO, CA 93706

WSW 1/4-1/2 1526 ft.

Relative: Lower

289 ft.

State LUST:

Cross Street:

Site 3 of 3 in cluster O

"G" ST

Actual: Qty Leaked:

Case Number

Not reported 5T10000177

Reg Board:

5F

Chemical:

#6 Fuel Oil

Lead Agency: Local Agency: Regional Board 10000

Case Type:

Drinking Water Aquifer affected

Status:

Case Closed

Review Date:

Not reported

Workplan:

1989-07-17 00:00:00

Pollution Char:

Remed Action:

1989-09-15 00:00:00 Not reported

Monitoring:

Not reported

Not reported 1989-07-17 00:00:00

Confirm Leak: Remed Plan:

1989-09-15 00:00:00

Prelim Assess:

5T10000630

Case Number:

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S105003991

YORKSHIRE DRIED FRUIT&NUTS INC (Continued)

Close Date: Release Date: 1996-10-21 00:00:00 1989-07-11 00:00:00

Cleanup Fund Id: Not reported

Discover Date: 1989-07-05 00:00:00 Enforcement Dt: 1989-07-13 00:00:00

Enf Type:

None Taken

Enter Date:

1989-07-15 00:00:00

Funding: Staff Initials:

State Funds PEG

How Discovered: Tank Closure

How Stopped: Interim:

Not reported

Leak Cause:

No UNK

Leak Source:

Tank

MTBE Date:

Not reported Max MTBE GW: Not reported

MTBE Tested:

Not Required to be Tested.

Priority:

Local Case #:

FA0266637

Beneficial:

Not reported

Staff:

DAM

GW Qualifier: Not reported Max MTBE Soil: Not reported

Soil Qualifier: Hydr Basin #:

Not reported SAN JOAQUIN (5-22)

Operator:

Not reported

Oversight Prgm:

LUST

Review Date:

1996-10-21 00:00:00 1989-06-13 00:00:00

Stop Date:

Work Suspended :No Responsible PartyDEL MONTE USA

RP Address:

1625 TULARE, FRESNO CA. 93706

Global Id:

T0601900175 Not reported

Org Name: Contact Person:

Not reported

MTBE Conc:

0 0

Mtbe Fuel: Water System Name:

DANISH CREAMERY ASSOCIATION

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: W0601900375 Waste Disch Assigned Name: 1000375-001GEN

Summary:

Not reported

LUST Region 5:

Substance:

#6 FUEL OIL

Case Type:

Drinking Water Aquifer affected

Program: Staff Initials:

LUST DAM

Status:

Case Closed

MTBE Code:

Lead Agency:

N/A Regional

WDS:

Facility ID:

5F 10I004511

Facility Contact SIC Code:

TIM PARKER

SIC Code 2:

Facility Telephone (559) 495-4281

5T10000177

Not reported Agency Name: YORKSHIRE DRIED FRUIT & NUTS

Case Number:

Map ID Direction Distance Distance (ft.) Elevation

Database(s)

EDR ID Number EPA ID Number

S105003991

YORKSHIRE DRIED FRUIT&NUTS INC (Continued)

Agency Address: 7255 N 1st St Ste 112

Fresno 93720 - 2972

Agency Contact: Design Flow: Facility Type:

LARRY ELLIS

Not reported

(559) 495-4250 Agency Phone:

Baseline Flow: Not reported

Industrial - Facility that treats and/or disposes of liquid or semisolid wastes from any servicing, producing, manufacturing or processing operation of whatever nature, including

mining, gravel washing, geothermal operations, air conditioning, ship building and repairing, oil production, storage and disposal operations, water pumping.

Active - Any facility with a continuous or seasonal discharge that is under Waste Facility Status: Discharge Requirements.

Private

Agency Type:

Waste Type: Not reported Threat to Water:

Minor Threat to Water Quality. A violation of a regional board order should cause a relatively minor impairment of beneficial uses compared to a major or minor threat. Not: All nurds without a TTWQ will be considered a minor threat to water quality unless coded at a higher Level. A Zero (0) may be used to code those NURDS that are found to represent

no threat to water quality.

Complexity:

Category C - Facilities having no waste treatment systems, such as cooling water dischargers or thosewho must comply through best management practices, facilities with passive waste treatment and disposal systems, such as septic systems with subsurface disposal, or dischargers having waste storage systems with land disposal such as dairy

Confirm Leak:

Prelim Assess:

Remed Plan:

Not reported

Not reported

Not reported

waste ponds.

Reclamation:

Not reported Not reported

POTW: NPDES Number:

CAS000001 The 1st 2 characters designate the state. The remaining 7 are assigned by the

Regional Board

Subregion:

P63

SSE 1/4-1/2 1573 ft. **ACE TIRE 565 BROADWAY** FRESNO, CA 93723 HAZNET S105109515 LUST N/A

Site 1 of 2 in cluster P

Relative: Equal

Actual: 292 ft.

State LUST:

VENTURA Cross Street: Not reported Qty Leaked:

5T10000031 Case Number 5F

Reg Board:

Chemical: Gasoline Lead Agency: Regional Board

10000 Local Agency:

Case Type:

Drinking Water Aquifer affected

Status: Review Date:

Case Closed Not reported

Workplan:

Not reported Not reported

Pollution Char: Remed Action:

1994-06-01 00:00:00 1996-10-01 00:00:00

Monitoring: Close Date: Release Date:

2004-03-04 00:00:00 1986-04-09 00:00:00

Cleanup Fund Id: Not reported Discover Date :

1986-04-09 00:00:00 Enforcement Dt: 1988-09-27 00:00:00

Enf Type:

CLOS

Enter Date:

1987-09-21 00:00:00

Funding:

Not reported

Staff Initials: LAN

How Discovered: Tank Closure

MAP FINDINGS

MTBE Detected. Site tested for MTBE & MTBE detected

Case Number:

5T10000031

Database(s)

EDR ID Number EPA ID Number

S105109515

ACE TIRE (Continued)

How Stopped:

Interim:

Leak Cause:

Not reported

Not reported

Not reported

FA0169025

Not reported

Not reported

T0601900030

SAN JOAQUIN (5-22)

2002-07-15 00:00:00

1965-01-01 00:00:00

DAM

1999-06-23 00:00:00

No

UNK

Leak Source:

MTBE Date:

Max MTBE GW: 18 Parts per Billion

MTBE Tested: Priority:

Local Case #: Beneficial:

Staff: GW Qualifier:

Max MTBE Soil: Not reported Soil Qualifier:

Hydr Basin #: Operator:

Not reported Oversight Prgm: LUST

Review Date:

Stop Date:

Work Suspended :No Responsible PartyTIMOTHY JONES PO BOX 11488

RP Address: Global Id: Org Name:

Not reported Contact Person: Not reported MTBE Conc:

Mtbe Fuel:

Water System Name:

Not reported Well Name: Not reported Distance To Lust: 0

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

Summary: Not reported

LUST Region 5:

Substance:

GASOLINE **Drinking Water Aquifer affected**

Case Type: Program:

LUST DAM

Staff Initials: Status: Case Closed

MTBE Code:

Lead Agency: Regional

HAZNET:

Gepaid: TSD EPA ID: Gen County:

CAC002551510 Not reported Fresno Los Angeles 0.68

Tsd County: Tons:

Facility Address 2: Not reported

Waste Category: Disposal Method: Oil/water separation sludge Recycler

Contact: Telephone:

Mailing Name:

susan pujin 000000000 Not reported Mailing Address: 565 broadway

County

FRESNO, CA 93723 Not reported

Map ID Direction Distance Distance (ft.) Elevation

EDR ID Number **EPA ID Number** Database(s)

WA

S104161613

P64 SSE ACE S/S

565 BROADWAY FRESNO, CA 93721

1/4-1/2 1573 ft.

Site 2 of 2 in cluster P

Relative: Equal

CORTESE:

Region:

CORTESE

Actual: 292 ft.

Fac Address 2:

565 BROADWAY

65 ESE

HARON MOTOR SALES 2222 VENTURA

FRESNO, CA 93721

1/4-1/2 1612 ft.

Relative: Equal

State LUST:

Cross Street: Qty Leaked: Case Number

Not reported 5T10000335

Actual: 292 ft.

Reg Board: 5F Gasoline

L ST

Chemical: Local Agency Lead Agency: Local Agency: 10000 Soil only Case Type:

Case Closed Status: Not reported Review Date: Not reported Workplan: Not reported Pollution Char:

Not reported Remed Action: Not reported Monitoring: Close Date:

2003-11-14 00:00:00 1991-10-24 00:00:00 Release Date: Cleanup Fund ld: Not reported 1991-09-24 00:00:00 Discover Date :

Enforcement Dt: 1965-01-01 00:00:00 CLOS Enf Type:

Enter Date:

1991-11-15 00:00:00 Responsible Party Funding:

LUI Staff Initials:

How Discovered: Tank Closure Not reported How Stopped: Not reported Interim: Leak Cause: UNK UNK Leak Source: Not reported

MTBE Date: Not reported Max MTBE GW:

Site NOT Tested for MTBE.Includes Unknown and Not Analyzed. MTBE Tested:

Not reported Priority:

FA0170368 Local Case #: Not reported Beneficial: Staff: DAM Not reported GW Qualifier:

Max MTBE Soil: Not reported Not reported Soil Qualifier: SAN JOAQUIN (5-22) Hydr Basin #:

HARON MOTOR SALES Operator: Oversight Prgm: LUST

1991-11-15 00:00:00 Review Date: 1991-08-29 00:00:00 Stop Date:

Work Suspended :No

Responsible PartyHARON MOTOR SALES

Cortese

Not reported

Not reported

Not reported

Confirm Leak:

Prelim Assess:

Remed Plan:

S106175487 LUST

Fresno Co. CUPA N/A

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S106175487

HARON MOTOR SALES (Continued)

RP Address:

2222 VENTURA BLVD, FRESNO, CA 93721

Global Id: Org Name:

T0601900328 Not reported Contact Person: Not reported

MTBE Conc:

Mtbe Fuel: Water System Name:

ARBOR MOBILE HOME PARK

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: W0603900831

Waste Disch Assigned Name: 2000831-001GEN

Summary:

AN ASSESSMENT TO DETERMINE THE IMPACT IS CURRENTLY IN

Confirm Leak:

Prelim Assess:

Remed Plan:

PROGRESS

CUPA:

Facility ID:

FA0170368

Region: **CUPA**

Program Element: AUTO REPAIR/MAINTENANCE MODEL PLAN

Owner Name:

HARON MOTOR SALES INC

APM Number:

468-225-20

Facility ID:

FA0170368

Region:

CUPA Program Element: UST REMOVAL/CLOSURE W/1 TANK

Owner Name:

HARON MOTOR SALES INC

APM Number:

468-225-20

Facility ID:

FA0170368

Region:

CUPA

Program Element: SMALL QUANTITY GENERATOR Owner Name:

HARON MOTOR SALES INC

APM Number:

468-225-20

Facility ID:

FA0170368

Region:

CUPA

Program Element: FORMER CONTAMINATED SITE/CLEANUP COMPLETE Owner Name:

APM Number:

HARON MOTOR SALES INC 468-225-20

66

North 1/4-1/2 1666 ft. FRESNO CITY POLICE DEPT.

2323 MARIPOSA **FRESNO, CA 93721**

LUST S102430469 Cortese N/A

Relative: Higher

State LUST:

Cross Street:

FRESNO

Qty Leaked: Actual: Case Number Not reported 5T10000595

294 ft.

Reg Board:

5F

Chemical:

Diesel

Lead Agency:

Regional Board

Local Agency :

Case Type:

10000

Status:

Soil only

Leak being confirmed

Review Date:

1995-12-11 00:00:00

Workplan:

Pollution Char:

Not reported

Remed Action:

Not reported Not reported

Monitoring:

Not reported

1995-12-11 00:00:00

Not reported

Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S102430469

FRESNO CITY POLICE DEPT. (Continued)

Close Date:

Not reported

Release Date:

1995-12-11 00:00:00

Cleanup Fund Id: Not reported

Discover Date: 1995-12-04 00:00:00

Enforcement Dt: 1965-01-01 00:00:00

Enf Type:

OEFA

Enter Date: Funding:

1995-12-22 00:00:00

Responsible Party LUI

Staff Initials:

How Discovered: OM

How Stopped: Not reported

Interim:

Not reported

Leak Cause:

UNK

Leak Source:

UNK

MTBE Date:

Not reported

Max MTBE GW:

Not reported Not Required to be Tested.

MTBE Tested: Priority:

Not reported

Local Case #:

FA0267545

Beneficial:

Not reported

DAM

Staff: GW Qualifier:

Not reported

Max MTBE Soil: Not reported

Not reported

Soil Qualifier: Hydr Basin #:

SAN JOAQUIN (5-22)

Operator:

CITY OF FRESNO

Oversight Prgm: LUST

Review Date:

1995-12-22 00:00:00

Stop Date:

1965-01-01 00:00:00

Work Suspended :No

Responsible PartyCITY OF FRESNO

RP Address:

2101 E ST., FRESNO, CA

Global Id:

T0601900576

Org Name:

Not reported

Contact Person:

Not reported

MTBE Conc:

0

Mtbe Fuel:

Water System Name:

Not reported

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

Summary:

Not reported

LUST Region 5:

Substance:

DIESEL

Case Type:

Soil only

Program:

LUST

Staff Initials:

DAM

Status:

MTBE Code:

Leak being confirmed

Lead Agency:

N/A Regional

CORTESE:

Region:

CORTESE

Fac Address 2:

2323 MARIPOSA

5T10000595

Case Number:

Map ID Direction Distance Distance (ft.) MAP FINDINGS

Confirm Leak:

Prelim Assess:

Remed Plan:

Database(s)

1990-08-29 00:00:00

Not reported

Not reported

LUST

EDR ID Number EPA ID Number

S106229756

N/A

67 North

Elevation

FRESNO COUNTY JAIL

1155 M ST

1/4-1/2

FRESNO, CA 93721

1842 ft. Relative:

State LUST:

Higher

FRESNO ST Cross Street: Qty Leaked: Not reported Case Number 5T10000263

Actual: 293 ft.

Reg Board: Chemical:

5F Gasoline Lead Agency: Local Agency Local Agency: 10000

Case Type: Status:

Undefined Leak being confirmed

Review Date: Workplan:

1990-08-29 00:00:00 Not reported

Pollution Char: Not reported

Remed Action: Not reported Monitoring: Not reported Close Date: Not reported Release Date: 1990-10-19 00:00:00 Cleanup Fund Id: Not reported

Discover Date: 1990-08-29 00:00:00 Enforcement Dt: 1965-01-01 00:00:00 Enf Type: Not reported

Enter Date: Funding:

1990-11-07 00:00:00 Responsible Party

Staff Initials: JRA How Discovered: Tank Closure How Stopped: Not reported Interim: Not reported Leak Cause: UNK

Leak Source: UNK MTBE Date: Not reported Max MTBE GW: Not reported

MTBE Tested: Site NOT Tested for MTBE.Includes Unknown and Not Analyzed. Priority: Medium priority

Local Case #: FA0269874 Beneficial: Not reported

Staff: DAM GW Qualifier: Not reported Max MTBE Soil: Not reported Soil Qualifier: Not reported

Hydr Basin #: Operator:

SAN JOAQUIN (5-22) LEROY MAYFIELD

Oversight Prgm: LUST

Review Date: 1990-11-07 00:00:00 Stop Date: 1990-06-15 00:00:00

Work Suspended :No

Responsible PartyFRESNO COUNTY FLEET SERVICE RP Address: 4551 E. HAMILTON, FRESNO, CA 93702

Global Id: Org Name:

T0601900260 Not reported Not reported

Contact Person: MTBE Conc:

Well Name:

0

Mtbe Fuel: Water System Name:

Not reported Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S106229756

FRESNO COUNTY JAIL (Continued)

Distance To Lust:

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

AS ASSESSMENT TO DETERMINE THE EXTENT OF THE IMPACT IS

CURRENTLY IN PROGRESS.

68 SSW ABANDONED S/S

LUST Cortese

S104869033 NA

Fresno Co. CUPA

1/4-1/2 1844 ft. 655 G ST

FRESNO, CA 93721

Relative: Higher

Actual:

293 ft.

State LUST:

Cross Street:

VENTURA

Qty Leaked:

Not reported

Case Number

5T10000124

Reg Board:

5F

Chemical:

Gasoline

Lead Agency:

Regional Board

Local Agency:

10000

Case Type:

Drinking Water Aquifer affected

Status:

Preliminary site assessment underway

Review Date:

Not reported

Confirm Leak:

Not reported

Workplan:

2005-11-18 00:00:00

Prelim Assess: Remed Plan:

2005-11-18 00:00:00 Not reported

Pollution Char:

Not reported Not reported

Remed Action: Monitoring:

Not reported

Close Date:

Not reported

Release Date:

1988-10-10 00:00:00

Cleanup Fund Id: Not reported

Discover Date:

1988-09-06 00:00:00 Enforcement Dt: 1965-01-01 00:00:00

Enf Type:

SEL

Enter Date:

1988-10-02 00:00:00

Fundina:

State Funds

Staff Initials:

OSC

How Stopped:

How Discovered: Tank Closure

Interim:

Not reported

Leak Cause:

No Corrosion

Leak Source:

Tank

MTBE Date:

Not reported

Max MTBE GW: Not reported

MTBE Tested:

MTBE Detected. Site tested for MTBE & MTBE detected

Priority: Local Case #: Not reported FA0269407

Beneficial:

Not reported

Staff:

DAM

GW Qualifier:

Not reported

Max MTBE Soil: Soil Qualifier:

0.01 Parts per Million

Hydr Basin #:

SAN JOAQUIN (5-22)

Operator: Oversight Prgm:

Not reported

Review Date:

LUST

1988-10-10 00:00:00 1988-09-06 00:00:00

Stop Date: Work Suspended :No

Responsible PartyCITY OF FRESNO

RP Address:

1919 E MCKINLEY, FRESNO, CA 93708

Global Id:

T0601900122

MAP FINDINGS

Case Number:

Confirm Leak:

Prelim Assess:

Remed Plan:

5T10000124

Database(s)

EDR ID Number EPA ID Number

S104869033

ABANDONED S/S (Continued)

Org Name: Contact Person:

Not reported Not reported

MTBE Conc:

Mtbe Fuel:

Water System Name: Well Name:

Not reported Not reported

Distance To Lust:

Waste Discharge Global ID: Not reported

Waste Disch Assigned Name: Not reported Summary:

Not reported

LUST Region 5:

Substance: GASOLINE

Case Type:

Drinking Water Aquifer affected

Program: Staff Initials:

DAM

LUST

Preliminary site assessment underway

Status: MTBE Code: Lead Agency:

N/A Regional

CORTESE:

Region:

CORTESE

Fac Address 2: 655 G ST

CUPA:

Facility ID:

FA0269407

Region:

CUPA

Program Element: CONTAMINATED UST SITE/RWQCB LEAD AGENCY

Owner Name: APM Number: FRESNO, CITY OF

467-081-16T

Facility ID: Region:

FA0269407 CUPA

Program Element: UST REMOVAL/CLOSURE W/3 TANKS

Owner Name:

FRESNO, CITY OF 467-081-16T

APM Number:

Q69

West

JENSEN & PILEGARD 1111 G ST

FRESNO, CA 93706

1/4-1/2

1858 ft.

Site 1 of 4 in cluster Q

LUST Cortese

Fresno Co. CUPA

1990-10-10 00:00:00

Not reported

Not reported

SWEEPS UST

1002847851 WA

Relative: Lower

State LUST:

Actual: 288 ft.

Cross Street: Qty Leaked:

Not reported Not reported 5T10000069

Case Number Reg Board:

5F

Chemical:

Diesel

Lead Agency:

Local Agency

Local Agency:

10000

Case Type:

Soil only

Status:

Case Closed

Review Date:

1990-10-10 00:00:00

Workplan:

Not reported

Pollution Char:

Not reported

Remed Action:

Not reported

Monitoring:

Not reported

Close Date:

2005-05-18 00:00:00

Release Date:

1990-10-11 00:00:00

TC1706388.1s Page 58

Map ID Direction Distance Distance (ft.) Elevation

Database(s)

EDR ID Number **EPA ID Number**

1002847851

JENSEN & PILEGARD (Continued)

Cleanup Fund Id: Not reported

Discover Date: 1990-10-10 00:00:00 Enforcement Dt: 1965-01-01 00:00:00

Enf Type:

CLOS

Enter Date: Funding:

1990-11-07 00:00:00 Responsible Party

PHI Staff Initials:

How Discovered: Tank Closure Not reported How Stopped: Not reported Interim: Leak Cause: UNK UNK Leak Source: MTBE Date: Not reported

Max MTBE GW: Not reported

Not Required to be Tested. MTBE Tested:

Priority: Local Case #:

Not reported FA0169671

Beneficial: Staff:

Not reported DAM

GW Qualifier: Not reported Max MTBE Soil: Not reported Not reported Soil Qualifier: SAN JOAQUIN (5-22) Hydr Basin #:

Not reported Operator:

Oversight Prgm: LUST

1990-11-07 00:00:00 Review Date: 1990-09-18 00:00:00 Stop Date:

Work Suspended :No

Responsible PartyJENSEN AND PILEGARD

RP Address:

1068 "G" STREET, FRESNO, CA 93706

Global Id: Org Name:

T0601900068 Not reported Not reported Contact Person:

MTBE Conc: Mtbe Fuel:

Water System Name:

Well Name:

Not reported Not reported

Distance To Lust:

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

Summary:

AN ASSESSMENT TO DETERMINE THE EXTENT OF IMPACT IS CURRENTLYIN

Case Number:

5T10000069

PROGRESS.

LUST Region 5:

Substance: Case Type: DIESEL Soil only

Program:

LUST

Staff Initials:

DAM

Status:

Case Closed

MTBE Code: Lead Agency: N/A Local

CORTESE:

Region: Fac Address 2: CORTESE 1111 G ST

CUPA:

Facility ID:

FA0169671

Region:

CUPA

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number**

JENSEN & PILEGARD (Continued)

1002847851

Program Element: FORMER CONTAMINATED SITE/CLEANUP COMPLETE

Owner Name:

JENSEN & PILEGARD

APM Number:

467-062-06

Facility ID:

FA0169671

Region:

CUPA

Program Element: UST REMOVAL/CLOSURE W/2 TANKS

Owner Name:

JENSEN & PILEGARD

APM Number:

467-062-06

SWEEPS:

Not reported

Status: Comp Number:

51569

Number: Board Of Equalization:

Not reported 44-004407

Ref Date: Act Date:

Not reported Not reported

Created Date:

Not reported Not reported

Tank Status: Owner Tank Id:

Not reported 10-000-051569-000001

Swrcb Tank Id: Actv Date:

Not reported

Capacity:

8000

Tank Use:

M.V. FUEL **PRODUCT**

Stg: Content:

DIESEL

Number Of Tanks:

Q70 West

PG&E GAS PLANT FRESNO 325 3A F/MARIPOSA BET F G FRESNO TULA FRESNO, CA 93706

CERCLIS FINDS

1000196845 CAD981415912

1/4-1/2 1865 ft.

Site 2 of 4 in cluster Q

Relative: Lower

CERCLIS Classification Data:

Actual:

Federal Facility: Not a Federal Facility Non NPL Status: Other Cleanup Activity: State-Lead Cleanup

288 ft.

Not on the NPL

NPL Status: Contact:

Contact Title:

Betsy Curnow

Not reported

Contact:

Jere Johnson

Contact Title:

Not reported

CERCLIS Assessment History:

Assessment:

DISCOVERY

PRELIMINARY ASSESSMENT

Completed:

07/01/1986

(415) 972-3093

(415) 972-3094

Assessment: Assessment: SITE INSPECTION

Completed: Completed:

Contact Tel:

Contact Tel:

12/01/1987 09/08/1989

CERCLIS Site Status:

Low

FINDS:

Other Pertinent Environmental Activity Identified at Site:

CERCLIS (Comprehensive Environmental Response, Compensation, and Liability Information System) is the Superfund database that is used to support management in all phases of the Superfund program. The system contains information on all aspects of hazardous waste sites, including an inventory of sites, planned and actual site activities, and financial information.

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

Q71 West **PG&E G STREET SUBSTATION**

Cortese

S104869002

1/4-1/2

1131 G

FRESNO, CA 93706

Fresno Co. CUPA

WA

1917 ft.

Site 3 of 4 in cluster Q

Relative: Lower

CORTESE:

Region:

CORTESE

Actual:

Fac Address 2:

Not reported

288 ft.

CUPA:

Facility ID:

FA0273183

Region:

CUPA

Owner Name:

Program Element: CONTAMINATED SITE - MISC/DTSC LEAD PACIFIC GAS & ELECTRIC COMPANY

APM Number:

Not reported

Q72 West **PG&E G STREET SUBSTATION**

Cal-Sites

Not reported

S101480254 SLIC WA

1/4-1/2

1131 G STREET

FRESNO, CA 93706

1917 ft.

Site 4 of 4 in cluster Q

Relative: Lower

CAL-SITES:

Facility ID Status:

10490101

Actual: 288 ft.

BKLG - BACKLOG, POTENTIAL ANNUAL WORKPLAN (AWP) SITE

01/30/1992 Status Date: Not reported

Lead:

1 - SACRAMENTO

Region: Branch:

CC - CENTRAL CALIFORNIA

File Name:

Not reported

Status Name: Lead Agency: **BACKLOG - POTENTIAL AWP SITE**

NPL:

Not reported

SIC:

49 ELECTRIC, GAS & SANITARY SERVICES

Facility Type:

RP

RESPONSIBLE PARTY Type Name:

Staff Member Responsible for Site:

Not reported

Supervisor Responsible for Site:

Not reported

Region Water Control Board:

CV - CENTRAL VALLEY

Access:

Not reported

Cortese:

Not reported

Hazardous Ranking Score:

Not reported

Date Site Hazard Ranked:

Not reported

Groundwater Contamination:

Not reported

No. of Contamination Sources:

Not reported

Lat/Long: Lat/long Method:

Not reported

State Assembly District Code:

31

State Senate District:

16

Click this hyperlink while viewing on your computer to access additional CAL-SITES detail in the EDR Site Report.

CA STATE SLIC:

Global Id:

SLT5FT504525

Region:

STATE

Assigned Name: Lead Agency Contact: SLICSITE Not reported

Lead Agency:

DEPARTMENT OF TOXIC SUBSTANCES CONTROL

Lead Agency Case Number:

SLT5FT050

Responsible Party:

ROBERT DOSS

MAP FINDINGS

Confirm Leak:

Prelim Assess:

Remed Plan:

Database(s)

LUST

SWEEPS UST

Not reported

Not reported

Not reported

EDR ID Number EPA ID Number

S101480254

S106175227

WA

PG&E G STREET SUBSTATION (Continued)

Recent Dtw:

Not reported Case Open

Facility Status: Substance Released:

MET, PET

73 SW **FELIX AUTO MECHANIC**

804 F ST

1/4-1/2 1920 ft.

FRESNO, CA 93706

Relative: Equal

State LUST:

Cross Street: Qty Leaked:

KERN Not reported 5T10000248

Actual: Case Number 292 ft. Reg Board:

5F Chemical: Waste Oil Local Agency Lead Agency:

Local Agency: Case Type:

10000

Status: Review Date:

Soil only Case Closed Not reported

Workplan: Pollution Char:

Not reported Not reported Not reported

Remed Action: Monitoring: Close Date:

Not reported 2001-03-22 00:00:00 Release Date: 1990-08-27 00:00:00

Cleanup Fund Id: Not reported

Discover Date: 1990-07-24 00:00:00 Enforcement Dt: 1965-01-01 00:00:00

Enf Type:

Not reported

Enter Date:

1990-08-30 00:00:00 Not reported

Funding: Staff Initials:

JRA

How Discovered: Tank Closure How Stopped: Interim:

Leak Cause:

Not reported Not reported Corrosion UNK

Leak Source: MTBE Date: Max MTBE GW:

Not reported Not reported

MTBE Tested:

Not Required to be Tested.

Priority: Local Case #: Not reported FA0269415 Not reported

Beneficial: Staff: GW Qualifier:

DAM Not reported Not reported

Max MTBE Soil: Soil Qualifier:

Not reported SAN JOAQUIN (5-22)

Hydr Basin #: Operator:

JIM DIAZ

Oversight Prgm: LUST Review Date:

1990-08-30 00:00:00 Stop Date: 1990-06-28 00:00:00

Work Suspended :No

Responsible PartyCHLOE D. PARENTI

RP Address:

3474 W. JENSEN, FRESNO, CA 93706

Global Id:

T0601900246 Not reported

Org Name: Contact Person: Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

5T10000248

Case Number:

EDR ID Number EPA ID Number

S106175227

FELIX AUTO MECHANIC (Continued)

MTBE Conc:

0

Mtbe Fuel:

Water System Name:

DANISH CREAMERY ASSOCIATION

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: W0601900375 Waste Disch Assigned Name: 1000375-001GEN

Summary:

AN ASSESSMENT TO DETERMINE THE EXTENT OF IMPACT IS

CURRENTLY IN PROGRESS.

LUST Region 5:

Substance:

WASTE OIL

Case Type:

Soil only

Program:

LUST DAM

Staff Initials:

Status:

MTBE Code:

Case Closed N/A

Lead Agency: Local

SWEEPS:

Status:

Not reported

Comp Number:

40492

Number:

Not reported

Board Of Equalization: 44-004162

Ref Date: Act Date:

Not reported Not reported

Created Date:

Not reported

Tank Status:

Not reported

Owner Tank ld:

Not reported

Swrcb Tank Id:

10-000-040492-000001

Actv Date: Capacity:

Not reported

Tank Use:

4000 M.V. FUEL

Stg:

PRODUCT

Content:

LEADED

Number Of Tanks:

Status: Comp Number: Not reported

40492

Number:

Not reported

Board Of Equalization:

44-004162

Ref Date: Act Date:

Not reported Not reported

Created Date:

Not reported

Tank Status:

Not reported

Owner Tank Id: Swrcb Tank Id:

Not reported 10-000-040492-000002

Actv Date:

Not reported

Capacity:

4000

Tank Use:

M.V. FUEL

Stg:

PRODUCT **REG UNLEADED**

Content:

Not reported

Status:

Not reported

Comp Number:

Number Of Tanks:

40492

Number: Board Of Equalization: 44-004162

Not reported

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S106175227

FELIX AUTO MECHANIC (Continued)

Ref Date: Act Date :

Not reported Not reported

Created Date:

Not reported

Tank Status:

Not reported Not reported

Owner Tank Id: Swrcb Tank Id:

10-000-040492-000004

Actv Date:

Not reported

Capacity: Tank Use: 500 OIL

Stg: Content:

WASTE WASTE OIL

Number Of Tanks:

Not reported

Status:

Comp Number:

40492

Number:

A 2

Ref Date:

Board Of Equalization: 44-004162

Act Date:

10-24-90 10-24-90

Created Date:

02-29-88

Tank Status: Owner Tank Id:

Not reported

Swrcb Tank Id:

10-000-040492-000003

Actv Date:

10-24-90

Capacity: Tank Use: 4000

Sta:

M.V. FUEL

DIESEL

Content:

Number Of Tanks:

74 West 1/4-1/2

PGANDE MANUFACTURED GAS PLANT SQ-FR-FRS-2 **BLOCK OF F,G, FRESNO AND TULARE STREETS**

FRESNO, CA 93700

Manufactured Gas Plants

1008407681

WA

Relative: Lower

1963 ft.

Actual: 288 ft.

75

TRINI'S BEACON

South 603 G ST 1/4-1/2

FRESNO, CA 93706

LUST U003971430 UST N/A

2002 ft. Relative:

State LUST:

Cross Street:

VENTURA

Higher

Qty Leaked:

Not reported

Actual: Case Number 293 ft.

5T10000690

Reg Board: Chemical:

5F Gasoline

Lead Agency:

Local Agency

Local Agency:

10000

Case Type:

Undefined

Status:

Leak being confirmed

Abate Method:

Excavate and Dispose - remove contaminated soil and dispose in approved

site

Review Date:

1998-11-04 00:00:00

Confirm Leak:

1998-11-04 00:00:00

Map ID Direction Distance Distance (ft.)

Site

Elevation

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

U003971430

TRINI'S BEACON (Continued)

Prelim Assess: Remed Plan: Not reported Not reported

Workplan: Not reported Pollution Char: Not reported Not reported Not reported

Remed Action: Not reported
Monitoring: Not reported
Close Date: Not reported
Not reported
1998-11-30 00:00:00

Cleanup Fund ld : Not reported

Discover Date: 1998-11-04 00:00:00
Enforcement Dt: 1965-01-01 00:00:00
Enf Type: Not reported

Enter Date: 1999-05-13 00:00:00
Funding: Responsible Party

Staff Initials: DAV

How Discovered: Tank Closure
How Stopped: Not reported
Interim: Not reported
Leak Cause: Not reported
Leak Source: UNK
MTBE Date: Not reported

Max MTBE GW: Not reported

MTBE Tested: Site NOT Tested for MTBE.Includes Unknown and Not Analyzed.

Priority: Medium priority
Local Case #: FA0003738
Beneficial: Not reported
Staff: DAM
GW Qualifier: Not reported
Max MTBE Soil: Not reported

Soil Qualifier: Not reported
Hydr Basin #: SAN JOAQUIN (5-22)
Operator: TRINIDAD TORRES

Oversight Prgm: LUST

Review Date: 1999-05-13 00:00:00 Stop Date: 1998-11-04 00:00:00

Work Suspended :No

Responsible PartyTRINIDAD TORRES

RP Address: 603 G ST FRESNO CA 93706 Global Id: T0601900669

Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0

Mtbe Fuel: 1

Water System Name: DANISH CREAMERY ASSOCIATION
Well Name: Not reported

Distance To Lust:

Waste Discharge Global ID: W0601900375 Waste Disch Assigned Name: 1000375-001GEN

Summary: Not reported

LUST Region 5:

Substance: GASOLINE
Case Type: Undefined

Program: LUST Staff Initials: DAM

Status: Leak being confirmed

MTBE Code: N/A Lead Agency: Local

State UST:

5T10000690

Case Number:

MAP FINDINGS

Database(s)

FINDS

HAZNET

RCRA-LQG

RCRA-TSDF SLIC

CA FID UST

SWEEPS UST

HIST UST

EDR ID Number EPA ID Number

U003971430

1000136187

CAD047384185

TRINI'S BEACON (Continued)

Facility ID:

FA0003738 STATE

Region:

Local Agency: 10000

76 West

VOPAK USA INCORPORATED

1/4-1/2

1152 G STREET **FRESNO, CA 93706**

2045 ft.

Relative: Lower

Actual: 288 ft.

RCRAInfo:

Owner:

VAN WATERS & ROGERS, DIVISION OF UNIVAR

(209) 486-1221

EPA ID:

CAD047384185

Contact:

Not reported

Classification:

Large Quantity Generator, TSDF

TSDF Activities: Not reported

BIENNIAL REPORTS:

Last Biennial Reporting Year: 2003

<u>Waste</u>	Quantity (Lbs)	Waste	Quantity (Lbs)
D018	15208.00	D039	8158.00
D040	8158.00	U019	15208.00
U025	8158.00	U076	7050.00
U079	7050.00	U210	10050.00

Violation Status: Violations exist

Regulation Violated:

Not reported Area of Violation: TRANSPORTER-OTHER REQUIREMENTS

Date Violation Determined:

Actual Date Achieved Compliance:

01/11/1988 03/25/1988

Enforcement Action:

Enforcement Action Date:

WRITTEN INFORMAL

02/19/1988 Not reported

Penalty Type: Regulation Violated:

Area of Violation:

Not reported GENERATOR-OTHER REQUIREMENTS

Date Violation Determined:

Actual Date Achieved Compliance:

01/11/1988 03/25/1988

Enforcement Action:

Enforcement Action Date:

Penalty Type:

WRITTEN INFORMAL

02/19/1988 Not reported

Regulation Violated:

Area of Violation:

Date Violation Determined:

Actual Date Achieved Compliance:

Enforcement Action:

Penalty Type:

Not reported

GENERATOR-GENERAL REQUIREMENTS

07/14/1986 09/05/1986

Enforcement Action Date:

WRITTEN INFORMAL

07/22/1986 Not reported

Regulation Violated:

Area of Violation:

Not reported

Date Violation Determined: Actual Date Achieved Compliance: GENERATOR-GENERAL REQUIREMENTS

06/30/1986

09/05/1986

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

FDR ID Number **EPA ID Number**

1000136187

Date of

VOPAK USA INCORPORATED (Continued)

Enforcement Action:

WRITTEN INFORMAL

Enforcement Action Date:

07/22/1986

Penalty Type:

Not reported

Regulation Violated:

Not reported

Area of Violation:

GENERATOR-GENERAL REQUIREMENTS

Date Violation Determined: Actual Date Achieved Compliance: 12/11/1985 03/25/1988

Enforcement Action:

WRITTEN INFORMAL

Enforcement Action Date:

12/11/1985

Penalty Type:

Not reported

Regulation Violated:

Not reported

Area of Violation:

GENERATOR-GENERAL REQUIREMENTS

Date Violation Determined:

10/01/1984

Actual Date Achieved Compliance:

04/25/1988

Enforcement Action:

WRITTEN INFORMAL

Enforcement Action Date:

10/01/1984

Penalty Type:

Not reported

There are 6 violation record(s) reported at this site:

Evaluation	Area of Violation	Compliance
Compliance Evaluation Inspection	TRANSPORTER-OTHER REQUIREMENTS	19880325
Compliance Evaluation mapeolion	GENERATOR-OTHER REQUIREMENTS	19880325
Financial Record Review	GENERATOR-GENERAL REQUIREMENTS	19860905
Financial Record Review	GENERATOR-GENERAL REQUIREMENTS	19860905
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19880325
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19880425

FINDS:

Other Pertinent Environmental Activity Identified at Site: California - Hazardous Waste Tracking System - Datamart

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

HAZNET:

Gepaid:

CAD047384185

TSD EPA ID:

CAD008302903

Gen County:

Fresno

Tsd County:

Fresno

Tons:

2.67

Facility Address 2:

Not reported Aqueous solution with less than 10% total organic residues

Waste Category: Disposal Method:

Transfer Station

Contact:

M NASSRALLA/REGULATORY MANAGER

Telephone:

(323) 837-7142 UNIVAR USA INC

Mailing Name:

Mailing Address: PO BOX 512062

LOS ANGELES, CA 90051 - 0062

County

Fresno

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

1000136187

VOPAK USA INCORPORATED (Continued)

Gepaid:

CAD047384185

TSD EPA ID:

CAT000646117

Gen County: Tsd County:

Fresno

Fresno

Tons:

3.25

Facility Address 2:

Not reported

Waste Category:

Disposal Method:

Disposal, Land Fill

Contact: Telephone:

M NASSRALLA/REGULATORY MANAGER

Mailing Name:

(323) 837-7142 UNIVAR USA INC

Mailing Address: PO BOX 512062

LOS ANGELES, CA 90051 - 0062

County

Fresno

Gepaid:

CAD047384185

TSD EPA ID:

CAT000646117

Gen County:

Fresno Fresno

Tsd County: Tons:

1.5

Facility Address 2:

Not reported

Waste Category:

Other organic solids

Disposal Method:

Disposal, Other

Contact:

M NASSRALLA/REGULATORY MANAGER (323) 837-7142

Telephone: Mailing Name:

UNIVAR USA INC

Mailing Address: PO BOX 512062

LOS ANGELES, CA 90051 - 0062

County

Fresno

Gepaid:

CAD047384185

TSD EPA ID:

CAD008302903

Gen County: Tsd County:

Fresno

Fresno

Tons:

1.06

Facility Address 2:

Not reported

Waste Category:

Disposal Method:

Aqueous solution with less than 10% total organic residues Not reported

Contact:

Telephone:

M NASSRALLA/REGULATORY MANAGER (323) 837-7142

Mailing Name:

UNIVAR USA INC

Mailing Address: PO BOX 512062

County

LOS ANGELES, CA 90051 - 0062 Fresno

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

VOPAK USA INCORPORATED (Continued)

1000136187

FID:

Facility ID:

10002396 Inactive Underground Storage Tank Location

Regulate ID:

00013994

Reg By: Cortese Code:

Not reported

SIC Code:

Not reported

Status:

Inactive

Facility Tel:

(209) 486-1221

Not reported

Mail To:

1152 G ST

Contact:

Not reported Not reported

FRESNO, CA 93709

Contact Tel: NPDES No:

Not reported Not reported

DUNs No: Creation:

10/22/93

Modified:

00/00/00

EPA ID: Comments:

Not reported Not reported

CA STATE SLIC:

Global Id:

SL185704255

Region:

STATE

Assigned Name:

SLICSITE Not reported

Lead Agency Contact: Lead Agency:

Not reported

Lead Agency Case Number:

Not reported

Responsible Party:

MICHAEL GAUDETTE

Recent Dtw: **Facility Status:**

Remediation Plan

Substance Released:

PCE

UST HIST:

13994

Owner Name:

UNIVAR CORPORATION

Facility ID:

Total Tanks:

Region:

STATE

Owner Address:

1600 NORTON BUILDING

SEATTLE, WA 98104

PRODUCT Tank Used for:

Tank Num:

00001000

Container Num: Year Installed:

Tank Capacity: Type of Fuel:

DIESEL

Tank Construction: Not Reported

Not reported

Leak Detection:

Contact Name:

Stock Inventor MIKE CROSS

Telephone: Other Type: (209) 486-1221 CHEMICAL DISTRIBUTOR

SWEEPS:

Facility Type:

Status:

Other

Not reported 13994

Comp Number: Number:

Not reported Not reported

Board Of Equalization: Ref Date: Act Date:

Not reported Not reported Not reported

Created Date: Tank Status:

Not reported

Owner Tank ld: Swrcb Tank Id: Not reported 10-000-013994-000001

Actv Date: Capacity:

Not reported 1000

Tank Use: Stg:

M.V. FUEL **PRODUCT**

Content: Number Of Tanks: DIESEL

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S104869180

N/A

77 SSE S & J MINI MART

476 H ST 1/4-1/2 **FRESNO, CA 93721**

LUST Cortese Fresno Co. CUPA

2105 ft.

Relative: Higher

Actual:

293 ft.

State LUST:

Cross Street: Qty Leaked:

BELMONT Not reported

Case Number Reg Board:

5T10000489 5F Gasoline

Chemical: Lead Agency:

Regional Board 10000

Local Agency: Case Type:

Drinking Water Aquifer affected

Status:

Case Closed

Abate Method:

Review Date:

No Action Required - incident is minor, requiring no remedial action Not reported

Confirm Leak:

Not reported

Workplan:

1994-04-13 00:00:00

Prelim Assess: Remed Plan:

1994-04-13 00:00:00 Not reported

Pollution Char: Remed Action:

Not reported

Not reported

Monitoring: Not reported

Close Date: Release Date: 1999-01-01 00:00:00 1994-04-13 00:00:00

Cleanup Fund Id: Not reported Discover Date: 1994-03-23 00:00:00

Enforcement Dt: 1965-01-01 00:00:00

Enf Type: Enter Date : None Taken

Funding:

1994-04-29 00:00:00 Responsible Party

Staff Initials: How Discovered: OM

LUI

How Stopped: Interim:

Not reported Not reported UNK

Leak Cause: Leak Source:

UNK 1996-05-06 00:00:00

MTBE Date: Max MTBE GW:

5 Parts per Billion

MTBE Tested:

MTBE Detected. Site tested for MTBE & MTBE detected

Priority: Local Case #:

Not reported

Beneficial:

Not reported

Staff: GW Qualifier: DAM

Max MTBE Soil: Soil Qualifier:

Not reported Not reported SAN JOAQUIN (5-22)

Hydr Basin #: Operator: Oversight Prgm:

SANTOCH BAINS LUST

Review Date:

1999-01-01 00:00:00

Stop Date:

Not reported

Work Suspended :No

Responsible PartyRED TRIANGLE OIL

RP Address:

2809 S CHESTNUT, FRESNO, CA 93725 T0601900473

Global Id: Org Name:

Not reported Not reported

Contact Person: MTBE Conc:

Mtbe Fuel: Water System Name:

Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

5T10000489

EDR ID Number EPA ID Number

S104869180

S & J MINI MART (Continued)

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

Summary:

LOW RISK GROUNDWATER, GASOLINE IMPACTS IN SOILS AND GROUND- WATER REMEDIATION

Case Number:

VERY LOW. ADDITIONAL INVESTIGATION UNNECESSARY;

UNNECCESSARY.

LUST Region 5:

Substance:

GASOLINE

Case Type:

Drinking Water Aquifer affected

Program: Staff Initials: LUST

DAM Case Closed

Status: MTBE Code:

Regional Lead Agency:

CORTESE:

Region: Fac Address 2: CORTESE

476 H ST

CUPA:

Facility ID:

FA0269426

Region:

CUPA

Program Element: HAZ MAT DISCLOSURE/CLOSED SITE

Owner Name:

RED TRIANGLE OIL COMPANY

APM Number:

Facility ID:

Not reported FA0269426

Region:

CUPA

Program Element: CLOSED UST FACILITY/DATA VAULT

Owner Name:

RED TRIANGLE OIL COMPANY

APM Number:

Not reported

Not reported

Facility ID:

FA0269426 **CUPA**

Region:

Program Element: FORMER CONTAMINATED SITE/CLEANUP COMPLETE

Owner Name:

RED TRIANGLE OIL COMPANY

APM Number:

FRESNO COUNTY CREDIT UNION **R78**

2211 MERCED ST NNW 1/4-1/2

FRESNO, CA 93721

2207 ft.

Site 1 of 4 in cluster R

Relative: Lower

CERCLIS-NFRAP Classification Data:

Federal Facility:

Not a Federal Facility

Actual: 291 ft.

Non NPL Code:

NFRAP Not on the NPL

NPL Status:

CERCLIS-NFRAP Assessment History:

Assessment:

DISCOVERY

Completed:

Completed:

11/01/1987 11/10/1988

CERC-NFRAP

Assessment:

PRELIMINARY ASSESSMENT

Completed:

11/10/1988

Assessment:

ARCHIVE SITE

1003879054

CAD982358509

Map ID Direction Distance Distance (ft.) Site Elevation

Database(s)

EDR ID Number **EPA ID Number**

R79 NNW FRESNO COUNTY EMPLOYEES CREDIT UNION SITE

CA BOND EXP. PLAN

S100833490 NA

1/4-1/2 2207 ft. 2211 MERCED STREET **FRESNO, CA 93721**

Site 2 of 4 in cluster R

Relative: Lower

Actual:

291 ft.

BEP:

Site Description:

The site is presently owned by the Fresno County Credit Union and was previously a gasoline station. Five underground tanks were installed at the gas station by 1953. In December, 1981, a construction firm removed three tanks and the tanks were pressure tested. One tank failed to hold pressure and was disposed of as scrap metal. It is not known what became of the

other two tanks.

Hazardous Waste Desc:

Soil samples taken indicate that the soils were contaminated with constituents, typically found in gasoline, down to a depth of 55 feet. Ground water was encountered at a depth of 75 feet. Soil borings from the site contained benzene, toluene, ethylbenzene, xylene, organic lead, and EDB. Water samples contained all these same contaminants with the exception

of organic lead.

Threat To Public Health & Env:

Ground water beneath the site shows signs of contamination by constituents of gasoline. The ground water in this area, according to the Central Valley RWQCB, is of excellent quality and is used as the main source of drinking

water.

Site Activity Status:

Twining Laboratories, Inc., prepared a report for Fresno County Employees Credit Union entitled "Preliminary Geotechnical Investigation, Gasoline Contamination Assessment, Proposed Credit Union Building". The report was dated May 28, 1985 and describes the field and laboratory investigation.

Project Revenue Source Co.:

PRS Company Address:

Not Reported Not reported Not reported

Project Revenue Source Desc:

This site is projected to be remediated by the responsible parties with reimbursement to DHS for its oversight costs. If the RPs are unable to fund site investigation and remediation, another source of funds will need to be

identified.

Responsible Party:

BACKLOG SITE CLEANUP PLANNING REPORT

R80 NNW 1/4-1/2 2207 ft. FRESNO CO EMPLOYEES CREDIT UN

2211 MERCED ST **FRESNO, CA 93703**

Site 3 of 4 in cluster R

LUST S101581299 **CA FID UST** N/A **SWEEPS UST**

Relative: Lower

Actual:

291 ft.

State LUST:

Cross Street: Qty Leaked:

Not reported Not reported

Case Number Reg Board:

5T10000029 5F

Chemical: Lead Agency:

Gasoline Regional Board

Local Agency: Case Type:

10000 Soil only

Status: Review Date:

Case Closed 1985-04-01 00:00:00 2001-11-26 00:00:00

Workplan: Pollution Char: Remed Action:

Not reported Not reported

Monitoring: Close Date: Release Date: Not reported 2002-05-28 00:00:00 1986-09-19 00:00:00

Cleanup Fund Id: Not reported

Discover Date: 1984-01-01 00:00:00

Confirm Leak: Prelim Assess:

1985-04-01 00:00:00 2001-11-26 00:00:00

Remed Plan:

Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S101581299

FRESNO CO EMPLOYEES CREDIT UN (Continued)

Enforcement Dt: 1965-01-01 00:00:00

Enf Type:

CLOS

Enter Date :

1987-09-24 00:00:00

Funding:

Not reported LAN

Staff Initials:

How Discovered: Subsurface Monitoring

How Stopped:

Not reported

Interim:

Not reported

UNK

Leak Cause:

Leak Source:

Tank

MTBE Date:

Not reported Max MTBE GW: Not reported

MTBE Tested:

MTBE Detected. Site tested for MTBE & MTBE detected

Priority: Local Case #: Medium priority FA0267531

Beneficial:

Not reported

DAM

Staff:

Not reported

GW Qualifier:

Max MTBE Soil: 0.05 Parts per Million

Soil Qualifier: Hydr Basin #:

SAN JOAQUIN (5-22)

Operator:

Not reported

Oversight Prgm:

LUST

Review Date:

2002-05-28 00:00:00

Stop Date:

Not reported

Work Suspended :No

Responsible PartySUSAN RYAN

RP Address: Global Id:

2580 W SHAW LN T0601900028

Org Name:

Not reported

Contact Person: Not reported

MTBE Conc:

Mtbe Fuel:

Not reported

Water System Name: Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

Summary:

Not reported

LUST Region 5:

Substance:

GASOLINE

Case Type:

Soil only

Program:

LUST

Staff Initials: Status:

DAM

MTBE Code:

Case Closed

Lead Agency:

Regional

5T10000029

Case Number:

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

FRESNO CO EMPLOYEES CREDIT UN (Continued)

S101581299

FID:

Facility ID:

10000055

Regulate ID:

Not reported

Reg By: Cortese Code: Active Underground Storage Tank Location Not reported

SIC Code:

Not reported

Status:

Active

Facility Tel:

Not reported

Mail To:

Not reported

4979 E UNIVERSITY

FRESNO, CA 93703

Contact: DUNs No: Creation:

Not reported Not reported 10/22/93

Contact Tel: NPDES No: Modified:

Not reported Not reported 00/00/00

EPA ID: Comments: Not reported Not reported

SWEEPS:

Status:

Comp Number:

Α 129

Number: Board Of Equalization: Not reported

Ref Date: Act Date: Created Date:

02-09-89 02-09-89

02-09-89

Tank Status: Owner Tank Id:

Not reported Swrcb Tank Id:

Actv Date:

10-000-000129-000001 02-09-89

Capacity: Tank Use:

550 M.V. FUEL

Stg:

Content:

LEADED

Number Of Tanks:

Status: Comp Number:

129

Number:

02-09-89

Board Of Equalization: Not reported Ref Date:

Act Date: Created Date: 02-09-89 02-09-89

Tank Status:

Owner Tank Id:

Not reported

Swrcb Tank Id: Actv Date:

10-000-000129-000002 02-09-89

Capacity:

550

Tank Use: Stg:

M.V. FUEL

Content:

LEADED

Number Of Tanks:

Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

Cortese

EDR ID Number EPA ID Number

1000383640

N/A

R81 NNW FRESNO CO. CREDIT UNION

2211 MERCED **FRESNO, CA 93721**

1/4-1/2 2207 ft.

Site 4 of 4 in cluster R

Relative: Lower

CORTESE:

Region:

CORTESE

Actual: 291 ft.

Fac Address 2:

2211 MERCED

82 North FRESNO CLINTON B.P. 2409 FRESNO ST N FRESNO, CA 93703

S103645204 HAZNET LUST

N/A Cortese

1/4-1/2 2263 ft.

Relative: Higher

State LUST:

CLINTON Cross Street: Qty Leaked: Not reported 5T10000494 Case Number

Actual: 294 ft.

5F Reg Board: Gasoline Chemical: Regional Board Lead Agency: 10000

Local Agency:

Drinking Water Aquifer affected Case Type:

Preliminary site assessment workplan submitted Status:

Not reported Confirm Leak: Review Date: Not reported Prelim Assess: Not reported Not reported Workplan: Not reported Remed Plan: Not reported Pollution Char: Not reported

Remed Action: Monitoring: Not reported Not reported Close Date: 1994-05-02 00:00:00 Release Date: Cleanup Fund Id: Not reported

1994-05-02 00:00:00 Discover Date : Enforcement Dt: 1965-01-01 00:00:00

SEL Enf Type:

1994-05-13 00:00:00 Enter Date: Responsible Party Funding:

DAV Staff Initials: How Discovered: Tank Closure Not reported How Stopped: Not reported Interim: UNK Leak Cause: Leak Source: UNK

MTBE Date: Not reported Max MTBE GW: Not reported

Site NOT Tested for MTBE.Includes Unknown and Not Analyzed. MTBE Tested:

Not reported Priority: Local Case #: FA0169717 Beneficial: Not reported DAM Staff: Not reported GW Qualifier: Max MTBE Soil: Not reported Not reported Soil Qualifier:

SAN JOAQUIN (5-22) Hydr Basin #:

Not reported Operator: Oversight Prgm: LUST

1994-05-12 00:00:00 Review Date: Stop Date: 1994-03-24 00:00:00

Work Suspended :No

Responsible PartyMARY JO BATON

MAP FINDINGS

Database(s)

5T10000494

EDR ID Number EPA ID Number

S103645204

FRESNO CLINTON B.P. (Continued)

RP Address:

5100 N 6TH ST, FRESNO, CA 93710 T0601900478

Global Id: Org Name:

Not reported Not reported

Contact Person: MTBE Conc:

Mtbe Fuel:

Water System Name:

Not reported Not reported

Well Name: Distance To Lust:

Waste Discharge Global ID: Not reported

Waste Disch Assigned Name: Not reported Summary:

Not reported

LUST Region 5:

Substance:

GASOLINE

DAM

Case Type:

Drinking Water Aquifer affected LUST

Program:

Staff Initials:

Case Number:

Status:

Preliminary site assessment workplan submitted MTBE Code:

Lead Agency: Regional

HAZNET:

Gepaid: TSD EPA ID: CAC000918432 CAD980883177

Gen County:

Fresno

Tsd County: Tons:

Kem 1.0425

Facility Address 2: Waste Category:

Not reported Unspecified oil-containing waste

Disposal Method:

Recycler

Contact:

MARY JOE BURTON

Telephone: Mailing Name:

(000) 000-0000 Not reported

Mailing Address: 5100 NORTH 6TH STREET

FRESNO, CA 93710

County

Fresno

CORTESE:

Region:

CORTESE

Fac Address 2:

2409 FRESNO ST N

83 SSW 1/4-1/2 **BLUES AUTO**

620 F ST

FRESNO, CA 93721 2268 ft.

LUST S104868689 Cortese

Fresno Co. CUPA

SWEEPS UST

N/A

Relative: Lower

Actual:

291 ft.

State LUST:

Cross Street:

VENTURA BLVE

Qty Leaked: Case Number Not reported 5T10000537

Reg Board:

Chemical:

5F Gasoline

Lead Agency:

Local Agency

Local Agency:

10000

Case Type:

Soil only

Status:

Review Date:

Case Closed

Workplan:

Not reported

Not reported Not reported

Pollution Char:

Confirm Leak: Prelim Assess: Not reported Not reported

Remed Plan:

Not reported

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S104868689

BLUES AUTO (Continued)

Remed Action: Monitoring:

Not reported Not reported

Close Date: Release Date: 2003-08-05 00:00:00 1993-07-07 00:00:00

Cleanup Fund Id: Not reported

Discover Date: 1993-06-28 00:00:00

Enforcement Dt: 1965-01-01 00:00:00

Enf Type:

CLOS

Enter Date: Funding:

1993-07-26 00:00:00 Not reported

Staff Initials:

LUI

How Discovered: Tank Closure How Stopped:

Not reported

Interim: Leak Cause: Not reported UNK

Leak Source:

UNK

MTBE Date: Max MTBE GW: Not reported

Not reported

MTBE Tested:

Site NOT Tested for MTBE.Includes Unknown and Not Analyzed.

Priority: Local Case #: Not reported FA0169534 Not reported

Beneficial: Staff:

DAM Not reported Max MTBE Soil: Not reported

GW Qualifier: Soil Qualifier: Hvdr Basin #:

Not reported SAN JOAQUIN (5-22)

Operator:

RICHARD MARTIN

Oversight Prgm: LUST

Review Date:

1993-07-26 00:00:00

Stop Date: Work Suspended :No

1993-03-31 00:00:00

Responsible PartyAKIRA YOKOMI

RP Address:

1535 KERN ST, FRESNO, CA 93721 T0601900520

Global Id: Org Name:

Not reported

Contact Person:

Not reported

MTBE Conc:

0

Mtbe Fuel:

DANISH CREAMERY ASSOCIATION

Water System Name:

Not reported

Well Name: Distance To Lust:

Waste Discharge Global ID: W0601900375 Waste Disch Assigned Name: 1000375-001GEN

Summary:

Not reported

LUST Region 5:

Substance:

GASOLINE

Case Type:

Soil only

Program:

LUST

Staff Initials:

DAM

Status:

Case Closed

MTBE Code: Lead Agency: N/A Local

CORTESE:

Region:

CORTESE

Fac Address 2:

620 F ST

5T10000537

Case Number:

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

BLUES AUTO (Continued)

S104868689

CUPA:

Facility ID:

FA0169534

Region:

CUPA

Owner Name:

Program Element: FORMER CONTAMINATED SITE/CLEANUP COMPLETE YOKOMI, NOFUKO

APM Number:

467-081-09

Facility ID:

FA0169534

Region:

CUPA

Program Element: UST REMOVAL/CLOSURE W/1 TANK

Owner Name:

YOKOMI, NOFUKO

APM Number:

467-081-09

SWEEPS:

Status:

Not reported

Comp Number:

Number:

Not reported

Board Of Equalization :

44-003204

Ref Date:

Not reported

Act Date:

Not reported Not reported

Created Date: Tank Status:

Not reported

Owner Tank Id:

Not reported

Swrcb Tank Id:

10-000-000087-000001

Actv Date:

Not reported

Capacity:

600

Tank Use:

OIL

Sta:

WASTE

WASTE OIL

Content: Number Of Tanks:

84

FIRE DEPT HEADQUARTERS

ESE 1/4-1/2 450 M ST

2323 ft.

FRESNO, CA 93706

Relative: Equal

Actual:

State LUST:

Cross Street:

SANTA CLARA

Qtv Leaked:

Not reported

Case Number

5T10000123

292 ft.

Reg Board: Chemical:

5F Gasoline

Lead Agency:

Local Agency:

Regional Board

Case Type:

10000 Soil only

Status:

Pollution Characterization

Confirm Leak:

Prelim Assess:

Remed Plan:

Not reported

Not reported

Not reported

Review Date:

Not reported

Workplan:

Not reported

Pollution Char:

Remed Action:

Not reported

Monitoring:

Not reported

Not reported

Close Date: Release Date: Not reported

Cleanup Fund Id: Not reported

1988-10-10 00:00:00

Discover Date:

Enforcement Dt: 1965-01-01 00:00:00

1988-09-13 00:00:00

Enf Type:

OEFA

Enter Date:

1988-10-02 00:00:00

Funding:

State Funds

LUST \$106175230

NA

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

S106175230

FIRE DEPT HEADQUARTERS (Continued)

Staff Initials:

PEG

How Discovered: Tank Closure How Stopped:

Not reported

Interim:

Not reported

Leak Cause:

UNK

Leak Source:

UNK

MTBE Date:

Not reported Max MTBE GW: Not reported

MTBE Tested:

Site NOT Tested for MTBE.Includes Unknown and Not Analyzed.

Priority:

Not reported

Local Case #: Beneficial:

FA0269414

Not reported

Staff:

DAM

GW Qualifier:

Not reported

Max MTBE Soil: Not reported Not reported

Soil Qualifier:

SAN JOAQUIN (5-22)

Hydr Basin #:

Not reported

Operator:

Oversight Prgm: LUST

Review Date:

1988-10-10 00:00:00 1988-09-08 00:00:00

Stop Date:

Work Suspended :No

Responsible PartyCITY OF FRESNO RP Address:

Global Id:

2101 "G" ST., FRESNO, CA 93706 T0601900121

Org Name:

Not reported

MTBE Conc:

Contact Person: Not reported

0

Mtbe Fuel: Water System Name:

ARBOR MOBILE HOME PARK

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: W0603900831 Waste Disch Assigned Name: 2000831-001GEN Not reported

Summary:

85 NNE SIERRA NATIONAL FOREST

1130 O STREET

1/4-1/2 2334 ft. FRESNO, CA 93721

Relative: Higher

CERCLIS-NFRAP Classification Data:

Federal Facility:

Federal Facility

Non NPL Code: NPL Status:

NFRAP

Actual: 297 ft.

Not on the NPL CERCLIS-NFRAP Assessment History:

Assessment: Assessment: DISCOVERY

PRELIMINARY ASSESSMENT

Assessment:

SITE INSPECTION

Assessment: Assessment:

SITE INSPECTION ARCHIVE SITE

CERCLIS-NFRAP Alias Name(s): SIERRA NF: BASS LAKE LANDFILL **CERC-NFRAP**

08/01/1987

09/04/1990

09/04/1990

08/25/1993

08/25/1993

Completed:

Completed:

Completed:

Completed:

Completed:

1002850116

CA5122307643

Confirm Leak:

Prelim Assess:

Remed Plan:

Map ID Direction Distance Distance (ft.) Elevation

Database(s)

LUST

EDR ID Number **EPA ID Number**

86 SSE KALASHIAN PACKING CO.

401 H ST

1/4-1/2 2443 ft. FRESNO, CA 93721

Cortese Fresno Co. CUPA

1992-10-14 00:00:00

Not reported

Not reported

S101294500 N/A

Relative: Higher

Actual:

296 ft.

State LUST:

Cross Street: Qty Leaked:

SAN BENITO ST Not reported 5T10000401

Case Number Reg Board: Chemical:

5F Gasoline Local Agency 10000

Local Agency: Case Type: Status:

Lead Agency:

Undefined

Review Date:

Leak being confirmed

1992-10-14 00:00:00 Not reported

Workplan: Pollution Char: Not reported Remed Action: Not reported Monitoring: Not reported Close Date: Not reported

Release Date: 1992-10-22 00:00:00 Cleanup Fund Id: Not reported

Discover Date: 1992-10-14 00:00:00 Enforcement Dt: 1965-01-01 00:00:00

Enf Type: Enter Date: Not reported 1992-11-05 00:00:00

Funding: Responsible Party Staff Initials: LUI

How Discovered: Tank Closure How Stopped: Not reported Interim: Not reported Leak Cause: UNK Leak Source: UNK

MTBE Date: Not reported Max MTBE GW: Not reported MTBE Tested:

Site NOT Tested for MTBE.Includes Unknown and Not Analyzed. Priority: Medium priority

Local Case #: Beneficial: Staff:

FA0268242 Not reported DAM GW Qualifier: Not reported Not reported

Max MTBE Soil: Soil Qualifier: Not reported Hydr Basin #:

SAN JOAQUIN (5-22) Operator: RICHARD KALASHIAN Oversight Prgm:

Review Date: Stop Date:

1992-10-22 00:00:00 1992-09-18 00:00:00

Work Suspended :No

Responsible PartyKALASHIAN PACKING CO.

RP Address: Global Id:

401 -H- STREET - FRESNO, CA 93721 T0601900392

Org Name: Contact Person:

Well Name:

Not reported Not reported

MTBE Conc: Mtbe Fuel:

Water System Name:

Not reported Not reported

Map ID Direction Distance Distance (ft.) Site Elevation

Database(s)

5T10000401

EDR ID Number EPA ID Number

\$101294500

KALASHIAN PACKING CO. (Continued)

Distance To Lust:

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

AN ASSESSMENT TO DETERMINE THE EXTENT OF IPACE IS IN PROGRESS.

Case Number:

LUST Region 5:

Substance:

GASOLINE

Case Type: Program:

Undefined LUST

Staff Initials:

DAM

Leak being confirmed

Status:

MTBE Code: Lead Agency: N/A Local

CORTESE:

Region:

CORTESE

Fac Address 2:

401 H ST

CUPA:

Facility ID:

FA0270516

Region:

CUPA

Program Element: HAZ MAT DISCLOSURE/CLOSED SITE

Owner Name:

KALASHIAN, RICHARD

APM Number:

Not reported

Facility ID:

FA0268242

Region:

CUPA

Program Element: CONTAMINATED UST SITE/EHS LEAD AGENCY

Owner Name:

SOUTHERN PACIFIC RAILROAD

APM Number:

Not reported

Facility ID:

FA0270516 CUPA

Region:

Program Element: MEDIUM HAZARDOUS MATERIALS HANDLER

Owner Name:

KALASHIAN, RICHARD

APM Number:

Not reported

Facility ID:

FA0268242

Region:

CUPA

Program Element: UST REMOVAL/CLOSURE W/1 TANK SOUTHERN PACIFIC RAILROAD

Owner Name: APM Number:

Not reported

87 WSW FRANKS SERVICE STATION

1060 E ST

FRESNO, CA 93721

1/4-1/2 2452 ft. Relative:

Lower

State LUST:

Cross Street: Qty Leaked:

MARIPOSA

Actual:

Case Number Reg Board:

Not reported 5T10000466

284 ft.

Chemical:

Gasoline

Lead Agency: Local Agency:

Local Agency 10000

Case Type:

Soil only

Status:

Case Closed

Review Date: Workplan:

Not reported Not reported Confirm Leak:

Not reported

Prelim Assess:

Not reported

S106175285

N/A

LUST

SWEEPS UST

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

FRANKS SERVICE STATION (Continued)

S106175285

Pollution Char: Remed Action:

Not reported Not reported

Remed Plan:

Not reported

Monitoring: Close Date: Not reported 1996-06-21 00:00:00

Release Date:

1993-10-27 00:00:00

Cleanup Fund Id: Not reported

Discover Date: 1993-10-18 00:00:00 Enforcement Dt: 1965-01-01 00:00:00 Enf Type: None Taken

Enter Date:

1993-12-07 00:00:00

Funding:

State Funds

Staff Initials: How Discovered: Tank Closure

JRA

How Stopped: Interim:

Not reported Not reported

Leak Cause:

UNK

Leak Source: Not reported MTBE Date: Not reported Max MTBE GW: Not reported

MTBE Tested:

Site NOT Tested for MTBE.Includes Unknown and Not Analyzed.

Priority:

Local Case #:

Not reported Not reported

Beneficial: Staff:

DAM

GW Qualifier: Not reported Max MTBE Soil: Not reported Soil Qualifier: Not reported

Hydr Basin #: Operator:

SAN JOAQUIN (5-22) MIKIYE TASHIMA

Oversight Prgm: LUST

Review Date: Stop Date:

1997-04-02 00:00:00

1993-09-16 00:00:00 Work Suspended :No

Responsible PartyMIKIYE TASHIMA

RP Address:

2722 HUGHES N, FRESNO, CA 93722

Global Id:

T0601900453 Not reported

Org Name: Contact Person:

Not reported

MTBE Conc:

Mtbe Fuel:

Not reported

Water System Name: Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: Not reported

Waste Disch Assigned Name: Not reported

Summary:

FRESNO COUNTY COMMUNITY HEALTH DEPARTMENT HAS REQUIRED THE SITE

RESPONSIBLE PARTY TO SECURE THE SERVICES OF AN APPROVEDENVIRINMENTAL ENGINEERING CONSULTING FIRM.

ON CLEANUP FUND PRIORITY LIST.

SWEEPS:

Status: Comp Number: Not reported

Number:

1983 Not reported

Board Of Equalization: Ref Date:

44-003442 Not reported Not reported

Act Date: Created Date:

Not reported

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number**

S106175285

FRANKS SERVICE STATION (Continued)

Tank Status:

Not reported Not reported

Owner Tank Id: Swrcb Tank Id:

10-000-001983-000001

Actv Date:

Not reported

Capacity:

350

Tank Use:

OIL

Stg: Content: WASTE WASTE OIL

Number Of Tanks:

Status:

Not reported

Comp Number:

1983

Number:

Not reported

Board Of Equalization: 44-003442

Ref Date:

Not reported

Act Date:

Not reported

Created Date :

Not reported

Tank Status:

Not reported

Owner Tank Id:

Not reported

Swrcb Tank Id:

10-000-001983-000002

Actv Date:

Not reported

Capacity:

6000

Tank Use:

M.V. FUEL

PRODUCT

Stg: Content:

REG UNLEADED

Number Of Tanks:

Not reported

Status:

Not reported

Comp Number:

1983

Number:

Not reported

Board Of Equalization: 44-003442

Ref Date:

Not reported

Act Date:

Not reported

Created Date:

Not reported

Tank Status:

Not reported

Owner Tank ld:

Not reported

Swrcb Tank ld:

10-000-001983-000003

Actv Date:

Not reported

Capacity:

6000

Tank Use:

M.V. FUEL

Stg:

PRODUCT

REG UNLEADED

Content: Number Of Tanks:

Not reported

Not reported

Status: Comp Number:

1983

Number:

Not reported

Board Of Equalization:

44-003442

Ref Date:

Not reported

Act Date :

Not reported

Created Date:

Not reported Not reported

Tank Status: Owner Tank Id:

Not reported 10-000-001983-000004

Swrcb Tank Id:

Actv Date:

Not reported

Capacity: Tank Use: 4000 M.V. FUEL

MAP FINDINGS

Database(s)

HAZNET

SWRCY

EDR ID Number EPA ID Number

S106175285

S102800658

NA

FRANKS SERVICE STATION (Continued)

Stg: Content: PRODUCT

Number Of Tanks:

PRM UNLEADED Not reported

88

MERCADO PLAZA PARTNERS

West 1/4-1/2 1435 FRESNO ST **FRESNO, CA 93706**

2567 ft.

Relative: Lower

CA SWRCY

Certification Status:

Actual: 284 ft.

Facility Phone Number:

Not reported Not reported

Whether The Facility Is Grandfathered: Convenience Zone Where Faciltiy Located:

Convenience Zone Where Faciltiy Located 2: 311 Convenience Zone Where Faciltiy Located 3: 3110 Convenience Zone Where Faciltiy Located 4: 3181 Convenience Zone Where Facility Located 5: 3867 Convenience Zone Where Faciltiy Located 6: 5027 Convenience Zone Where Facility Located 7:0

Aluminum Beverage Containers Redeemed: AL Glass Beverage Containers Redeemed: GL Plastic Beverage Containers Redeemed : PL

Other mat beverage containers redeemed: Not Accepted Refillable Beverage Containers Redeemed: Not Accepted

Date facility became certified:

02/16/00

Date facility began operating (no date indicates never operational): 04/01/00 Date facility ceased operating (no date indicates still operating):

HAZNET:

Gepaid: TSD EPA ID: CAC000978576

Gen County: Tsd County:

CAD980883177 Fresno

Facility Address 2:

1.9515 Not reported

Waste Category:

Unspecified oil-containing waste

Disposal Method:

Recycler

Kem

Contact: Telephone: MERCADO PLAZA PARTNERS

Mailing Name:

(209) 266-9964 Not reported

Mailing Address: 5114 E. CLINTON FRESNO, CA 93727

County

Fresno

89 NNW 1/4-1/2

ADAM'S AUTOMOTIVE 1402 VAN NESS AVE N

FRESNO, CA 93728

LUST Cortese

Fresno Co. CUPA

S101294588 WA

2570 ft. Relative: Lower

State LUST:

Cross Street: Qty Leaked:

E FLORADORA Not reported

Actual: 289 ft.

Case Number Reg Board:

5T10000262

Chemical: Lead Agency: Gasoline Regional Board

Local Agency: Case Type:

10000 Undefined

Confirm Leak:

Prelim Assess:

Remed Plan:

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

1990-10-11 00:00:00

Not reported

Not reported

EDR ID Number EPA ID Number

S101294588

ADAM'S AUTOMOTIVE (Continued)

Status:

Pollution Characterization

Review Date:

1990-10-11 00:00:00

Workplan: Pollution Char: Not reported Not reported

Remed Action: Monitoring:

Not reported Not reported Not reported

Close Date: Release Date:

1990-10-16 00:00:00

Cleanup Fund ld : Not reported

Discover Date: 1990-10-11 00:00:00 Enforcement Dt: 1965-01-01 00:00:00 SEL

Enf Type:

Enter Date: 1990-11-07 00:00:00

Funding: Staff Initials: Not reported

STE How Discovered: Tank Closure How Stopped:

Not reported Not reported

Interim: Leak Cause: Leak Source:

UNK UNK Not reported

MTBE Date: Max MTBE GW: Not reported MTBE Tested:

Site NOT Tested for MTBE.Includes Unknown and Not Analyzed.

Priority: Local Case #:

Not reported FA0170586 Not reported

Beneficial: Staff: GW Qualifier:

DAM Not reported Max MTBE Soil: Not reported Soil Qualifier: Not reported

Hydr Basin #: Operator:

SAN JOAQUIN (5-22) SEE R.P.

Oversight Prgm: LUST Review Date:

1990-11-07 00:00:00 1990-09-11 00:00:00

Stop Date:

Work Suspended :No Responsible PartyMING C. LUM

RP Address:

3599 W. FIR AVENUE, FRESNO, CA 93711

Global Id: Org Name: Contact Person: Not reported

T0601900259 Not reported

MTBE Conc: Mtbe Fuel:

0

Water System Name:

Not reported Not reported

Well Name: Distance To Lust:

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

Summary:

AN ASSESSMENT TO DETERMINE THE EXTENT OF IMPACT IS CURRENTLYIN

Case Number:

5T10000262

PROGRESS

LUST Region 5:

Substance: Case Type:

GASOLINE Undefined

Program: Staff Initials: LUST DAM

N/A

Status:

Pollution Characterization

MTBE Code:

TC1706388.1s Page 85

MAP FINDINGS

Confirm Leak:

Prelim Assess:

Remed Plan:

Not reported

Not reported

Not reported

Database(s)

LUST

Cortese

S105023828

N/A

EDR ID Number EPA ID Number

S101294588

ADAM'S AUTOMOTIVE (Continued)

Lead Agency:

Regional

CORTESE:

Region:

CORTESE

Fac Address 2:

1402 VAN NESS AVE N

CUPA:

Facility ID:

FA0170586

Region:

CUPA

Owner Name:

Program Element: UST REMOVAL/CLOSURE W/5 TANKS

LUM, MING & MO-SIN

APM Number:

451-122-14

451-122-14

Facility ID:

FA0170586

Region:

CUPA

Program Element: CONTAMINATED UST SITE/RWQCB LEAD AGENCY

Owner Name:

APM Number:

LUM, MING & MO-SIN

90 West

PEPSI-COLA BOTTLING CO

1/4-1/2

2592 ft.

1150 NORTH AVE E

FRESNO, CA 93725

Relative: Lower

Actual:

282 ft.

State LUST:

Cross Street:

S EAST AVE

Qty Leaked: Case Number Not reported

5T10000361 5F

Reg Board: Chemical:

Motor Oil

Lead Agency:

Local Agency

Local Agency:

10000

Case Type: Status:

Soil only Case Closed

Review Date:

Not reported

Workplan:

Not reported

Pollution Char: Remed Action: Not reported

Not reported

Monitoring:

Not reported

Close Date:

Release Date:

1993-11-23 00:00:00

Cleanup Fund Id: Not reported

1991-07-09 00:00:00

Discover Date: 1991-07-08 00:00:00

Enforcement Dt: 1965-01-01 00:00:00

Enf Type:

None Taken

Enter Date:

1991-07-18 00:00:00

Funding:

Responsible Party

Staff Initials: How Discovered: OM

CHR

Not reported

How Stopped:

Not reported

Interim: Leak Cause:

Leak Source:

Structure Failure

MTBE Date:

Piping

Not reported

Max MTBE GW:

Not reported

MTBE Tested:

Not Required to be Tested.

Priority:

Local Case #: Beneficial:

Not reported Not reported

Staff:

DAM

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

S105023828

PEPSI-COLA BOTTLING CO (Continued)

GW Qualifier: Not reported Max MTBE Soil: Not reported Soil Qualifier:

Not reported

Hydr Basin #:

SAN JOAQUIN (5-22)

Operator: Oversight Prgm: LUST

S.L. NELSON

Review Date:

1993-11-23 00:00:00 1991-07-02 00:00:00

Stop Date: Work Suspended :No

Responsible PartyPEPSI-COLA BOTTLING CO.

RP Address:

1150 E. NORTH AVENUE, FRESNO 93725 T0601900354

Global Id: Org Name:

Not reported Contact Person: Not reported

MTBE Conc:

Mtbe Fuel: Water System Name:

VALLEY DETROIT DIESEL ALLISON

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: W0601900431 Waste Disch Assigned Name: 1000431-001GEN

Summary:

Not reported

LUST Region 5:

Substance: Case Type: MOTOR OIL Soil only

Program:

LUST

Staff Initials:

DAM

Status:

Case Closed

MTBE Code: Lead Agency: N/A Local

CORTESE:

Region:

CORTESE

Fac Address 2:

1150 NORTH AVE E

91

DEPT OF TRANSPORTATION

North 1/4-1/2

1283 WEST AVE N **FRESNO, CA 93728**

2592 ft.

Relative: Equal

State LUST:

Cross Street: Qty Leaked:

Not reported Not reported 5T10000017

Actual: 292 ft.

Case Number Reg Board:

Hydrocarbons

Chemical: Lead Agency:

Local Agency 10000

Local Agency: Case Type: Status:

Soil only Case Closed

Review Date: Workplan:

Not reported Not reported

Pollution Char: Remed Action: Not reported

Monitoring:

Not reported

Close Date:

Not reported 1990-03-23 00:00:00

Release Date: 1987-03-16 00:00:00 Cleanup Fund Id: Not reported

Discover Date: 1965-01-01 00:00:00

LUST Cortese

5T10000361

Not reported

Not reported

Not reported

Case Number:

Confirm Leak:

Prelim Assess:

Remed Plan:

\$103065730

N/A

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S103065730

DEPT OF TRANSPORTATION (Continued)

Enforcement Dt: 1965-01-01 00:00:00

Enf Type:

CLOS

Enter Date:

1987-09-25 00:00:00

Funding:

Not reported

Staff Initials:

JIM How Discovered: Not reported

How Stopped: Interim:

Not reported Not reported Not reported

Leak Cause: Leak Source: MTBE Date:

Not reported Not reported

Max MTBE GW: Not reported MTBE Tested:

Not Required to be Tested.

Priority: Local Case #:

Not reported FA0170438

Beneficial:

Not reported

Staff: GW Qualifier:

DAM Not reported Max MTBE Soil: Not reported

Soil Qualifier: Hydr Basin #:

Not reported SAN JOAQUIN (5-22)

Operator:

Not reported

Oversight Prgm: LUST

Review Date: Stop Date:

2002-02-13 00:00:00 1965-01-01 00:00:00

Work Suspended :No Responsible PartyOSA

RP Address: Global Id:

Not reported T0601900017

Org Name: Contact Person:

Not reported Not reported

MTBE Conc: Mtbe Fuel:

Water System Name:

Not reported

Well Name:

Not reported

Distance To Lust:

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

Summary:

TNK TEST INCONCLUSIVE. PROP. 65 LIST OF FACILITY.

LUST Region 5:

Substance:

HYDROCARBONS

Case Type:

Soil only LUST

Program: Staff Initials:

DAM

Case Number: 5T10000017

Status:

Case Closed

MTBE Code: Lead Agency:

N/A Local

CORTESE:

Region:

CORTESE

Fac Address 2:

1283 WEST AVE N

Map ID Direction Distance Distance (ft.) Site Elevation

Database(s)

EDR ID Number EPA ID Number

92

TWINING LABORATORIES INC

NNE 1/4-1/2

2527 FRESNO ST **FRESNO, CA 93721**

2626 ft. Relative: **RCRA-SQG FINDS**

1000316143 CAD007964240

HAZNET LUST **CHMIRS** Cortese Fresno Co. CUPA

Higher Actual: 298 ft.

RCRAInfo:

Owner:

NOT REQUIRED

(415) 555-1212

EPA ID:

CAD007964240

Contact:

Not reported

Classification: **Small Quantity Generator**

TSDF Activities: Not reported Violation Status: Violations exist

Regulation Violated:

Not reported

Area of Violation:

GENERATOR-PRE-TRANSPORT REQUIREMENTS

Date Violation Determined:

08/21/2003 Not reported

Actual Date Achieved Compliance:

Area of Violation

There are 1 violation record(s) reported at this site:

Not reported

Not reported

Not reported

Date of Compliance

Compliance Evaluation Inspection

GENERATOR-PRE-TRANSPORT REQUIREMENTS

Confirm Leak:

Prelim Assess:

Remed Plan:

FINDS:

Other Pertinent Environmental Activity Identified at Site: California - Hazardous Waste Tracking System - Datamart

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

State LUST:

Cross Street:

Not reported

Qtv Leaked: Case Number Not reported 5T10000070

Reg Board:

5F

Chemical: Lead Agency: Unleaded Gasoline

Local Agency:

Regional Board 10000

Case Type: Status:

Soil only

Review Date:

Case Closed Not reported Not reported

Workplan: Pollution Char: Remed Action:

Not reported Not reported

Monitoring: Close Date: Release Date: Not reported 2005-03-11 00:00:00 1987-12-22 00:00:00

Cleanup Fund Id: Not reported

Discover Date: 1965-01-01 00:00:00 Enforcement Dt: 1965-01-01 00:00:00

Enf Type:

CLOS

Enter Date:

1987-12-22 00:00:00

Funding:

State Funds

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number**

1000316143

TWINING LABORATORIES INC (Continued)

Staff Initials:

JIM

How Discovered: Not reported How Stopped:

Not reported

Interim:

Not reported

Leak Cause:

Not reported

Leak Source:

Not reported

MTBE Date:

Not reported

Max MTBE GW: Not reported

MTBE Tested:

MTBE Detected. Site tested for MTBE & MTBE detected

Priority: Local Case #:

Not reported

FA0004971

Beneficial:

Not reported

Staff:

DAM

GW Qualifier:

Not reported

Max MTBE Soil:

0.001 Parts per Million

Soil Qualifier:

Hydr Basin #:

SAN JOAQUIN (5-22)

Operator:

Not reported

Oversight Prgm:

LUST

2002-02-13 00:00:00

Review Date: Stop Date:

1965-01-01 00:00:00

Work Suspended :No

Responsible PartyTWINNING LABORATORIES INC.

RP Address:

P.O. BOX 1472, FRESNO, CA 93716

Global Id:

T0601900069

Org Name:

Not reported

Contact Person:

Not reported

MTBE Conc:

Mtbe Fuel:

Water System Name:

Not reported

Well Name:

Not reported

Case Number:

5T10000070

Distance To Lust:

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

Summary:

Not reported

LUST Region 5:

Substance:

UNLEAD GASOLINE

Case Type:

Soil only

Program:

LUST

Staff Initials:

DAM

Status:

MTBE Code:

Case Closed

N/A

Lead Agency:

Regional

HAZNET:

Gepaid:

CAD007964240

TSD EPA ID:

CAT080022148

Gen County:

Fresno

Tsd County:

San Bernardino

Tons:

.2293 Not reported

Facility Address 2:

Waste Category: Disposal Method: Waste oil and mixed oil

Contact:

Transfer Station HARRY D MOORE

Telephone:

(209) 268-7021

Mailing Name:

Not reported

Mailing Address: PO BOX 1472

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

1000316143

TWINING LABORATORIES INC (Continued)

FRESNO, CA 93716 - 1472

County

Fresno

Gepaid:

CAD007964240 CAT080022148

TSD EPA ID: Gen County:

Fresno

Tsd County:

San Bernardino

Tons:

.2293

Facility Address 2: Waste Category:

Not reported Unspecified organic liquid mixture

Disposal Method:

Transfer Station

Contact: Telephone: HARRY D MOORE (209) 268-7021 Not reported

Mailing Name: Mailing Address: PO BOX 1472

FRESNO, CA 93716 - 1472

County

Fresno

Gepaid: TSD EPA ID: CAD007964240 CAT080022148

Gen County:

Fresno

Tsd County:

San Bernardino

Tons:

1.3761

Facility Address 2:

Not reported

Waste Category: Disposal Method: Liquids with pH <UN-> 2 **Transfer Station** HARRY D MOORE

Contact: Telephone:

(209) 268-7021

Mailing Name:

Not reported

Mailing Address: PO BOX 1472

FRESNO, CA 93716 - 1472

County

Fresno

Gepaid: TSD EPA ID: CAD007964240

Gen County:

CAD980884183 Fresno

Tsd County:

Fresno

Tons:

Facility Address 2:

0.2

Waste Category:

Not reported

Unspecified organic liquid mixture

Disposal Method:

Disposal, Other

Contact: Telephone: LINDA DAVIDSON CONTROLLER

Mailing Name:

(559) 268-7021

Not reported

Mailing Address: PO BOX 1472

FRESNO, CA 93716 - 1472

County

Fresno

Gepaid:

CAD007964240

TSD EPA ID:

CAD980884183

Gen County:

Fresno

Tsd County:

Fresno

Tons:

0.41 Not reported

Facility Address 2: Waste Category:

Liquids with pH <UN-> 2 with metals

Disposal Method:

Disposal, Other

Contact:

LINDA DAVIDSON CONTROLLER

Telephone:

(559) 268-7021

Mailing Name:

Not reported

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

1000316143

TWINING LABORATORIES INC (Continued)

Mailing Address: PO BOX 1472

FRESNO, CA 93716 - 1472

County

Fresno

Click this hyperlink while viewing on your computer to access 20 additional CA HAZNET record(s) in the EDR Site Report.

CORTESE:

Region:

CORTESE

Fac Address 2:

2527 FRESNO ST N

CHMIRS:

OES Control Number:

9014202

Extent of Release:

Not reported

Property Use: Incident Date: Mercantile, Business

29-NOV-90

Date Completed: 29-NOV-90

Time Completed : Agency Id Number : Agency Incident Number :

1225 10728 468 9014202

OES Incident Number : Time Notified : Surrounding Area : Estimated Temperature : Property Management :

More Than Two Substances Involved? : Special Studies 1 : Special Studies 2 : Special Studies 3 : Special Studies 4 : Special Studies 5 :

Not reported Not reported Not reported Not reported Not reported

Not reported

Special Studies 6: N
Resp Agncy Personel # Of Decontaminated: 0
Others Number Of Decontaminated: 0
Others Number Of Injuries: 0

Others Number Of Injuries : Others Number Of Fatalities : Vehicle Make/year :

0 Not reported Not reported Not reported

Vehicle License Number : Vehicle State : Vehicle Id Number : CA/DOT/PUC/ICC Number : Company Name :

Not reported Not reported Not reported

Reporting Officer Name/ID : Report Date :

STEVEN T. RHODES 29-NOV-90

Comments : Facility Telephone Number :

Yes 209 445-3271

Waterway Involved : Waterway :

Not reported Not reported Not reported Not reported Not reported

Cleanup By : Containment : What Happened : Type : Other :

Spill Site:

Not reported Not reported Not reported Not Reported 19-JUN-91

E Date : Contained : Site Type :

Substance:

Not reported Not reported

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

1000316143

TWINING LABORATORIES INC (Continued)

Not reported Evacuations: Not reported Num Of Injuries: Not reported Num Of Fatalities: Not reported Date/Time: 88-92 Year: Not reported Agency: Not reported BBLS: Not reported Cups: Not reported CUFT: Not reported Gallons: Not reported Grams: Not reported Pounds: Not reported Liters: Not reported Ounces: Not reported Pints: Not reported Quarts: Sheen: Not reported Not reported Tons: Not reported Unknown: Not reported Description: Not reported Incident date: Not reported Admin Agency: Not reported OES date: Not reported OES time: Not reported OES notification:

CUPA:

Facility ID: Region:

Amount:

FA0004971

CUPA

Program Element: FORMER CONTAMINATED SITE/CLEANUP COMPLETE

Not reported

TWINING LABORATORIES Owner Name:

466-082-04 APM Number:

Facility ID:

FA0004971

Region:

CUPA Program Element: UST REMOVAL/CLOSURE W/1 TANK

Owner Name: TWINING LABORATORIES

APM Number:

466-082-04

Facility ID:

FA0004971

Region:

CUPA

Program Element: CLOSED HAZARDOUS WASTE TREATMENT UNIT TWINING LABORATORIES

Owner Name: APM Number:

466-082-04

Facility ID:

FA0004971

CUPA Region:

Owner Name:

Program Element: SMALL QUANTITY GENERATOR TWINING LABORATORIES

APM Number:

466-082-04

Facility ID:

Region:

FA0004971 **CUPA**

Program Element: MEDIUM HAZARDOUS MATERIALS HANDLER

Owner Name:

TWINING LABORATORIES

APM Number:

466-082-04

EPA Waste Codes Addendum

Code	Description
D001	IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
D002	A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
D005	BARIUM
D007	CHROMIUM
D008	LEAD
D018	BENZENE
D039	TETRACHLOROETHYLENE
D040	TRICHLOROETHYLENE
F003	THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F005	THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
U019	BENZENE (I,T)
U025	DICHLOROETHYL ETHER
U025	ETHANE, 1,1'-OXYBIS[2-CHLORO-

EPA Waste Codes Addendum

Description
ETHANE, 1,1-DICHLORO-
ETHYLIDENE DICHLORIDE
1,2-DICHLOROETHYLENE
ETHENE, 1,2-DICHLORO-, (E)-
ETHENE, TETRACHLORO-
TETRACHLOROETHYLENE